


T. 141 R. 28 M. 5th Coordinates: X _____ Y _____
E11419 Corner common to sections 19, 20

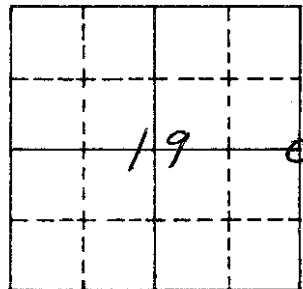

○ = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
 Original monument Post
1 CH. S. OF N. EDGE 2 CH LONG SWAMP

Bearing Trees

Species W. Pine
 Diameter 18"
 Bearing N38E
 Distance 118 LKS

Original Evidence Found

Year of search _____ By _____
 Monument found _____

Original Bearing Trees Found

Species _____
 Diameter _____
 Bearing _____
 Distance _____

Subsequent Corner Restoration

Year surveyed 1916 By E. B. Horst
 Location filed COUNTY BOOK "B" P. 384-390
 Monument SET 2 1/2 x 48" CAPPED MONUMENT
1917, E. B. HORST, BOOK "C" P. 528 FND 2 1/2 x 48" I.M.
also on microfilm - roll 115 BK 77 P. 106
1916 - also on microfilm - roll 115 BK 77 P. 84

Bearing Trees, Reference Objects

Species _____
 Diameter _____
 Bearing _____
 Distance _____

Evidence of Subsequent Corner Restoration

Year of search 1918 By GLO
FILED AT: SECRETARY OF STATE FND 2" GALV. I.P.
SET 1 x 3/8" I.P. w/ BRASS CAP
114
519/520
1918

Bearing Trees, Reference Objects

J. PINE R. OAK
8" 5"
N21 1/4 E N37 W
136 LKS 128 LKS

Subsequent Corner Restoration

Year surveyed _____ By _____
 Location filed _____
 Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CERTIFICATE - BILL OKERMAN - 1973
1992 Certificate - Terry L. Freeman, RLS 21367
Doc. # 341349
found 2" GLO brass cap and County
iron pipe next to each other. Ties: "5"
Red Oak N 37 W 83.71' (dead); Birch
stub N 12 W 54.18'; 6" Birch N 14 E 84.73';
Jack Pine snag N 21 E 89.49'; Red Oak
stump N 54 E 41.39'; 6" Maple S 27 E
208.26'.

Remonumentation certificate prepared _____
 Filed at _____

By _____
 Date _____