


Index No. R1

CASS COUNTY LAND CORNER RECORD

F. 141 R. 31 M. SW Coordinates: X _____ Y _____
NW 30 Corner common to sections 19, 30

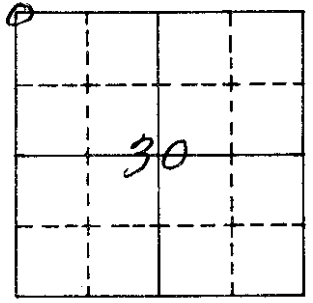

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871

Original monument POST

Species	Bearing	Trees	
<u>ASPEN</u>	<u>ASPEN</u>	<u>W. PINE</u>	<u>W. PINE</u>
<u>9"</u>	<u>9"</u>	<u>6"</u>	<u>6"</u>
<u>N80E</u>	<u>S65E</u>	<u>S43W</u>	<u>N70W</u>
<u>13LKS</u>	<u>16LKS</u>	<u>19LKS</u>	<u>10LKS</u>

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found

Species	Diameter	Bearing	Distance

Subsequent Corner Restoration

Year surveyed 1921 By E.B. HORST

Location filed COUNTY RESURVEY "E-54"

Monument 1 Row Monument

1921, E.B. HORST, Book "2" P. 445 Fwd 2 1/2 x 4 1/8" Iron w/ cap

Set by Hubbard Co. From U.S. BTS

Evidence of Subsequent Corner Restoration

Year of search 1967 By DNR-Engineering

Map notes in file

Found C.P. in place

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance

Bearing Trees, Reference Objects

<u>oak</u>	<u>7"</u>	<u>NNE</u>	<u>52.45'</u>
<u>C.F.P.</u>	<u>E</u>	<u>E</u>	<u>16.52'</u>

Nail & Bottle Caps

Subsequent Corner Restoration

Year surveyed 1984 By Tony Kerick

Location filed Certificate of Location

Monument End 1 1/2" I.P. and the 2-1967 ties

Set 2 1/2" I.P. w/ brass cap

<u>12" Tw. oak</u>	<u>N17E</u>	<u>75.99'</u>
<u>8" W. oak</u>	<u>N38E</u>	<u>130.09'</u>
<u>14" J. Pine</u>	<u>N62E</u>	<u>74.02'</u>
<u>C.F.P.</u>	<u>N70E</u>	<u>16.82'</u>
<u>8' Steel posts</u>	<u>E 2.34'</u>	<u>S 3.0'</u>

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Certificate - Tony Kerick - 1984 Doc. # 280483

Aug. 1919, Twp rd order shows no survey

Remonumentation certificate prepared _____ By _____

Filed at _____ Date _____