


T. 144 R. 25 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 33 Corner common to sections 27,28,33,34

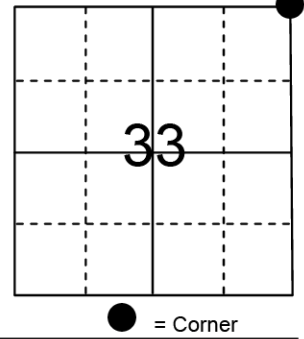

EXISTING SURVEYS

Original Government Survey

Year surveyed 1876  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species	Balsam	Balsam	Balsam	Maple
Diameter	<u>8"</u>	<u>10"</u>	<u>7"</u>	<u>5"</u>
Bearing	<u>N 38° E</u>	<u>S 52° E</u>	<u>N 45° W</u>	<u>S 39° W</u>
Distance	<u>12 links</u>	<u>6 links</u>	<u>14 links</u>	<u>23 links</u>

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 12/1983 By J.R. Worcester, CCHD  
Location filed: S.P. 11-603-07  
Monument:  
Indicates corner assumed on centerline at Station 339+11.5

Evidence of Subsequent Corner Restoration

Year of search 5/1984 By J.H. Parker, LS 9235  
Location filed: Certificate of Location  
Monument: Found 2" x 31" iron pipe  
Excavate a 4'x 4' hole, found iron pipe, down 0.5'.

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 9/1984 By J.H. Parker, LS 9235  
Location filed: Certificate of Location  
Monument: Set 5/8"x 36" aluminum rod monument with cap,  
down 0.3', 2' north of the south edge of bituminous and  
witnessed.  
6" Maple, N 57° W, 144.26'  
10" Birch, N 44° E, 143.84'  
6" Birch, S 47° E, 79.63'  
10" W. Pine, S 43° W, 143.32'  
  
7/2011, CCHD/SO  
#2011.015  
Set P.K. nail from 1984 witnesses and recovered 1/4 corners  
E. and W., 9'+, - S. of center line CSAH #3 and witnesses as  
follows.  
14" W. Pine, S 43° W, 143.32'(1984) 20d nail, up 2.4', S. side  
11" Birch snag, N 44° E, 143.84'(1984) 20d nail, up 2.4', W.  
8" R. Oak, N 30° W, 104.62' duplex nail, up 1.0', E. side  
6" B. Oak, N 46° E, 123.01' duplex nail, up 1.0', N. side  
10" R. Oak, S 38° E, 107.81' duplex nail, up 1.0', S. side  
Steel post, South, 62.7'(1984)  
  
8/2011, CCHD/SO  
#2011.015  
Set Mag nail from witnesses after construction 8' +, -, S. of new  
center line CSAH #3.

Evidence of Subsequent Corner Restoration Found

Year of search 10/2017 By CCHD/SO  
Location filed: #2017.017  
Monument: Found the 2011 concrete nail  
in good condition, 8', +/-, S. of centerline CSAH #3, 1984 and  
2011 witnesses in good condition.  
  
7/2019, CCHD/SO  
#2017.017  
Replaced Conc. nail with Alum. Co. mon., down 0.05', 8', +/-, S.  
of centerline CSAH #3. 1984 and 2011 witnesses good.  
  
7/2019, T.L. Freeman, LS 21367  
Certificate of Location, A000651791  
Filed on the above information.

Species  
Diameter  
Bearing  
Distance

Bearing Trees, Reference Objects

Monument

Location filed

By

Year surveyed

Subsequent Corner Restoration

Distance

Bearing

Diameter

Species

Species	Balsam	Balsam	Balsam	Maple
Diameter	8"	10"	7"	5"
Bearing	N38E	59SE	N45W	53SW
Distance	12LKS	6LKS	14LKS	23LKS

Original monument lost  
Year surveyed 1876

Original Government Survey

EXISTING SURVEYS

Original Evidence Found

Year of search By

Monument found

Original Bearing Trees Found

Distance

Bearing

Diameter


Species

Evidence of Subsequent Corner Restoration

Year of search By

Bearing Trees, Reference Objects

O = Corner

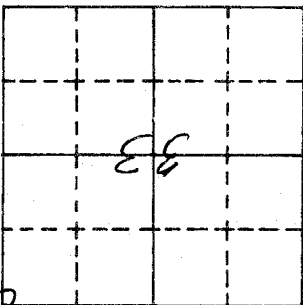

CASS COUNTY LAND CORNER RECORD

Index No. V13

T. 144 R. 25 M. 57H Coordinates: X 2728'33.34 Y

Corner common to sections NE 33

Evidence of Subsequent Corner Restoration Found

Year of search By

Subsequent Corner Restoration

Year surveyed By

Location filed

Monument

Certificate - Jim Parker - 1985  
 Fnd 2x31" I.P. - set 5/8" x 36" aluminum rod w/ cap  
 10" Birch N44°E 143.84'  
 6" Birch 547°E 79.63'  
 10" w. Pine 543°W 143.32'  
 6" Maple N57°W 144.26'  
 Doc. # 281976

Remonumentation certificate prepared

By

Filed at

Date

V-13