


T. 144 R. 29 M. 5TH Coordinates: X _____ Y _____
NE 22 Corner common to sections 14, 15, 22, 23

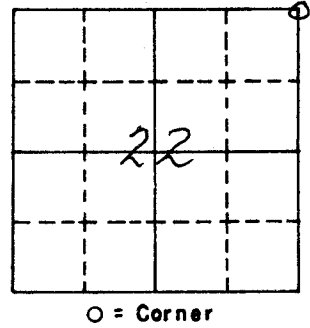

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Species	Bearing	Tree	Distance
<u>Maple</u>	<u>7"</u>	<u>Maple</u>	<u>11 LKS</u>
<u>Maple</u>	<u>6"</u>	<u>Lin den</u>	<u>17 LKS</u>
<u>Maple</u>	<u>13"</u>	<u>Maple</u>	<u>10 LKS</u>
<u>Maple</u>	<u>3"</u>	<u>Maple</u>	<u>12 LKS</u>

Original Evidence Found

Year of search _____ By _____
Monument found _____

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1906 By JOHN CURO
Location filed COUNTY SURVEY RECORD BOOK A P. 222-223
Monument SET OAK STAKE FROM OLD GROUT B. T. 7" MAPLE N55W 7.3', 13" LIND S21W 11.9', 6" MAPLE S56E 11.2', 3" MAPLE N23W 7.9'

Evidence of Subsequent Corner Restoration

Year of search 1926 By GLO
Find decayed wood Stake in NE & NW BTS - Now 10" & 8"
Set 2x36" 1/2" wild brass cap
TM4 N R29W
515 514
522 523
1926

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Bearing Trees, Reference Objects

<u>Maple</u>	<u>Elm</u>
<u>12"</u>	<u>12"</u>
<u>531-15E</u>	<u>529-45W</u>
<u>98 LKS</u>	<u>96 LKS</u>

Subsequent Corner Restoration

Year surveyed 1916 By E. B. HEST
Location filed microf. film - roll 105 BK546 P. 25
Monument Find 2 BITS standing - one down and stump of 4th BIT set true corner new BITS:
10" Maple N34E 21'
10" Basswood N41W 21.2'
9" Maple S63 1/2 W 32.7'
10" Maple S56 1/2 E 45.3'

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CERTIFICATE - PETE MEYER - 1963
Found GLO monument in good condition
11" Elm N11W 37.55'
6" Maple S44E 8.4'
8" Elm S11W 53.75'