

CORNER  
RESTORATION  
T14IN R25W



MINING  
TRANSIT BOOK

No. 384F

BOOK #1

CORNER RESTORATION T14IN R25W

Original Govt. Survey by  
ALLEN and PUTMAN IN 1871

USFS Book #1

T141N R25W 5th. PM.

CASS COUNTY

61	62	63	64	65	66	67	68	69	70	71	
6	5	72	4	48	3	32	2	16	1	73	
		75	46	47	30	31	14	15	76		
77	7	8	74	9	45	10	29	11	13	12	78
			43	44	27	28	11	12	79		
18	17	57	16	42	15	26	14	10	13		
		56	40	41	24	25	8	9			
19	20	55	21	39	22	23	23	7	24		
		53	54	37	38	21	22	5	6		
30	29	52	28	36	27	20	26	4	25		
		50	51	34	35	18	19	2	3		
31	32	49	33	33	34	17	35	1	36		
			60	58	59						

Colored numbers refer to page  
on which notes for that corner  
may be found.

1

1/4 Cor. Sec. 35-36

orig. notes: Birch 10" S76°E 27 Lks

Spruce Pine 8" N88W 21 Lks

2

Sec. Cor. 25, 26, 35-36

Orig. Notes: Spruce 10° N23E 17 Lks

Spruce 18° S80E 32 Lks

Birch 19° S42W 15 Lks

Birch 8° N50W 8 Lks

3

1/4 Cor. Sec 25-36

Orig. Notes: Cedar 5" N4°E 23 LKs

Birch 8" S55E 16 LKs

4

1/4 Cor. Sec 25-26

Orig. Notes: Fir 8" SB1E 16 LKs

Tamarac 6" N72W 23 LKs

5

Sec. Cor. 23-24-25-26

Orig. Notes; Tamarac 16" S89E 14 LKs

Spruce 6" N23E 29 LKs

Spruce 6" N50W 18 LKs

Cedar 5" S20W 26 LKs



1/4 Cor. Sec. 24-25

Orig. Notes: Cedar 8" S50E 11 LKs or

Cedar 6" N80E 6 LKs or

1/4 Cor. Sec. 23-24

Orig. Notes: Maple 7" S27E 5 LKs

Fir 6" S72W 22 LKs

Sec. Cor. 13-14-23-24

Orig. Notes: Fir 6" S74E 11 Lks.

Birch 10" N50E 42 Lks.

Birch 12" N30W 5 Lks.

Fir 6" S65W 14 Lks.

9

1/4 Cor Sec. 13-24

Orig. Notes: Birch 8" N57E 26 LKs

Maple 7" S70E 20 LKs

10

1/4 Cor. Sec 13-14

Orig. notes: Birch 10" N35W 8 LKs

Birch 10" S41E 22 LKs

11

Sec. Cor 13-14-11-12

Orig. Notes: Elm 11" S62E 31 LKs

Birch 8" S44W 12 LKs

Cedar 16" N37 $\frac{1}{2}$ W 28 LKs

Birch 7" N20E 53 LKs

12

1/4 Cor. Sec 12-13

Orig. notes: Fir 5" SW 17 LKs

Birch 11" N1/4W 3 LKs

31

13

1/4 Cor. Sec. 11-12

Orig. notes: Birch 4" N32W 14Lks

Maple 8" N41E 4Lks



14

Sec. Cov. 1-2-11-12

Orig. Notes. Maple 6" S70W 12 LKs

Maple 8" N41W 28 LKs

Maple 6" N33E 24 LKs

ELM 4" S38E 26 LKs.

15

1/4 Cor. Sec. 1-12

Orig. Notes: W. Pine 10" N34E 11 Lks.

W. Pine 6" S62E 8 Lks.

16

$\frac{1}{4}$  Cor. Sec. 1-2

Orig. notes: W. Pine 8" East 13 Lks

W. Birch 6" 560 W 15 Lks.

17

1/4 Cor. Sec. 34-35

Orig. notes: Spruce 8" N74W 10 LKs

Spruce 8" N47E 12 LKs

18

Sec. Cor. 26-27-34-35

Orig. Notes: Spruce 9" N74E 36 LKs.

Spruce 10" S2E 58 LKs

Aspen 8" S40W 65 LKs

Willow 5" N74W 12 LKs

19

1/4 Cor. Sec. 26-35

Orig. notes: Spruce pine 12" S80E 49 LKs

Spruce pine 14" N20E 21 LKs

1/4 Cor. Sec. 26-27

Orig. notes: Birch 10" N82W 20 LKs

Linden 6" N40E 25 LKs.

21

Sec. Cor. 22-23-26-27

Orig. Notes: W. Pine 16" S68W 284Ks.

Aspen 15" N55W 284Ks

Spruce 22" N71E 54Ks

Spruce 7 S24E 474Ks



22

1/4 Cor. Sec. 23-26

Orig. Notes: Spruce 4" S18W 46 LKS

Tam. 7" NBOW 25 LKS.

23

1/4 Cor. Sec. 22-23

Orig. Notes: Tam. 5" S 2° E 19 LKs.

Spruce 5" N 47° W 19 LKs

24

Sec. Cor. 14-15-22-23

Orig. notes: Tam 8" N52E 9 Lks.

Tam 9" S42E 7 Lks

Tam 10" N40W 4 Lks

Tam 5" S12W 10 Lks

1917 J.H. Flynn SURVEY RECORD # 377

Found BOOK C Pg 32

Tam (Down), N52°E, 9 lks

Tam stub, 9", S42°E, 7 lks

Tam stub, 10", N40°W, 4 lks

Tam stub, 5", S12°W, 10 lks

New BT's

Tam, 12", N25°E, 47.4 ft

Tam. stump, 8", S18°W, 23.0 ft

1941 R. Delant

Found CEDAR Post

Metal LOCATION POSTER ON

TREE North .55 chns

1914.00

2178.00  
Creek 15 lks wide

1/4 Cor. Sec. 14-23

Orig. Notes: Cedar 8° N15° E 13 LKs

Fir 7" S46W 12 LKs

1917 J. H. Flynn SURVEY RECORD # 377

Found post & BT's BOOK C Pg 32

Cedar, 10", N15° E, 13 LKs

Fir, 7", S46° W, 12 LKs

Large Boulder, West end, 13.2 ft south of post

August 5, 1985 G. Kosenko, G. Robertson

Found large boulder that was referenced to in 1917. It is the only large boulder in the area.

Found no traces of any BT's or post. At record bearing and dist. from the boulder we set a 2 1/2 inch outside diameter by 5 foot long galvanized iron pipe with a magnetic breakable bottom and a 3 inch diameter domed brass cap stamped

up 18 inches



# CERTIFICATE FILED

from which

W. Birch, 8.2 in, S75° E, 60.85 ft to a 1/2" nail in North face, double blaze, scr: "1/4 523 BT" w/ 60d spike  
1917 Large boulder, 7 ft x 5 1/2 ft, south, 13.20 ft to NW corner of boulder. It is 2 1/2 ft high  
Sugar Maple, 7.1 in, N 08° W, 35.54 ft to a 1/2" nail in east face double blaze, scr: "1/4 514 BT" w/ 60d spike

8 ft metal fence post, South, 3.0 ft. w/ 54-2

8 ft metal fence post, East, 3.0 ft w/ 54-2 + 54-9

All BTs painted red with red ring

26

1/4 Cor. Sec. 14-15

Orig. notes: Spruce pine 18°N75E 6 Lks. (3.96)

Spruce pine 20°N50W 7 Lks. (2.64)

27

Sec. Cor 10-11-14-15

Orig notes: Birch 4" SB2W 5 Lks

Birch 5" S72E 29 Lks,

Birch 9" N13E 20 Lks,

Birch 7" N63W 16 Lks.

28

1/4 Cor. Sec. 11-14

Orig. Notes: Birch 10" S5W 5 Lks

Hsh 6" N82E 16 Lks.

29

1/4 Cor. Sec. 10-11

Orig. notes: Tam. 5" N22W 21 Lks.

Dead Tam. 4" S 16 1/2 E 10 Lks.



30

Sec. Cor. 2-3-10-11

Orig. Notes: Fir 6" N20E 4 LKs

Birch 4" N40W 3 LKs.

Birch 10" S25W 23 LKs

Fir 6" S27E 12 LKs

31

1/4 Cor. Sec. 2-11

orig. Notes: Birch 6" N1°W 15 Lks

Cedar 19" S93E 10 Lks.

Specimens Taken June 24, 1985

32

$\frac{1}{4}$  Cor. Sec. 2-3

Orig. notes: Tamarac 4" West 12 Lks.

Tam 8" S80E 10 Lks

33

33

1/4 Cor. Sec 33-34

Orig. Notes: Cedar 6" S65E 18 LKs

Cedar 10" S35W 52 LKs

Sec. Cor 27-28-33-34

Orig. Notes: Maple 6" N75W 4 LKs.

Maple 6" N18E 43 LKs.

Ash 7" S45W 57 LKs

Linden S54E 35 LKs

1913 J. H. Flynn SURVEY RECORD # 378

Found all Gov't BT's BOOK C  
Pgs. 36-38

35

1/4 Cor. Sec. 27-34

Orig. notes: Spruce pine 12" N50E 14 Lks

Spruce pine 12" S22W 28 Lks

36

1/4 Cor. Sec. 27-28

Orig. notes: Tamarac 4" S60W 14 Lks

Tamarac 5" S75W 23 Lks

1913 J.H. Flynn SURVEY RECORD #378

Found BOOKC Pg. 36-38

Down Tam, 5", S75°W, 23 Lks

New BT's

Tam, 4", S87°W, 38.7 ft

Tam, 5", N80°E, 39.0 ft

Sec. Cor. 21-22-27-28

Orig. Notes: Spruce pine 12" S14W 12 Lks

Fir 8" S53E 47 Lks.

Cedar 10" N50W 20 Lks.

Fir 5" N40E 29 Lks.

1913 J. H. Flynn SURVEY RECORD # 378  
Found BOOK C Pgs. 36-38

Pine stump, 16", S14°W, 12 Lks

Cedar, 12", N50°W, 20 Lks

New BT's

W. Pine, 16", N61°E, 34.0 ft

Cedar, 15", N72°W, 39.0 ft.

June 13, 1985 G. Kosanko G. Robertson  
Recovered no evidence here that  
could prove this corner without  
a traverse.



1/4 Cor. Sec. 22-27

Orig. Notes: Spruce 6" N35W 4 Lks.

Spruce 6" S20E 15 Lks.

1/4 Cor. Sec. 21-22

Orig. Notes: Spruce 10" N35W 11 Lks.

Cedar 10" N78E 19 Lks.

1913 J. H. Flynn

Found

Spruce stump, 10", N35°W 10 lks

Cedar, 10", N78°E, 19 lks

New BT's

Cedar, 11", S86°E, 25.0 ft

Cedar, 12", S89°W, 25.0 ft

Minnesota Department of Transportation  
#200 highway plans -  
corner lies ±100 feet south  
of a P/W on curve

June 13, 1985 G. Kosanko, G. Robertson

Find a Cedar stump in the NE quad.  
No scribing visible. Could not find  
anything else. Measured from the  
stump and fell on the west side of  
old road. Will try to verify this  
stump with a traverse

# CERTIFICATE FILED

1935 HMK

Found Cedar snag <sup>10"</sup> 4' high with  
1/4 521

41 chs From North  
.5 chs WEST

July 24, 1985

The stump that was found June 13, 1985  
checks out to be within 0.10 feet of  
the proper location according to the 1913  
survey. We accept this as the SE (1913)  
bearing tree and monument the corner  
as follows:

Angle + Distance to set corner from traverse:

STA	1 <sup>st</sup> HAD	2 <sup>nd</sup> HAD	H. Dist

FS 2302 328-09-51 148-10-00

BS 22 00-00-00 180-00-00

TA@ 23 328-09-51 328-10-00

328-09-56

4.62

See BK 2 pg 78

Sec. Cor. 15-16-21-22

Orig. Notes: ASPEN 26" N52W 15 LKS

FIR 10" S60W 29 LKS.

FIR 6" S13°E 26 LKS.

Spruce 12" N70E 14 LKS

1913 J.H. Flynn

Corner in Center of road

Found Aspen &amp; NE BT, Set past

W. Pine stump, 20", N61°E, 42.0 ft

Large Boulder, 36", N49½°W, 37.5 ft

June 13, 1985 Recovery by: G. Kosenko  
G. Robertson


Found a boulder marked  
"S 16" on it. Also recovered  
a large W. Pine stump hole. These  
two witnesses pull to a common  
point in the middle of road & is.  
This is a Gov't corner

July 1, 1985, G. Robertson B. Ausk  
Set a 2 ft long by 2½ in O.D.  
Concrete filled galvanized iron  
pipe with a 3 in. dia. brass  
cap stamped as shown:

## CERTIFICATE FILED

Under old road surface

0.8 ft.

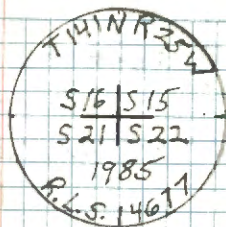

Decl.

5° East

From which:

Birch, 6.7" N41°E, 40.03 ft. to a 16d nail in the SE face  
~~NOW A WEND FALL~~  
double blazed, scribed "S15 BT" w/60d spike

Birch, 5.6" S45°E, 33.42 ft. to a 16d nail in the NE face,  
~~LOGGED OFF~~  
double blazed, scribed "S22 BT" w/60d spike

Maple, 5.3" S43°W, 79.20 ft. to a 16d nail in the NW face  
~~NOW 10" GOOD SHAPE~~  
double blazed, scribed "S21 BT" w/60d spike

1913 Boulder, 2.5' x 2.5', N42°W, 37.5 ft. to "S 16" on  
boulder

All TREES painted with Rings

CORNER FALLS in old Road bed N+S+E

CENTER LINES

07-28-2009 R. MAIN  
FD IRON IN PLACE AND GPS. FD ONE NEW TIE  
BY CASS COUNTY.

R. OAK 14" N70°W 26.81 FT TO DOUBLE HEAD NAIL  
BT BY BH ON 5/04

41

1/4 Cor. Sec. 15-22

orig. notes: Tamarac 8" S20W 16 Lks

Tamarac 7" N15W 7 Lks.

1917 J. H. Flynn SURVEY RECORD # 377

Found: BOOK C Pgs 32

Tam stub, 9" , S20°W, 16 lks

Tam stump, N15°W, 7 lks

New BT's

W. Pine, 10" , N22°E, 33.7 ft

Tam stump, 15" , S32°W, 27.4 ft

42

L-13

 $\frac{1}{4}$  Cor. Sec 15-16

orig. notes: Tamarac 8" N30E 12 LKs

Tamarac 10" N54W 18 LKs

1913, J.H. Flynn

Found:

Tam stump, 8", S50°E, 12 LKs

Tam stump, 10", N54°W, 18 LKs

New BT's

Cedar, 6", N63°W, 35.6 ft

Spruce, 7", N82°E, 37.1 ft

1935 HMK 874-9

Cedar snag 5" N72°W 30' ±

4 1/2 ft high

Metal Location Poster

Aspen 4" N72°E 36.3'


Tag on west side of tree

August 1, 1985 Recovery by G. Kosenko, B. Ansk

To set this corner I did a bent line proportion to control the northings and used the centerline of the old road to place the monument.

## CERTIFICATE FILED

We located the position for this  $\frac{1}{4}$  corner as follows:

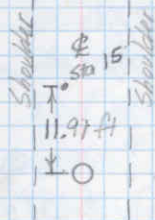

Corner is set in the E of the old road.

Angle to Distance to Corner Position (1502)  
 STA 1<sup>st</sup> H&D 2<sup>nd</sup> H&R H. Dist  
 H &

FS 1502 355-29-50 170-59-05

BS 14 00-00-00 175-29-50

TO 16 355-29-50 355-29-15

11.93

Set a 2 ft long by 2 1/2 inch outside diameter aluminum pipe with a 3 inch diameter aluminum cap stamped as shown, 0.5 ft below the road surface (swamp). Placed a magnet in bottom of the hole.



See BK 2 page 77

Sec. Cor. 9-10-15-16

Orig. Notes: Fir 10" S15E 28 Lks

Aspen 10" S63W 22 Lks

Birch 8" N46E 17 Lks

W. Pine 10" N27W 19 Lks

1913 J.H. Flynn SURVEY RECORD # 378

Found old Gov't BT's:

BOOK C  
Pgs. 36-38

W. Pine stub, N27°W, 14 Lks

Rotten Fir stump, 10", S15°E, 28 Lks

New BT's

W. Pine stump, 15", S25½°E, 56.5 ft

Dry Cedar, 10", N72°E, 39.5 ft

June 18, 1985 G. Kasenko G. Robertson

Searched for all BT's but found none. Also dug a hole 3 ft diameter by 2½ ft deep at a point 256 ft east of N¼ corner of S. 16. This fell in the middle of an intersection. Did not find any post.

This corner was set at the intersection of the road running west and south in 1913 by J.H. Flynn. We then

## CERTIFICATE FILED

measured east from the N. ¼ of S. 16 and fell within 0.35 feet. Measured north from SE section corner of S. 16 and fell within 2.50 feet. Knowing this we use the ¼'s and evidence to the corner and monument this point as follows;

July 25, 1985 G. Robertson B. Ausk

Set a 2 ft long by  $\frac{2.5}{2.7}$  in. O.D. aluminum monument with a  $\frac{3}{8}$  in. aluminum cap stamped as shown:

1.2 ft below road surface

Decl. 5° East



From which:

W. Oak, 8.5", N45°E, 125.70 ft. to a 16d nail in the NW face double blazed, scribed "S10 BT" w/60d spike

Birch, 9.5", S60°E, 72.13 ft to a 16d nail in the NE face double blazed, scribed "S15 BT" w/60d spike

Birch, 6.3", S69°W, 61.89 ft to a 16d nail in the SE face double blazed, scribed "S16 BT" w/60d spike

W. Oak, 6.7", N35°W, 87.83 ft to a 16d nail in the SW face double blazed, scribed "S9 BT" w/60d spike

All BT's painted red w/red ring

Placed 2 red+blue magnets in the bottom of hole

44

1/4 Cor Sec. 10-15

Orig. notes: Tamarac 10" N26W 18 Lks. (11.22')

Tam. 18" S80E 8 Lks. (5.28')

1941 R. DeFANT

Found scribed CEDAR Post

Both ORIGINAL TREES

Metal Location PASTER ON

Birch 7" N61°E 7.90'

TAG ON SW SIDE OF TREE

45

1/4 Cor. Sec 9-10

orig. notes: Birch 22" S67W 5 Lks.

Maple 6" S60E 8 Lks.  
maybe S50E writing is poor



46

Sec. Corner 3-4-9-10

orig. notes: W. Pine 30" N47W 33 Lks.

W. Pine 26" N23E 55 Lks.

W. Pine 18" S74E 110 Lks.

Fir 8" S85W 15 Lks.

47

1/4 CORNER 3-10

ORIG. NOTES: FIR 7" S3E 12 LKS.

W. PINE 16" N2E 13 LKS.

78

1/4 Cor. Sec 3-4

orig. notes: Cedar 4" West 74 Lks

Cedar 6" N80E 18 Lks.

49

1/4 Cor. Sec. 32-33

Orig. Notes: Fir 4" N40E 28 Lks

Fir 8" N45W 30 Lks.

50

Section Corner 28-29-32-33

Orig. notes: Tam. 10" N47W 15 LKs

Birch 12" S40W 44 LKs

Tam. 9" S40E 12 LKs

Tam. 16" N20E 27 LKs

51

1/4 Cor. Sections 28-33

Orig. Notes; Maple 4" East 50 Lks.

Fir 6" West 17 Lks.

384 5076

52

1/4 Cor. Sec. 28-29

Orig. Notes: Cedar 10" S80W 10 LKs.

Cedar 12" S3E 10 LKs.

52

53

Section corner 28-29-20-21

orig. notes: Tamarac 10" N45 $\frac{1}{2}$ W 22 LKs

Tamarac 12" S47W 12 LKs

Tamarac 8" S10E 10 LKs

Tamarac 12" N19E 33 LKs



54

1/4 Cor. Sections 21-28

Orig. notes: Tamarac 4" East 10 Lks

Cedar 4" West 8 Lks.

1913 Cass County Road Survey  
Found original corner and  
set:

W. Birch, 10", S12°W, 7'3"

B. Ash, 5", N56°E, 8'

55

1/4 Cor Sec. 20-21

Orig. Notes: Cedar 7" S63W 45 LKs

Cedar 10" S83E 30 LKs

56 CONT ON BK#4 Pg#4

Section Cor. 16-17-20-21 N-9

Orig. Notes: Spruce 8" N73W 14 LKS (9.24H)

Fir 10" S30W 16 LKS

Fir 6" S32E 52 LKS (34.32)

Birch 7" N55E 21 LKS (13.86)

May 28, 1920

Curo Notes BK#162

Find: Spruce

8"

N73°W

14 lks

"BT"

A Fir

sp mld

"BT"

W. Birch

7"

N55°E

21 lks

"BT"

June 6, 1920

Set a 2 1/2 foot long, 3 inch diameter iron pipe w/ cap stamped S16 17 20 21 w/ 2 60d spikes in bottom with a mound of stone

June 5 1985 Recovery by G. Kosenko

B. Ausk

G. Robertson

Recovered a 2 1/2 inch outside diameter galvanized iron pipe with a pipe

# CERTIFICATE FILED

cap 3 inch diameter and stamped as

shown, up 8 inches

17 16

20 21

Look for the original BT's but couldn't recover any.

1940 R DESANT

Found IRON PIPE

METAL LOCATION POSTER ON ASPEN 5" N52°W .35 chs

July 1, 1985

G. Robertson

R. Feltus (M.E. E.D.)

New BT's

Aspen, 6.8", N 55° E, 25.90 ft to a 16d nail in NW face double blazed, scribed "S16 BT" w/ 60d spike  
Birch, 3.7", S 03° E, 32.70 ft to a 16d nail in W face double blazed, scribed "S21 BT" w/ 60d spike  
Aspen, 6.6", S 28° W, 9.60 ft to a 16d nail in SW face double blazed, scribed "S20 BT" w/ 60d spike  
Aspen, 5.7", N 21° W, 11.50 ft to a 16d nail in SW face, double blazed, scribed "S17 BT" w/ 60d spike  
Carsonite Boundary Marker, North, 3.0 ft  
Carsonite Boundary Marker, West, 2.0 ft  
All BT's painted red with red ring

1/4 Cor Sec 16 1/7

Notes of Raymond T DeFont  
Jan. 23, 1940

Found: Iron pipe 12" above ground  
Fence cor post with F.S.L.P.  
County Corner (Probable)?

I searched for cor and found  
a 2" Iron pipe bent over under  
power line, also found old rusty  
F.S.L.P. 6" below ground at corner  
site,

I put up F.S.L.P. on 14" Aspen  
S 62° W 9.7' from cor

7/2/76

Notes of Orig. Govt. survey 1871

Set wood post

Tam. 10 S 50 E 28 lks. = 18.5'

Tam. 6 S 60 W 24 lks. = 15.8'

# CERTIFICATE FILED

June 6, 1920

Find old post

Set iron pipe, 4 ft. long, 2 in. diameter 2 ft.  
in ground

January 23, 1940

Find iron pipe 12 inches above ground  
Fence corner post with F.S.L.P.

July 2, 1976

Find 2 in. iron pipe bent over under power  
line and old rusty F.S.L.P. 6" below ground  
Aspen, 14", S 62° W, 9.70 ft

June 5, 1985 Recovery by: B. Ausk

G. Kosenko

G. Robertson

Found a 2" outside diameter rusted iron  
pipe bent over, a road R W post is  
next to it. No bearing trees were  
recovered here. Also found an old  
fence corner post under the ground  
next to the I.P. We dug up the I.P.  
and found it to be 4 ft long. This is  
the 1920 I.P. Made 2 temp ties  
Aspen, 12", N 30 E, 58.20  
Aspen, 7", S 11 W, 21.30

See BK 2 Pg 76

58

T141N R25W

Original Government Survey  
Set wood post from which:

Tam , 15" , N73°E , 25 lbs

Tam , 5" , N72°W , 14 lbs

59

T14N R25W SE Sec Cor 34

Original Government Survey

Red Elm, 9" , N75°E, 10 lbs

Willow, 2" , N43W, 34 lbs

60

T14N R25W SW Sec cor 34  
Original Government Survey

Birch, 8", N55°E, 36 lbs

Ash, 6", N40°W, 27 lbs

T141N R25W NW Sec. Cor. 6  
Original Gov't Survey

Dead Tamarack	4"	N43°E	9.90 ft
" " "	3"	N21°W	21.12 ft
" " "	3"	S54°W	38.94 ft
" " "	5"	S38°E	15.18 ft

SEE FIELD BOOK #1 142-26  
PAGE 73 AND UPDATED INFO.  
IN FIELD BOOK #3 142-26  
PAGE 75 8/4/97



T141N R25W N $\frac{1}{4}$  Sec 5  
Original Gov't Survey

Dead Tamarack, 4", S63°E, 15.18 ft  
" " " , 7", N84°W, 22.44 ft

1922 J.H. Flynn

Found stubs of both Gov't. BT's

Set a 1 $\frac{1}{2}$ " x 44" flue pipe

Aspen, 12", south, 52 ft

T141N, R25W. Sec. Cor 5, 4, 32, & 33  
Original Govt Survey

R. Pine, 10", N06°W, 67.98 ft.

R. Pine, 8", S72°W, 122.10 ft

4-25-95 RM & CK

FROM G.P.S. POINT WE RUN S29W-375' TO  
SEARCH AREA. FOUND PINE 14" DIA. X 10' LONG  
WINDFALL WITH DOUBLE BLAZES AND SCRIBE  
ON BOTH SURFACES - T1 225 BT

THIS BT WOULD BE S72W-122.10'

AREA OF CORNER POST IS IN WILLOW + ALDER  
AND MARSH GRASS - STILL FROZEN AT THIS TIME  
WE WILL WAIT UNTIL IT THAWS OUT BEFORE  
WE SEARCH FOR ORIG. POST - THERE ARE  
OTHER STUMP IN AREA OF OTHER PINE BT  
ONCE WE FIND POST WE CAN BETTER DETER-  
MINE WHICH STUMP IS OTHER ORIG. BT.

5/15/95 R. MAIN C. KRAUSE

MADE A THROUGH SEARCH FOR ORIGINAL POST AND FOUND  
NO EVIDENCE. SET A 2" X 48" STEEL PIPE W/ 3" BRASS  
CAP ON TOP OF A 8 FT STEEL SIGN POST FROM ORIG R. PINE  
BT. MONUMENT IS 2 FT ABOVE SWAMP STAMPED  
AND WITNESSED WITH :

5/15/95 CONT

R PINE 17 1/2" N 78°W 164.5 FT TO SPR MKD: 53 2 BT

TAMARACK 12" S45°W 54.15 FT TO SPR MKD: 55 BT

TAMARACK 9" S2°E 286.0 FT TO SPR MKD: 54 BT

TAMARACK 12" S86°E 32.15 FT TO SPR MKD: 54 BT

8 FT STEEL SIGN POST 1.95 SOUTH

T141N R25W N<sup>1</sup>/<sub>4</sub> Sec 4

Original Gov't Survey

Birch, 8", S52°W, 6.60 ft

Birch, 9", N04°E, 14.52 ft

65

T141N R25W Sec. Cor. 4, 3, 33, + 34

Original Gov't Survey

Cedar	6"	S03°E	5.28 #
Birch	10"	N45°E	19.80 #
Birch	12"	N32½°W	7.92 #
Fir	8"	S77°W	18.48 #

1922 J. H. Flynn

Found cedar B.T. (Down)

Set wood post

3-19-95 RMËCK

NO EVIDENCE FD IN BK 1 PG 41

T142 R25

66

T14N R25W N $\frac{1}{4}$  Sec 3  
Original Gov't Survey

W. Pine, 8", S10°E, 3.96 ft  
Spruce, 6", N04°E, 6.60 ft

T141N R25W Sec Cor 3, 2, 34, + 35  
Original Gov't Survey

R. Pine, 8", S45°W, 4.62 ft.  
Spruce, 16", N14°W, 3.96 ft.  
Spruce, 16", N48½°E, 12.54 ft.  
Spruce, 4", S51°E, 15.84 ft.

— R. PAIRTER

Location POSTER ON  
Red. OAK 30" S 34°? 123.42  
TAG ON NE SIDE OF TREE

3-20-95 RM + CK

SEARCH IN AREA OF G.P.S. LOCATION

FOUND SPRUCE + PINE STUMPS IN AREA

THEY SHOW SIGNS OF BURN AND ARE

BADLY ROTTED - APPROX CORNER IS 60'±

WEST OF WOODS TRAIL (FR 2101N) N + S

NO EVIDENCE COULD BE FOUND AT THIS TIME

SEARCHED 1½ HRS.

68

T141N R25W N<sup>1</sup>/<sub>4</sub> Sec 2  
Original Gov't Survey

Cedar, 6", S 10° E, 5.94 ft.

Aspen, 12", N 80° W, 13.20 ft.

T141N R25W Sec Cor 2, 1, 35, & 36.  
Original Gov't Survey

W. Pine, 8" , N37°E, 10.56 ft  
Spruce, 12" , N55°W, 4.62 ft  
Cedar, 6" , S80°W, 15.84 ft  
Cedar, 4" , S34½°E, 8.58 ft

1937 T. Williams

Found scribed CEDAR

Metal Location PASTER ON

SPRUCE 6" S05°E 42.90'

TAG ON South side of TREE



T141N R25W N $\frac{1}{4}$  Sec 1  
Original Gov't Survey

Basswood, 16", N08°W, 7.92 ft

W. Pine, 8", S01°W, 3.30 ft

3-16-40 R.J. DEFANT 874-9

Fd POST IN FAIR CONDITION UP 15" PLACED TAG  
ON SAME. BELIEVES THIS TO BE A COUNTY  
CORNER. SHOWS FENCE LINE NORTH AND WEST.

5-16-95 R. MAIN C. KAUSE

Fd FENCE RUNNING WEST AND TRACES OF FENCE  
RUNNING NORTH. BELIEVE WE FOUND THE FENCE  
CORNER SHOWN FROM DEFANT DRAWING. Fd old  
blue line RUNNING NORTH. STATE CLEAR CUT  
NORTHEAST. PLACED FSLP ON 10" ASPEN FROM  
WHICH APPROX CORNER BEARS N78E, 6 ft.  
COULDN'T FIND TAG, LOGGING WAS VERY DISRUPTIVE  
IN THIS AREA.

71

T141N R25W NE Cor Sec 1  
Original Gov't Survey

Spruce, 4" , N55°W, 14.52#

Spruce, 3" , S48°W, 14.52#

72

T141N R25W  $\frac{1}{4}$  cor. Sec 5<sup>4</sup>4  
Original Gov't Survey

Tomorack, 8" , N70°E, 18.48 ft

Cedar, 6" , S48°W, 12.54 ft

73

T141N R25W E 1/4 Sec 1  
Original Gov't Survey

W. Pine, 16" , N45°W, 15.84 ft

W. Pine, 12" , S34°W, 8.58 ft

1927 Minn. Hwy. Dept. R/W map  
Corner at P.I. (old) roads

74

T141N R25W  $\frac{1}{4}$  Cor Sec 8+9  
Original Gov't Survey

Tom. , 7" S40°E, 13.86 ft

Tam. , 6" N23°W, 14.52 ft

1913 Todd & Flynn

Found both BT's at record bearing &  
distance

T141N R25W  $\frac{1}{4}$  cor Sec 4 & 9  
Original Gov't Survey

Cedar, 8" , S40°W, 11.88 ft

Cedar, 6" , N22°E, 2.64 ft

76

T141N R25W Sec Cor 1, 12, 6; & 7  
Original Gov't Survey

Tam. , 5" , N58°W , 56.76 #

Tam. , 3" , S79°W , 57.42 #

T141N R25W W<sup>1</sup>/<sub>4</sub> Sec. 7  
Original Gov't Survey

Pine, 4", N73°W, ~~56.76~~ #36LKS = 23.76 FT  
Pine, 4", N10°E, 10.56 #16LKS

May 16, 1911 J. Caro & Crew  
Traversed from E 1/4 cor west  
to W 1/4 cor. He doesn't state  
what he found but he says the  
corner was set by another surveyor  
but checks out fine for measurement

SURVEY RECORD # 507 - BOOK D - Pgs. 62+63

By J. H. FLYNN JUNE 23-27-1919

Fd. ORIG. PINE STUMPS

FENCE CORNER IS 33' EAST OF CORNER POST

PLAT SHOWS DISTANCE NORTH TO R. R. TRACK

R.O.W. - 1175.0' AND DISTANCE SOUTH TO SEC.

COR. - 2627.0'

5-15-02 R MAIN

FD IRON IN OLD ROAD BED WITH TWO LATH  
WITH COMPUTED POSITION WRITTEN ON SAME.  
IRON IS 1/2" REBAR FLUSH W/ GROUND.



T141N R25W E $\frac{1}{4}$  Sec 12  
Original Gov't Survey

Tam., 5", N58°W, 56.76 ft

Tam., 3", S79°W, 57.42 ft

1911 Harry Todd

At 5001.8 from E-corner is So. 46.75 ft

1919 J. H. Flynn

Found both Govt. BT stumps

Fence corner, East, 33.0 ft

79

T141N R25W Sec Cor 12, 13, 7, & 18  
Original Gov't Survey

Fir , 6" , N67°W , 15.84 ft

Tam. , 10" , S28°W , 18.48 ft