

CORNER RESTORATION

T141N R29W



FIELD BOOK

820012

BOOK 4

CORNER RESTORATION T141N R29W #4

T 141 N R 29 W

BOOK # 4 of 8

USFS


|   | T |    |  |  |  |  | R |    |  |  |  |    |
|---|---|----|--|--|--|--|---|----|--|--|--|----|
| A |   |    |  |  |  |  |   |    |  |  |  |    |
| B |   |    |  |  |  |  |   |    |  |  |  |    |
| C |   | 6  |  |  |  |  |   | 5  |  |  |  | 4  |
| D |   |    |  |  |  |  |   |    |  |  |  |    |
| E |   |    |  |  |  |  |   |    |  |  |  |    |
| F |   |    |  |  |  |  |   |    |  |  |  |    |
| G |   | 7  |  |  |  |  |   | 8  |  |  |  | 9  |
| H |   |    |  |  |  |  |   |    |  |  |  |    |
| I |   |    |  |  |  |  |   |    |  |  |  |    |
| J |   |    |  |  |  |  |   |    |  |  |  |    |
| K |   |    |  |  |  |  |   |    |  |  |  |    |
| L |   | 18 |  |  |  |  |   | 17 |  |  |  | 16 |
| M |   |    |  |  |  |  |   |    |  |  |  |    |
| N |   |    |  |  |  |  |   |    |  |  |  |    |
| O |   |    |  |  |  |  |   |    |  |  |  |    |
| P |   | 19 |  |  |  |  |   | 20 |  |  |  | 21 |
| Q |   |    |  |  |  |  |   |    |  |  |  |    |
| R |   |    |  |  |  |  |   |    |  |  |  |    |
| S |   |    |  |  |  |  |   |    |  |  |  |    |
| T |   | 30 |  |  |  |  |   | 29 |  |  |  | 28 |
| U |   |    |  |  |  |  |   |    |  |  |  |    |
| V |   |    |  |  |  |  |   |    |  |  |  |    |
| W |   |    |  |  |  |  |   |    |  |  |  |    |
| X |   | 31 |  |  |  |  |   | 32 |  |  |  | 33 |
| Y |   |    |  |  |  |  |   |    |  |  |  |    |
| Z |   |    |  |  |  |  |   |    |  |  |  |    |

|   | Mer. |  |  |  |  |  |  |  |  |  |  |    |
|---|------|--|--|--|--|--|--|--|--|--|--|----|
| A |      |  |  |  |  |  |  |  |  |  |  |    |
| B |      |  |  |  |  |  |  |  |  |  |  |    |
| C |      |  |  |  |  |  |  |  |  |  |  | 1  |
| D |      |  |  |  |  |  |  |  |  |  |  |    |
| E |      |  |  |  |  |  |  |  |  |  |  |    |
| F |      |  |  |  |  |  |  |  |  |  |  |    |
| G |      |  |  |  |  |  |  |  |  |  |  | 12 |
| H |      |  |  |  |  |  |  |  |  |  |  |    |
| I |      |  |  |  |  |  |  |  |  |  |  |    |
| J |      |  |  |  |  |  |  |  |  |  |  |    |
| K |      |  |  |  |  |  |  |  |  |  |  |    |
| L |      |  |  |  |  |  |  |  |  |  |  | 13 |
| M |      |  |  |  |  |  |  |  |  |  |  |    |
| N |      |  |  |  |  |  |  |  |  |  |  |    |
| O |      |  |  |  |  |  |  |  |  |  |  |    |
| P |      |  |  |  |  |  |  |  |  |  |  | 24 |
| Q |      |  |  |  |  |  |  |  |  |  |  |    |
| R |      |  |  |  |  |  |  |  |  |  |  |    |
| S |      |  |  |  |  |  |  |  |  |  |  |    |
| T |      |  |  |  |  |  |  |  |  |  |  | 25 |
| U |      |  |  |  |  |  |  |  |  |  |  |    |
| V |      |  |  |  |  |  |  |  |  |  |  |    |
| W |      |  |  |  |  |  |  |  |  |  |  |    |
| X |      |  |  |  |  |  |  |  |  |  |  | 36 |
| Y |      |  |  |  |  |  |  |  |  |  |  |    |
| Z |      |  |  |  |  |  |  |  |  |  |  |    |

Center North 1/16 Cor. Sec. 14

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

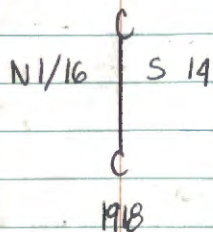

Poplar 6" N37°W 118 IKS - 77.88'

~~NO EVIDENCE FOR~~

B. Oak 14" S18°30'W 192 IKS - 126.72'

~~NO EVIDENCE FOR~~

~~Fd. Brass Capped Iron Pipe up 8" OK~~

~~SET - New BFs~~

~~W. Oak 10" S32°W 48.90' CS 1/4 SH PAT }  
W. Oak 9" S78°E 43.20' CS 1/4 SH PAT }  
W. Oak 5" N04°W 47.54' CS 1/4 SH PAT }~~

~~Steel sign post 1 1/2" x 8' EAST 5' A11 & B12 signs~~

~~Steel sign post 1 1/2" x 8' North 5' A11 & B12 signs~~

~~line to standard East~~

~~corner falls on high ground in mixed hardwoods~~

information on  
the wrong page

JA 10/5/87

L-20

Center East 1/16 Cor. Sec. 14

B.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

FD. IRON & CAP IN PLACE E V16 12/3/85 CK-6B

IN RIDGE SWAMP E4W C ——— C

100' IN TO SWP. FROM S14/ CAP IS 4" ABOVE

HIGHLAND E & 50' TO SOUTH 1918 ICE - BIRCH STAKE

APPROX. 2' WATER BELOW ICE & SNOW BESIDE IRON

Poplar 8" N65°45'E 162 IKS - 106.92'

NO EVIDENCE AT 886 ← DIST.

W. Oak 6" S63°30'E 154 IKS - 101.64'

OAK WINDFALL AT 563E 101.6' CHECKED OK

5680-2' By CyA 1/22/62

W. OAK 8 S1W 56.40 SPK & TAG

W. OAK 4 S31W 65.60 " "

W. OAK 8 N33W 88.20' " "

c.c. Done 1/86

CHAINED WEST FROM 1/4 BET. SECS. 13 & 14

DISTANCE 1276' CHECKED OK - LINE FELL 15' N OF IRON

L-19, 20

Angle Point 1 of Allotment 1361 and Angle Point  
3 of Allotment 1494, Sec. 14

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

12/11/85 CK, GB, JA

Fd. iron pipe with

brass cap set 10"

above gr d.

API

TR

1361

TR

AP3

1494

S 4

1918

Mkd. New BT'S

W. Oak 19 N20W 37.6 500+ Tags

W. Oak 13 N70W 18.5 " "

W. Oak 17 S66E 41.25 " "

C.C. Done 1/86

Chained from C E 1/6 sec. 14 637' west.

Dist. checked good.

Corner falls in young maple & w. Oaks

L-18, 19

S.M.C. on the centerline of Sec. 14 (shore of Cedar Lake bears N 4 S)


G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

12/11/85 CK, GB, JA

Fd. no evidence

SMC



of iron. corner falls

S14

in cedar lake.

1918

Poplar 8" N62°45'E 500 1Ks - 330.00'

Poplar 6" S85°E 584  
684 cks - 385.4

Fd. poss. BT. No scar vis. on a pop. stub.

CG. done 1/66

4  
Chained from C 1/4.

M, N-20

S.M.C. on the East 1/4 line of Sec. 14

G.L.O. Resurvey notes of 1918

Ironpost 3' long 1" diam. with brass Cap marked

Fd. IRON & CAP IN PLACE

E

CAP IS FLUSH WITH ROAD

S 14 S 14

N 45 + 150' N of COR. ROAD BR.

NE. I.P. bent some easterly

E

SMC

1918

N. Oak 16" N29°45'E 40 IKS- 26.40'

Fd. no evidence. Falls in old road clearing

Ash 6" N57°30'W 8 IKS- 5.28'

Fd no evidence. Falls in old road clearing

12/3/85 CK-GB

CHAINED S4E FROM SE 1/4 538' DISTANCE FELL

AT IRON IN ROAD - LINE WAS GOOD ROAD N-S.

12/9/85 CK, GB

MKV New BT'S

W. Oak 8 N64E 18.2 500 + Tags

W. Oak 5 S31E 44.4 " "

R. Oak 8 S43W 34.3 " "

C.C. Done

M-20

South East 1/16 Cor. Sec. 14

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

SE 1/16 S14

Fd. IRON CAP IN PLACE 1918

12" ABOVE GND.

R. Oak 12" S86°15'E 37 IRS - 24.42'

Fd. stump hole.

W. Oak 6" S73°W 82' IRS - 54.12'

NOW W. OAK<sup>17</sup> S73W 54.1' SCAR FACING COR.

5680-11 By WALTER KRUGER

12/3/85 OK+GB

Fd. IRON CAP IN PLACE 12" ABOVE GROUND

SOUTH OF GRASS MARSH NE+SW

CHAINED FROM CE 1/16 S4E DISTANCE CHECKED OK

AT 1297' LINE FELL W 20'

12/9/85 CK, GB

Mkd. New BT'S

W. Oak 5" S35W 11.5' 500 + Tags

R. Oak 9" S78E 26.5 " "

C.C. Done 1/86



M-19, 20

Angle Point 4 of Allotment 1361, Angle Point 4 of  
Allotment 1494 and a point on the North bdy.

of Allotment 1436, Sec. 14

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|         |      |
|---------|------|
| TR      | TR   |
| 1361    | 1494 |
| TR 1436 |      |
| 1918    |      |

M K-20

A. North East 1/16 Cor. Sec. 14

A1 G. L.O. Resurvey notes of 1918

O Iron post 3' long 1" diam. with brass cap marked

G Fd I.R. with brass NE 1/16 S14

I, Cap set 1" high in the 1918

east side of beaver pond.

N. Pine 22" N79°E 253 KS - 166.98'

Fd. burned pine stub <sup>5" high</sup> at bring + dist.

Tamarack 8" S17°45'E 88 KS - 58.08'

Fd. rotted tam. stp at bring + dist.

5680-2 by Cyx 1/22/62

12/4/85 CK, GB, JA

W. Oak 12" S1W 47.8 50D + Tags

W. Oak 10" East 77.35 " "

W. Oak 9 N72E 56.95 " "

12/4/85 - Chained 589W 1298.9'. Fell good on line and distance.

Aspen regeneration to the NE  
C.C. Done 1/86



K-19, 20

Angle Point 2 of Allotment 1494 and a point on the South bay of Allotment 1652, Sec 14 G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|                      |     |      |
|----------------------|-----|------|
|                      | TR  | 1652 |
| 12/4/85 - CK, JA, GB |     | AP2  |
| Fd. I.P. with B.C.   | S14 | TR   |
| set 16" above grd.   |     | 1494 |
|                      |     | 1918 |

Mkd New BT's

|       |     |      |       |                       |
|-------|-----|------|-------|-----------------------|
| W.Oak | 12" | N14W | 36.15 | 50 D <sup>9</sup> Tag |
| W.Oak | 15" | S7W  | 9.35  | " "                   |
| W.Oak | 14  | S54W | 86.5  | " "                   |

c.c. Done 1/86

10

12/4/85 Corner falls on SE side of a small cigar shape pond, Ridge East Chained S89W 648'. Fd. corner at end of our line and dist.

S.M.C. on the West 1/16 Sec. 14 (shore of Cedar L. bears NE & NW)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SMC

W

S14 | S14

W

1918


Tamarack 6" S15°45'E 49 1R5- 32.34'

Tamarack 8" S65°30'W 106 1K5- 69.96'

S.M.C. on the West 1/16 line Sec. 14 (shore of Cedar L. bears NE & SW)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

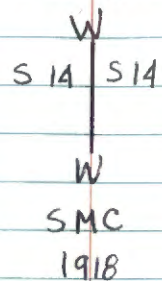

Tamarack 14" N14°E 45 KS - 29.70'

South West 1/16 Cor. Sec. 14

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SW 1/16 S14

1918

Tamarack 10" S 41° W 68 1/2 - 44.88'

Ash 6" N 19° 30' W 17 1/2 - 11.22'

SMC on the South 1/16 line Sec. 14 (shore of Cedar L. bears N45)

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|     |   |     |   |
|-----|---|-----|---|
| SMC | S | S14 | S |
|     |   | S14 |   |

1918

Spruce 16" N68°15'E 149 1KS- 98.34'



S.M.C. on the South 1/16 line Sec. 14 (shore of bay of Cedar L. bears N 8 S)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|   |     |   |      |
|---|-----|---|------|
| S | S14 | S | MC   |
|   | S14 |   |      |
|   |     |   | 1918 |

Tamarack 12" N14°45'W 60 KS - 39.60'

Ash 5" S35°45'W 42 KS - 27.72'

S.M.C. on the North 1/16 line Sec. 4 (Shore of Cedar L. bears N & S)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SMC | S14  
N ——— N  
| S14  
1918


Poplar 6" N79°30'E 163 IKS - 107.58'

Poplar 6" S78°45'E 132 IKS - 87.12'

S.M.C. on the North 1/16 line Sec. 14 (shore of Cedar L. bears N45)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

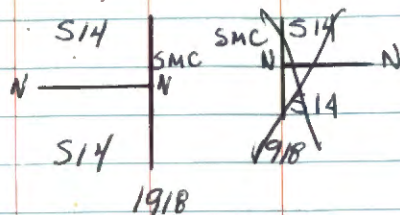

Tamarack 12" N44°W 39 IKS - 25.74'

Cedar 10" S80°W 50 IKS - 33.00'

Angle Point 1 of Allotment 1309, Angle Point  
4 of Allotment 1352 and a point on the  
West bdy. of Allotment 1656, Secs. 10-11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|      |      |
|------|------|
| TR   |      |
| 1352 |      |
| AP 4 | TR   |
| AP 1 | 1656 |
| TR   |      |
| 1309 |      |
| S 10 | S 11 |
| 1918 |      |

South 1/16 Cor. Secs. 10-11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

S1/16

S10 | S11

1918


Oak 8" S89°E 170 /KS- 112.20'

Birch 8" S76°45'W 233 /KS- 153.78'

M.C. Secs. 10-11 (shore of Horeshore Lake, bears E + W)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

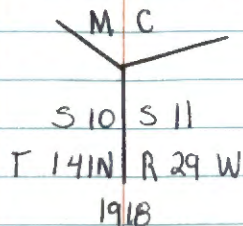

Oak 8" S33°45'E 246 1/2 - 162.36'

Poplar 5" S18°15'W 240 1/2 - 158.40'

Angle Point 2 of Allotment 1442, Angle Point 3 of Allotment 1402 and Angle Point 4 of Allotment 1273, Secs. 2-11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|      |      |
|------|------|
| S 2  |      |
| TR   | TR   |
| 1273 | 1402 |
| AP 4 | AP 3 |
|      | AP 2 |
|      | TR   |
|      | 1442 |
| S 11 |      |
| 1918 |      |

East 1/16 Cor. Secs. 2-11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|             |        |            |
|-------------|--------|------------|
| No evidence | E 1/16 | <u>S 2</u> |
| on 5/3/89   |        | S 11       |
|             |        | 1918       |

W. Oak 30" S12°W 84 lks - 55.44'

fd. oak stp. remains at bring & dist.

W. Oak 24" N81°30'W 98 lks - 64.68'

No evidence - falls in Hwy 200

5/3/89 GB

Chained from the SE 1/4 south 1307' and

from the south 1/4 sec. 2 east 1321'.

Found no evidence of GLO iron. Corner

falls in the south ditch of Hwy 200.

Found oak stp. remains at bring

& distance from intersection of chainage.



Angle Point 3 of Allotment 1402 and Angle Point  
4 of Allotment 1660, Secs. 2-11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|      |      |      |
|------|------|------|
|      | S 2  |      |
| TR   |      | TR   |
| 1660 |      | 1402 |
| AP 4 |      | AP 3 |
|      | S 11 |      |
|      | 1918 |      |

E-19

Quarter Cor. Secs. 2-11

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass  
cap marked

Fd. IRON &amp; CAP - IN PLACE

$$\frac{1}{4} \frac{S \ 2}{\text{---}}$$

IN GOOD CONDITION

S 11

12" ABOVE GROUND - ON KNOLL 1918

IN HARDWOODS - 300' SOUTH OF HWY #200 3/28/89 CK

W. Oak 6" S38° 30' E 39 IKS - 25.74'

5/3/89 Fd. no evidence

Poplar 7" N51° 30' W 37 IKS - 24.42'

5/3/89 Fd. poplar wind fall at bring &amp; dist. Fd. reg. scribble

5680-11 By Cyr 11/25/64

PUT FSLP ON R. OAK 14 S32W - 21.95' FROM CORNER

FOUND OLD COUNTY IRON 2" X 48" NORTH &amp; ALONG SIDE

3/28/89 CK

5/3/89-6B

Mkd. New BT'S:

1. Ash 5" S60E 36.8 1/4 5" BT

TWIN  
2. W. Oak 12" S31W 33.58 1/4 5" BT

3. R. Oak 18" S85W 21.3 1/4 5" BT

NOW A 30 FT SNAG R. MAIN 5/2/01


8' steel sign post north 3.25' from  
corner with both signs attached

24

Line to standard mkd. north

5-24-01 R. MAIN

GPS IRON

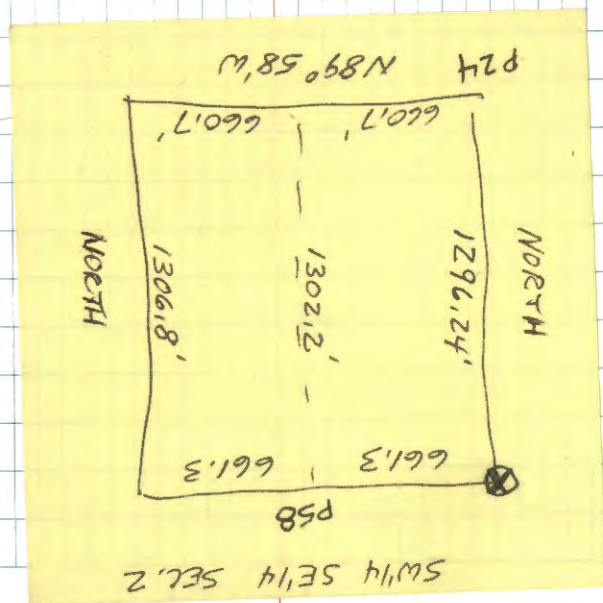

Angle Point 3 of Allotment 1640, Angle Point  
4 of Allotment 1642 and a Point on the ~~West~~  
North bdy. of Allotment 1311, Secs. 2-11

G.L.O. Resurvey notes of 1918  
Iron post 3 long 1" diam. with brass cap  
marked

|             |         |             |
|-------------|---------|-------------|
|             | S 2     |             |
| TR          |         | TR          |
| 1642        |         | 1640        |
| <u>AP 4</u> |         | <u>AP 3</u> |
|             | TR 1311 |             |
|             | S 11    |             |
|             | 1918    |             |

West 1/16 Cor. Secs. 2-11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

W 1/16 52

S 11

1918

W. Oak 16" N 81° 15' E 53 1/2 - 34.98'

W. Oak 16" S 22° 15' E 56 1/2 - 36.96

M.C. Secs. 2-11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

T141N R29W

MC / S2

S11

1918

W. OAK 10" N63°E 29 KS - 19.14'  
NOW 20" @ BRG AND DIST/NEW TAG

B. OAK 18" S40°E 75 KS - 49.50'  
NOW A CHARRD OAK STUMP @ BRG & DIST

5-24-01 R. MAIN

Fd MC IN PLACE 10 FT EAST OF LAKE EDGE.


MC IS ON SOUTH SIDE OF PUT APPROACH TO LAKE.

FENCE FROM MC TO LAKE. GPST IRON.

S.M.C. on the center line of Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. With brass cap marked

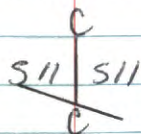

S.M.C.

1918

W. Oak 12" N85°15'E 123/ks - 81.18'

Poplar 6" N47°45'W 42/ks - 27.72'

Center South 1/16 Cor. Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

C  
S 1/16 | S 11  
C  
1918

Poplar 6" N27°E 18 IKS - 11.88'

Poplar 6" S56°W 41 IKS - 27.06'

10/1/87 JH TJ CS

Fd: Brass capped Iron Pipe up 8" OK.

No evidence of 1918 BTS

SET: New BTS:

|        |     |      |        |                 |                                 |
|--------|-----|------|--------|-----------------|---------------------------------|
| W. Oak | 10" | S32W | 48.90' | CS 1/16 S 11 BT | } SPLS<br>} TAGS<br>} ROD RINGS |
| W. Oak | 9"  | S78E | 43.20' | CS 1/16 S 11 BT |                                 |
| W. Oak | 5"  | N04W | 47.54' | CS 1/16 S 11 BT |                                 |

Steel sign post 1 1/2 x 8' East 5.0' ATT &amp; Bdry signs

Steel sign post 1 1/2 x 8' North 5.0' ATT &amp; Bdry signs

Line to standard East 1/2 mile

Corner falls on high ground in mixed hardwoods

Center Quarter Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

C  $\frac{1}{4}$  S 11

1918

W. Oak 11" S35° 30' W 127 1/2 - 83.82'

Poplar 10" N84° 15' W 138 1/2 - 91.08'



Angle Point 1 of Allotment 1593, Angle Point  
4 of Allotment 1311 and a point on the West  
bdy. of Allotment 1412, Sec. 11

G.L.O. Resurvey notes of 1918


Iron post 3' long 1" diam. with brass cap  
marked

|      |      |
|------|------|
| TR   |      |
| 1311 |      |
| AP 4 | TR   |
| AP 1 | 1412 |
| TR   |      |
| 1593 |      |
|      | S 11 |
|      | 1918 |

Center North 1/16 Cor. Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

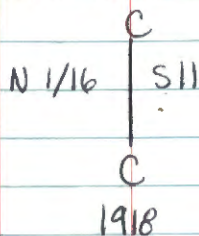

Poplar 6" N85°E 44 1KS - 29.04'  
NO EVIDENCE

W. Oak 24" S51°W 115 1KS - 75.90'  
NO EVIDENCE

06-20-2011 R. MAIN

FD IRON IN PLACE AND GPS. ALSO FD 1/2" X 4"  
PIPE LAYING DOWN NEXT TO GLO. OLD FSLP  
ON 15' BASSWOOD FROM WHICH CORNER BEARS  
S40°W 12 FT. TAG SAYS 54°E WHICH IS  
INCORRECT.


1337.418

32

Center East 1/16 Cor. Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked



S11

1918

Birch 10" N36°30'E 36 1/2 - 23.76'

Spruce 10" N39°W 13 1/2 - 8.58'

Angle Point 3 of Allotment 1469, Angle Point  
4 of Allotment 1412 and a point on the  
North bdy. of Allotment 1629, Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|      |      |
|------|------|
| TR   | TR   |
| 1412 | 1469 |
| AP 4 | AP 3 |

TR 1629

S 11

1918

Center West 1/16 Cor. Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

W 1/16  
C ————— C

S 11

1918


W. Oak 8" N65°45'E 181 1/2 - 119.46'

W. Oak 10" N86°W 213 1/2 - 140.58'

S.M.C. on the center line of Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

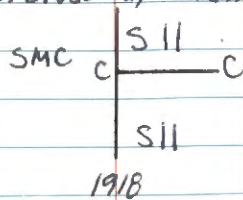

B. Oak    14"    N69°45'E    73 1/2 - 48.10'

W. Oak    6"    S22°45'E    95 1/2 - 62.70'

Angle Point 3 of Allotment 1593. and a point  
on the North bdy. of Allotment 1656, Sec. 11

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|      |             |
|------|-------------|
|      | TR          |
|      | 1593        |
| TR   | <u>AP 3</u> |
| 1656 |             |

S11  
1918

South East 1/16 Cor. Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

SE 1/16 S11

1918

|        |     |          |     |      |        |
|--------|-----|----------|-----|------|--------|
| Ash    | 5"  | S38°30'E | 32  | 1KS- | 21.12' |
| Fd     | 12" | S39E     |     |      | 21.72' |
| Poplar | 6"  | N18°30'W | 138 | 1KS- | 91.08' |

10/1/87 JA TJ CS

Fd: Brass Capped Iron Pipe up 10" in  
Swamp marked OKBT: 1918 Ash 12" S39E 21.12' Blazed orange  
remarked 'BT' SPK tag red ring

SET: New BTS

|        |     |      |        |               |                             |
|--------|-----|------|--------|---------------|-----------------------------|
| W. Oak | 16" | S28W | 75.25' | SE 1/4 S11 BT | } SPK<br>tag<br>red<br>ring |
| Maple  | 6"  | N79W | 61.50' | SE 1/4 S11 BT |                             |

Steel sign post West 4.0' 1 1/2 x 8' APB & B'ding sign-  
line to stand East and West - angle checks  
to corner. (GLO)Corner falls on <sup>West</sup> East edge of swamp and  
130' West of East edge



Angle Point 2 of Allotment 1330 and a point  
on the East bdy. of Allotment 1629, Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" with brass cap marked

|      |      |      |
|------|------|------|
|      | S 11 |      |
| TR   |      |      |
| 1629 |      | AP 2 |
|      |      | TR   |
|      |      | 1330 |
|      |      | 1916 |

North East 1/16 Cor. Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

NE 1/16 S11

1918

Ash 6" N22°45'E 48 IKS - 31.68'

Ash 9" S32°W 111 IKS - 73.26'

Angle Point 3 of Allotment 1442 and a point on the  
North bdy. of Allotment 1469

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

TR

1442

AP 3

TR 1469

S 11

1918

Angle Point 1 of Allotment 1412 and Angle Point  
2 of Allotment 1469, Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3/4 long 1" diam. with brass cap marked

|      |      |
|------|------|
| AP 1 | AP 2 |
| TR   | TR   |
| 1412 | 1469 |
| S 11 |      |
| 1918 |      |

South West 1/16 Cor. Sec. 11

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SW 1/16 S11

1918

W. Oak 6" N20°E 82 1ks - 54.12'

Poplar 10" N48°15'W 70 1ks - 46.20'

Angle Point 2 of Allotment 1593, Angle Point  
3 of Allotment 1311 and a point on the East  
bdy. of Allotment 1309, Sec. 11

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|      |       |
|------|-------|
|      | S. 11 |
|      | TR    |
|      | 1311  |
| TR   | AP 3  |
| 1309 | AP 2  |
|      | TR    |
|      | 1593  |
|      | 1918  |

North West 1/16 Cor. Sec. 11

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

NW 1/16 S11

1918


W. Oak 24" N 40° 15' E 14 1/2 - 9.24'

W. Oak 18" S 87° 45' W 56 1/2 - 36.96'

S.M.C. on the No. 116 line Sec. 11 (shore of Horseshoe L. Bears NE & SW)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

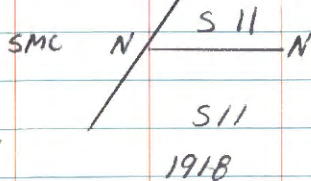

W. Oak 14 inch N71°45'E 62 1K5 - 40.92'

W. Oak 6 inch S57°45'E 70 1K5 - 46.20'



M.C. Sections 2-3

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|         |        |
|---------|--------|
| T 141 N | R 29 W |
|---------|--------|

|     |     |
|-----|-----|
| S 3 | S 2 |
|-----|-----|

M C

1918

W. Oak 7" N56°E 13 IKS - 0.58'

Now 16" N56°E

W. Oak 12" N76°W 52 IKS - 34.32'

Now 18" N76°W

5-2401 R. MAEN

FD GLOIRON AT WATERS EDGE. FD BRUSHED  
LINE NORTH OF CORNER. PUT IRON 1.2 FT X  $\frac{3}{4}$ "  
WITH " 11946 STAMPED ON THE SIDE OF SAME +  
20 FT NORTH OF GLO IRON. GPS IRON

South 1/16 Cor. Secs. 2-3

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

S 1/16  
S3 S2

1918

Maple 12" N34°E 34 1KS - 22.44'  
NO EVIDENCE 5/24/01

Maple 12" N36°30'W 29 1KS - 19.14'  
NOW 17" WINDFALL @ BRG & DIST. "ROLLOVER WINDOW"  
LOWER BR/ZE. SCRIBE & CENTER OF TREE ROTTED AWAY.

S-2401 R MAIN

FD IRON IN PLACE UP 8". CORNER IN MATURE  
HARDWOODS ± 50 FT SOUTH OF SLOUGH. MARK  
NEW BTS GPS IRON

W OAK 14" N 20° W 51.30 FT TO SPK MKD S 3 BT

MAPLE 6" S 68° W 28.20 FT TO SPK MKD S 3 BT

8 FT STEEL SIGN POST 3.8 FT WEST 4.4 FT SOUTH  
LINE TO STANDARD SOUTH AND WEST OF CORNER

Angle Point 4 of Allotment 1694, Angle Point 1 of Allotment 1717 and a point on the West bdy. of Allotment 1679, Secs. 2-3

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|      |      |
|------|------|
| TR   |      |
| 1694 |      |
| AD4  | TR   |
| API  | 1679 |
| TR   |      |
| 1717 |      |
| S 3  | S 2  |
|      | 1918 |

5-30-01 R<sub>o</sub> MAIN

Fd GLO IRON IN PLACE UP 12" o CORNER IN MIXED MATURE HARD WOODS. FSLD DATED 8/56 ON 12" MARK FROM WHICH CORNER BEARS N 48° E 6.2 FT TO Q OF TREE. GPS IRON MARK NEW BIS

ASH 9" N 59 E 20.60 FT TO SPK MKD: APS 2 BT

ROAK 18" N 17 W 20.40 FT TO SPK MKD: APS 3 BT

8 FT STEEL SIGN POST 3.9 WEST 3.45 NORTH

Quarter Cor. Secs. 3-2

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

1/4  
S3 | S2

1918

Maple 6" S59°E 17 IKS - 11.22'  
NOW 19" MAPLE

W. Oak 7" S15°30'W 28 IKS - 18.48'  
NOW 5"

8 FT STEEL SIGN POST 30' WEST 40' 35" SOUTH  
LINE TO STD WEST AND SOUTH OF CORNER. REMAIN  
GPS IRON ON S-31-01

M.C. Secs. 2-3 (Shore of Leech L. bears E & W)

G.L.O.R. resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|         |        |
|---------|--------|
| M C     |        |
| S 3     | S 2    |
| T 141 N | R 29 W |
| 1918    |        |

Maple 8" S84°15'W 385 1/2 - 254.10'

Mound of stone 2' base 1 1/2' high south of cor.

South 1/4 Cor. Sec. 2

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

3/28/89 CK S1/16 S2

Ed. IRON & CAP - IN PLACE

IN GOOD CONDITION - 10" ABOVE

GROUND - 40' EAST OF FR# 2486 1918

OLD FSLP ON W. OAK 6 N28E - 7.2' FROM IRON

Poplar 8" N55°45'E 36 IKS - 23.76'

NO EVIDENCE

W. Oak 12" S4°W 155 IKS - 102.30'

NO EVIDENCE

5/3/89 GB

Mkd. New BT'S

W. OAK 6" N27E 7.48 CSK 6 S2 BT

W. Pine 28" S57E 14.62 "

W. Oak 5" S27W 15.80' "

8' steel sign posts east 4.0 and south 4.4  
from corner with both signs attached.

CC DONE

52

line to standard east + south.

Center Quarter Sec. 2

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

C  $\frac{1}{4}$  S2

1918

R. Oak 12" N58°45'E 31 KS - 20.46'

Maple 18" N36°30'W 40 KS - 26.40'

Center West 1/16 Cor. Sec. 2

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

W 1/16  
C ————— C

S 2

1918

Birch 8" N52°45'E 92 1/2 - 60.72'


Cedar 12" S59°W 133 1/2 - 87.78'



S.M.C. on the center line Sec. 2 (shore of Leech L. bears NW & SE)

G.L.O. Resurvey notes, of 1918

Iron post 3' long 1" diam. with brass cap marked

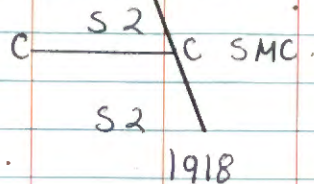

W. Oak 12" S54°15'W 43 1KS - 28.38'

Maple 10" N83°W 136 1KS - 89.76'

South East 1/16 Cor. Sec. 2

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

SE 1/16 S2

1918

5/3/89 Maple 10" N17°30'E .39 IKS - 25.74'

Fd. Maple 18" N19°E at 25.74 Scar visible.

Bitch 6" S30°45'W 20 IKS - 13.20'

Fd. no evidence

5/3/89 B. Brama

Fd. GLO brass cap on iron pipe set in place.

Brass cap is 10" above ground.

Mkd. New BT'S:

1. Maple 9" N47E 38.7' SE 1/16 S2 BT

2. W. Oak 14" S49°E 29.86' "

3 W. Oak 14" S18°W 96.32' "

8" steel sign posts west 3.1 and south 2.9  
from corner with both signs attached.

CC DONE


56

line to standard runs west and south from corner.

S.M.C. on the East 1/4 line Sec. 2 (Share of Kerch L. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

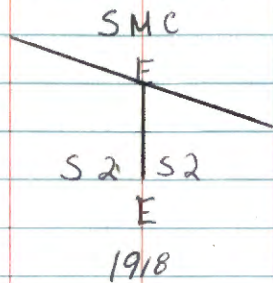

Birch 8" S15°E 87 IKS - 57.42'

Birch 5" S56°W 7 IKS - 4.62'

Angle Point 1 of Allotment 1660, Angle Point 2  
of Allotment 1402 and a point on the south  
bdy. of Allotment 1509, Sec. 2

G.L.D. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|            |      |      |
|------------|------|------|
|            | TR   | 1509 |
| 3/22/89 CK | AP 1 | AP 2 |

|                             |    |    |
|-----------------------------|----|----|
| FOUND IRON & CAP - IN PLACE | TR | TR |
|-----------------------------|----|----|

|                   |      |      |
|-------------------|------|------|
| IN GOOD CONDITION | 1660 | 1402 |
|-------------------|------|------|

|                 |     |  |
|-----------------|-----|--|
| 8" ABOVE GROUND | S 2 |  |
|-----------------|-----|--|

|              |      |  |
|--------------|------|--|
| IN HARDWOODS | 1918 |  |
|--------------|------|--|

CHAINED 661' BETWEEN AP 1 & 2 AND CS 116 AS CHECK

5/3/89 GB

MKD. New BT'S:

|              |        |       |             |
|--------------|--------|-------|-------------|
| 1. R. Oak 9" | S 79 W | 19.55 | AP 1 S 2 BT |
|--------------|--------|-------|-------------|

|               |        |       |        |
|---------------|--------|-------|--------|
| 2. R. Oak 13" | N 45 W | 14.45 | S 2 BT |
|---------------|--------|-------|--------|

|             |        |       |             |
|-------------|--------|-------|-------------|
| 3. Maple 6" | S 66 E | 26.87 | AP 2 S 2 BT |
|-------------|--------|-------|-------------|

8" steel sign post west 3.8' from corner  
with both signs attached.

line to Standard east & west.

Angle Point 1 of Allotment 1273, Angle Point  
 2 of Allotment 1402, and a point on the  
~~south bdy. of Allotment~~ Angle Point 3 of  
 Allotment 1396 and Angle Point 4 of  
 Allotment 1654, Sec. 2

|      |      |
|------|------|
| TR   | TR   |
| 1654 | 1396 |
| AP 4 | AP 3 |
| AP 1 | AP 2 |
| TR   | TR   |
| 1273 | 1402 |

S 2

1918

S.M.C. Sec. 2 (shore of Leach h. bears E & W)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S M C

TR TR

1654 1396

S 2

1918

Ash 14" S 17° 30' E 139 1/2 - 91.74'

Ash 7" S 53° 45' W 150 1/2 - 99.00'

South West 1/16 Cor. Sec. 2

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

SW 1/16 S2

1918

Tamarack 4" N35°W 122 1/2 - 80.52'

Poplar 7" S78°30'W 325 1/2 - 247.50'

Angle Point 1 of Allotment 1642, Angle Point  
2 of Allotment 1640 and a point on the  
South bdy. of Allotment 1509, Sec. 2

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

|      |      |
|------|------|
| TR   | 1509 |
| AP1  | AP2  |
| TR   | TR   |
| 1642 | 1640 |
| S2   |      |
| 1918 |      |



Quarter Cor. Secs. 21-22

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

↓  
S21 | S22  
1918

W. Pine 7" S41°15'E 131.1KS - 86.46'

Form #58 on 6" J. pine N60°E - 34.32 FT

10-5-06 R. MAEN

GPS IRON

Sec. Cor. of Secs. 15-16-21-22

G. L. O. Resurvey notes of 1918

Iron post 3' long 2" diam. with brass cap  
marked

|       |      |
|-------|------|
| T141N | R29W |
|-------|------|

|     |     |
|-----|-----|
| S16 | S15 |
|-----|-----|

|     |     |
|-----|-----|
| S21 | S22 |
|-----|-----|

1918

N. Pine 6" S84°30'E 272 1ks-179.52'

N. Pine 10" N70°30'W 138 1ks-91.08'

Mound of stone 2' base 1½' high west of cor.

Form 458 on 10" N. PINE N32°W 128.04ft

N-16

East 1/16 Col. Sacs. 15-22

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

E 1/16 S 15

S 22

1918

B. Oak 14" N17°45'E 189 1ks - 124.74'

4' stub 28" N18°E 124.74

B. Oak .16" S68°15'W 170 1ks - 112.20'

5680-11 By WITTHOEFY & ENEMY 3/69

9-85 B. AUSK

Fd BRASS CAP OK up 1.0'

from which =

W. OAK 10" N81°E 19.92'

R. PINE 16" S28°W 49.23'

W. OAK 7" N17°W 23.81'

} B. Olson  
1980

Steel Sign Post EAST 3.5' w/54-2, 54-9

" " " WEST 3.5' w/54-2, 54-9

LINE to Std. EAST + WEST

CC

65

Quarter Cor. Secs. 15-22

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

$$\begin{array}{r} \perp \\ 4 \end{array} \frac{5.15}{\hline} \\ 5.22 \\ 1918$$

Poplar 6" S64°W 118 KS - 72.88'

Fd Rotted Stump hole at Brq & Pist.

B. Oak 12" N42°W 89 KS - 58.74'

Fd B. OAK stub at Brq & Pist. 19"

9-85 JA., G.B.

Found BRASSCAP OK up 10"

From which:

R. OAK 13" S18°W 25.16'

R. OAK 9" S79°W 41.55

R. OAK 8" S27°W 14.35

} B. Olson  
1980

Steel Sign Post 4.8' South w/54-2, 54-9

" " " 5' EAST w/54-2, 54-9

Line to Sid South & North

CC

66

West 1/16 Cor. Secs. 15-22

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

W 1/16 S 15

S 22

1918

W. Pine 4" S45°30'W 132 IKs - 87.12'

N. Pine 7" N81°W 344 IKs - 227.04'

P-15

Center Quarter Cor. Sec. 22

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

C $\frac{1}{4}$  S 22

1918

W. Oak 16" S2°15'E 212 IKS- 139.92'

OAK wood - 4" - 3' stub

W. Oak 14" N32°30'W 167 IKS- 110.22'

OAK wood Sill &amp; Stump hole

7150-4 BY SCHREINER, WITTHOFT &amp; EMERY 8/30/68

9-85 J.A.G.B.

Found BRASSCAP O.K. UP 7"

from which:

Birch 11" N76°W 2426

- B. Olson

ROAK 13" N21°W 3197 1980

Casswood 13" S0-1°W 2754

Stad Sign Post 4" East W/54-2, 54-9

South W/54-2, 54-9

" " " 3.7 North W/54-2, 54-9

LINE to Std. East, South, North

CC

68

South East 1/16 Cot. Sec. 22

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

SE 1/16 S 22

1918

Poplar 6" S85°15'<sup>E</sup> 34 1/2 - 22.44'

B. Oak 14" S7°45'W 110 1/2 - 22.60'

South 1/16 Cor. Secs. 15-16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

S1/16

S16 | S15

1918

N. Pine 8" N55°45'E 120 1/2 - 112.20'


Birch 6" N84°W 50 1/2 - 33.00'



M.C. Secs. 15-16 (shore of Lake bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

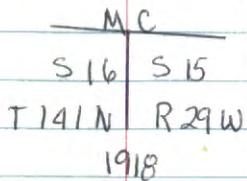

Raise mound of stone 2' base 1 1/2' high south of Col.

M. C. Secs. 15-16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

T141N R29W

S16 S15

~~MC~~

1918

R. Oak 6" N35°45'E 104 1KS - 68.04'

W. Oak 4" N78°W 85 1KS - 56.10'

M.C. Secs. 15-16 (Lake bears ELW)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|       |      |
|-------|------|
| MC    |      |
| S16   | S15  |
| T141N | R29W |
| 1918  |      |

R. Oak 16" N69°45'E 136 1/2 - 89.76'

Pine 6" S79°30'N 330 1/2 - 217.80'

East 1/16 Cor. Secs. 10-15

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 10  
E 1/16

S 15  
1918

Double W. Pine 14" N28°30'E 270 lks - 178.20°

N. Pine 8" S19°E 390 lks - 257.40°

Quarter Cor. Secs. 10-15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap  
marked

$$\frac{\pm}{4} \quad \frac{S 10}{\text{---}}$$

S 15

1918

W. Oak 14" N16°15'E 218 1/2 - 143.88'

Poplar 6" S40°15'E 71 1/2 - 46.86'

J-14

West 1/16 Cor. Secs. 10-15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

W 1/16 S 10

S 15

1918

Poplar 5" S30°15'E 23 1/2 - 15.18'

W. Oak 10" N47°W 32 1/2 - 21.12'

7150-4 By WITTHOEFT 6/70

76

M.C. Secs. 10-15

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

|       |       |
|-------|-------|
| T141N | R 29W |
| MC    | S 16  |
|       | S 15  |
| 1918  |       |

N. Pine 4" N52°30'E 105 1K3- 69.30'


Poplar 6" S32°45'E 220 1K3- 145.20'

M-15

Center South 1/16 Cor. Sec. 15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam with brass cap  
marked

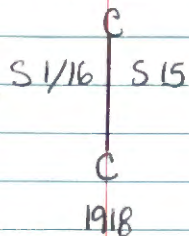

N. Pine 16" N51°15'E 204 1/2 - 134.64'

N. Pine 16" S52°15'W 73 1/2 - 48.18'

7150-4 By WITTHOEFT & EMERY 6/70



1-15

Center Quarter Cor. Sec. 15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

C $\frac{1}{4}$  S15

1918

J. Pine 8" N68°30'E 166 1/2 - 109.56

J. Pine 6" S61°30'W 53 1/2 - 34.98'

7150-4 By WITTHOEFT & EMERY 6/70