

T141N R29W
CORNERS
Book #8

T141N R29W
Book #8


CORNERS

RF
FIELD BOOK
82-0012

USFS

T141N R29W
BOOK #8 OF 8

CASS COUNTY

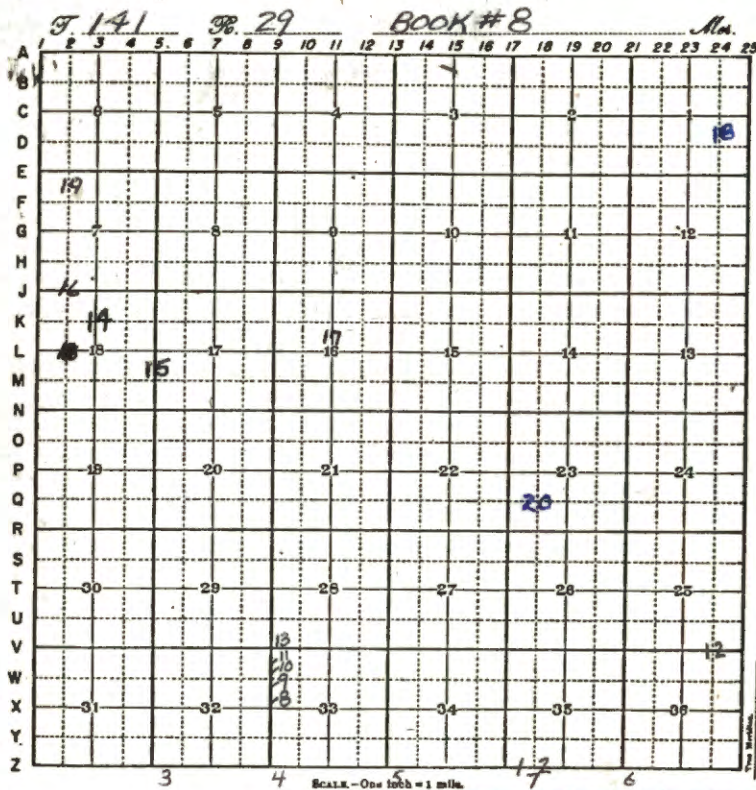

1 2-17, 18

Meander Corner Bet. Sec's. 35 and 2

Notes of Original Gov't Survey 1863-

Set post on west side of bay of Barnum Lake.

Dry Tamarack 14" N26W 29 lks.

Dry Tamarack 15" S34E 35 lks.

2 2-17, 18

Meander Corner Bet Sec's 35 and ~~36~~²

Notes of Original Gov't Survey 1863 -

Set post on ~~west~~ east side of bay of Barnum Lake.

W. Birch 9" N40 E 621ks.

J. Pine 18" S82 E 831ks.

Closing Section Corner To Sections 5/6

Notes of Original Gov't Survey 1870-

Set post 10.06 chs. east of std. Cor. 31432

Poplar 6" S55W 30 lks.

J. Pine 10" S68°E 62 lks.

4 A-9 T140N R29W

Closing Section Corner To Sections 445

Notes of Original Gov't Survey 1870-

Set post 10.20 chs. east of Std. Cor. 32933

4

5 A-13 T140N R29W

Closing Section Corner To Sections 3, 4

Notes of Original Gov't Survey 1870-

Set post 11.25 chs. east of std. Cor. 33 & 34

R. Maple 7" 572 E 581 ks.

R. Elm 8" 560 W 541 ks.

6 A-21 T140N R29W

Witness Corner To Section Corner 1 & 2

Notes of Original Gov't Survey of 1870-

Set post 2.46 chs. south of section corner

and 11.23 chs. east of std. corner 35 & 36

W. Pine 22" S10E 30 lks.

W. Birch 10" S65W 50 lks.

6

1915 - Surveyed by John Curo See Plat 23

Set 2 1/4" x 48" iron mon. - witness corners ^{1297.52 west} 304.39 south

1915 F.A. Donner, County Bk. C. p. 235, Found

SE. B.T. for witness corner, set 4x4x36"

Aspen post. Microfilm-roll 105, Bk. 66 p. 33-34

1981 - Plat Lantern Bay Subdivision, Roger Mustonen

7 A-18 T140N R29W

WEST $\frac{1}{16}$ (North line of Section 2)

Corner established by Cass Co. Survey

7

12/18/84 - Co. Surveyor Terry Freeman found
iron pipe in a swamp. Placed Co. location tag
on 4" Tam. S27E 21.3.

8 WjX-9

Meander Corner bet. Sec's 32, 33

Notes of Original Gov't Survey 1873 -

Set post on south shore of bay

Poplar 3" S4E 91ks.

Poplar 4" S32W 281ks.

8

9 W, X-9

Meander Corner Bet Sec's 32, 33


Notes of Original Gov't Survey 1873.

Set post on north shore of bay

W. Pine	18" 12"	S52E S13W	321ks. 291ks.
---------	------------	--------------	------------------

W. Pine	12" 4"	N10W S6E	231ks. 41ks.
---------	-----------	-------------	-----------------

9

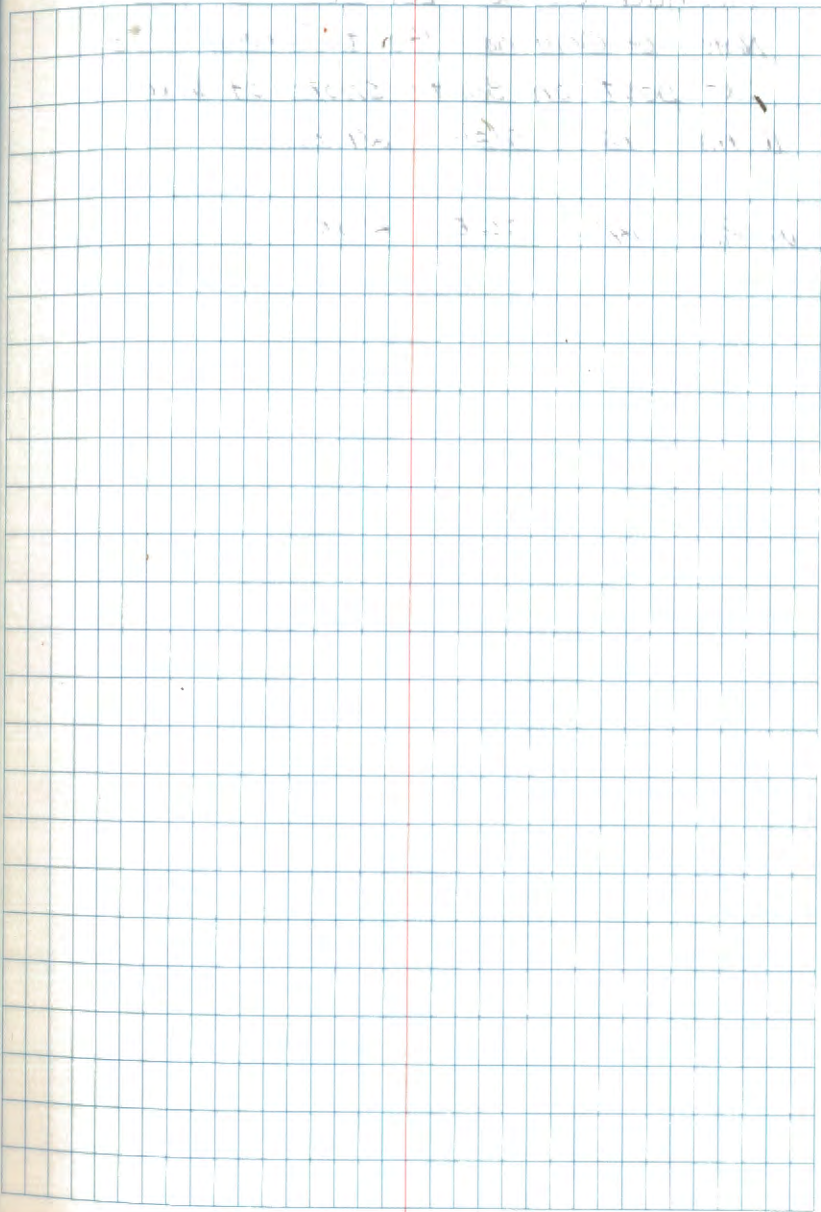

10 W₃X-9

Meander Corner Bet Sec's 32,33

Notes of Original Gov't Survey 1873-

Set post on south shore of lake

W. Pine 12" S13W 291ks.

W. Pine 14" S6E 411ks.

10

11 V,W-9

Meander Corner Bet Sec's 32, 33

Notes of Original Gov't Survey 1873-

Set post on north shore of lake

W. Oak 6" N75E 321ks.

Poplar 6" S87W 331ks.

12 V-24

EAST $\frac{1}{16}$ Bet. Sec's 25, 36

Corner established by Dave Claypool 1983-

Set 2x60" galv. iron pipe with brass
cap mkd. (proportionate)

Mkd. BY'S:

N. Pine 20" N22W 64.14'

N. Pine 22" N86E 46.32'

12

Certificate of Survey By David Claypool
filed by U.S.F.S 1984

MEANDER CORNER BET. SEC'S. 28 & 33

NOTES OF ORIGINAL GOV'T. SURVEY 1873

SET POST

OAK 4 S74W 34 LKS. 22.44'

OAK 7 N87W 24 LKS. 15.84'

3.10 CHS. EAST OF SEC. COR. - 204.6'

CENTER NORTH 1/16 SECTION 18

NOTES OF GLO RESURVEY 1918

SET 1" X 36" IRON POST WITH BRASS CAP MARKED

6/12/81 CK-6B FD. BASE OF IRON
 24" IN GROUND - WITH FLANGES IN PLACE
 IN N+S WOODS ROAD AND TRAIL TO SE 1918

C
 N 1/16 S 18
 C

FROM WHICH

RED OAK 18 S67E 98 LKS.

NOW 23" RED OAK S67E 64.7' SCRIBE CLOSED

WHITE OAK 24 S86W 225 LKS.

TO PERPETUATE CORNER LOCATION WE SET 2" X 24"

FS. BRASS CAPPED IRON PIPE WITH CAP MARKED

T 14 N R 29 W

C
 N 1/16 S 18
 C

1981

WITNESSED BY

RLS NO

N. PINE 20 S36E 34.70' MKD CN 1/16 S 18 BT

N. PINE 16 N37E 38.50' " " "

R. OAK 11 S29W 26.17' " " "

CORNER IS IN CENTER OF OLD WOODS TRAIL N+S

AND TRAIL TO SE TO CABIN ON PINE LAKE

MEANDER CORNER BETWEEN SECTIONS 17+18

NORTH SHORE OF PINE LAKE

NOTES OF GLO RESURVEY 1918

SET 1" X 3/8" IRON POST WITH BRASS CAP MARKED

6/29/81 CK-6B

T141N R29W

Fd. IRON & CAP IN PLACE

S18 | S17

6" ABOVE GROUND - PLACE ROCK AROUND IRON

FROM WHICH

N. PINE 30 N35E 8 LKS.

NOW 25" N. PINE N35E 5.3' ^{WEATHER ABRASION} SCRIBE VISABLE

POPLAR 8 N62°15'W 79 LKS.

NO EVIDENCE REMAINS AT BRG. + DISTANCE

6/29/81

FD. COUNTY IRON PIPE 1/4" X 48" APPROX. 10.0' N NW
OF GLO IRON - NO MENTION OF IRON BY GLO

WEST $\frac{1}{16}$ CORNER BET. SEC'S. 7+18

NOTES OF GLO RESURVEY 1918

SET 1" X 3/4" IRON POST WITH BRASS CAP MARKED

7-2-81 CK-6B

Fd. GLO IRON LYING ON $W \frac{1}{16} \frac{57}{518}$

GROUND ALONG WOODS ROAD

ON SOUTH SIDE OF ROAD 1918

WITNESSED BY

R. OAK 18 S 87° 15' W 117 LKS. = 77.22'

NO EVIDENCE FOUND NEAR ROAD CLEARING

W. OAK 7 N 80° W 145 LKS. = 95.70'

Fd. 17" W. OAK AT N 80° W 95.7' FROM SKP. IN ROAD

FROM $\frac{1}{4}$ BET. SEC'S. 7+18

N 89° 30' W 19.29 CHS. = 1273.14'

CHAINED FROM $\frac{1}{4}$ COR. 1273.1' Fd. IRON LYING

ON SOUTH SIDE OF ROAD - LINE WENT DOWN ROAD

SET 60° SPIKE FROM W. OAK BT

NEW TIES TO SPK.

W. OAK 8 N 26° W 19.80' FSLP

R. OAK 13 S 45° W 19.95' BT TAG

NAILED GLO IRON ON 13 R. OAK - WILL SET LATER

AP4 TR 1654 SECTION 16

1918 GLO RESURVEY HARRINGTON Ag #122
 SET IRON PIPE 3 FT X 1" WITH CAP, 26" IN THE
 GROUND MKD:

S16
 TR
 1654
 AP4
 1918

4-13-2000 R MAIN

FOUND IRON IN PLACE FLUSH WITH GROUND ON
 THE EAST SIDE OF A BASSWOOD CLUMP. CORNER
 ON NORTH FACING SLOPE IN MIXED HARDWOODS
 R PINE PLANTATION \pm 100 FT SOUTH AND EAST
 OF CORNER. SMALL URBAN POOL 300' X 50' NORTH
 OF CORNER 75 FT. MKD TWO B.T.S:

R PINE 8" S54°E 62.93 FT TO SPK MKD: S16 BT

R PINE 9 $\frac{1}{2}$ " S33°W 92.7 FT TO SPK MKD 8616 BT

8 FT STEEL SIGN POSTS 303 NORTH 303 WEST
 FD 1936 TAG ON GROUND EAST OF CORNER

7-24-36 STEADLAND 874-9

FD IRON 1" ABOVE GROUND. PLACED FSLP ON 5" ASPEN
 POST @ CORNER.

3-2001 MAIN

LINE TO STANDARD WEST & NORTH OF CORNER

AP2 TR1438 AP3 TR1435 SECTION 1

1918 GLO DEPENDENT RESURVEY

SET 3FT X 1 INCH IRON POST 26" IN
THE GROUND WITH BRASS CAP MKD:

TR
1435
AP3
1403
AP2
TR
1438
1918

57-01 R. MAIN

FD GLO IRON IN PLACE UP 8" ON EAST
FACING SLOPE. CORNER IN MIXED HARDWOODS.
ONE YEAR OLD HARDWOOD THINNING EAST OF
CORNER. MARK TWOSTS.

W OAK 6" N 81° E 19.82 FT TO SOL NWD APS1 BT

W OAK 6" S 49° W 33.80 FT TO SPK MKD APS1 BT

AP1 TR1211 AP4 TR 1215 SECTION 7

1918 GLO DEPENDENT RESURVEY Pg 177
 SET 3 FT X 1" IRON PIPE 26 INCHES IN
 THE GROUND WITH BRASS CAP MKD: TR 57

1215
AP4
AP1
TR
1211
A18

10-22-01 R. MAIN

FD IRON IN PLACE UP 4" CORNER IN
 GRASS ALDER SLOUGH RUNNING NORTH SOUTH.
 HIGH GROUND \pm 60 FT EAST AND \pm 80 FT WEST.
 WITNESS WITH:

W OAK 7" N41°E 68.20 FT TOSP MKD: 57 BT

W OAK 6" N56°E 57.95 FT TOSP MKD: 57 BT

SOUTH WEST SIXTEENTH SECTION 23

3-9-2012 R. MAIN

SET 2" X 2' GALV STEEL PIPE/W/ 3" BRASS CAP 6"

BELOW & FR 2825

W.OAK 7" S45°W 16.62' TO SPK

W.OAK 8" N61°W 18.62' TO SPK

8 FT STEEL SIGN POST 13.42' WEST TO C. OF POST.
LINE TO STANDARD WEST

MONUMENT STAMPED

T141 N R29 W

SW $\frac{1}{16}$ - 5232012
U.S. FS

END OF
BOOK 8