

LEGEND

○ = Corner having information on form 7100-52 in this file.

T145N R31W 5th PM


FILING INSTRUCTION

(Ref. FSM 7150)

File 7100-52 card record by letter and number coordinates behind the file guide for the township in which it falls.

File the 7100-52 card record by letter and then by number i.e., all A cards first, then B cards etc.

The first card behind the file guide (if data have been obtained and recorded) will be card A-1 for N.W. Township Corner, then card A-2 for 1/16 corner then card A-3 for 1/4 corner etc.

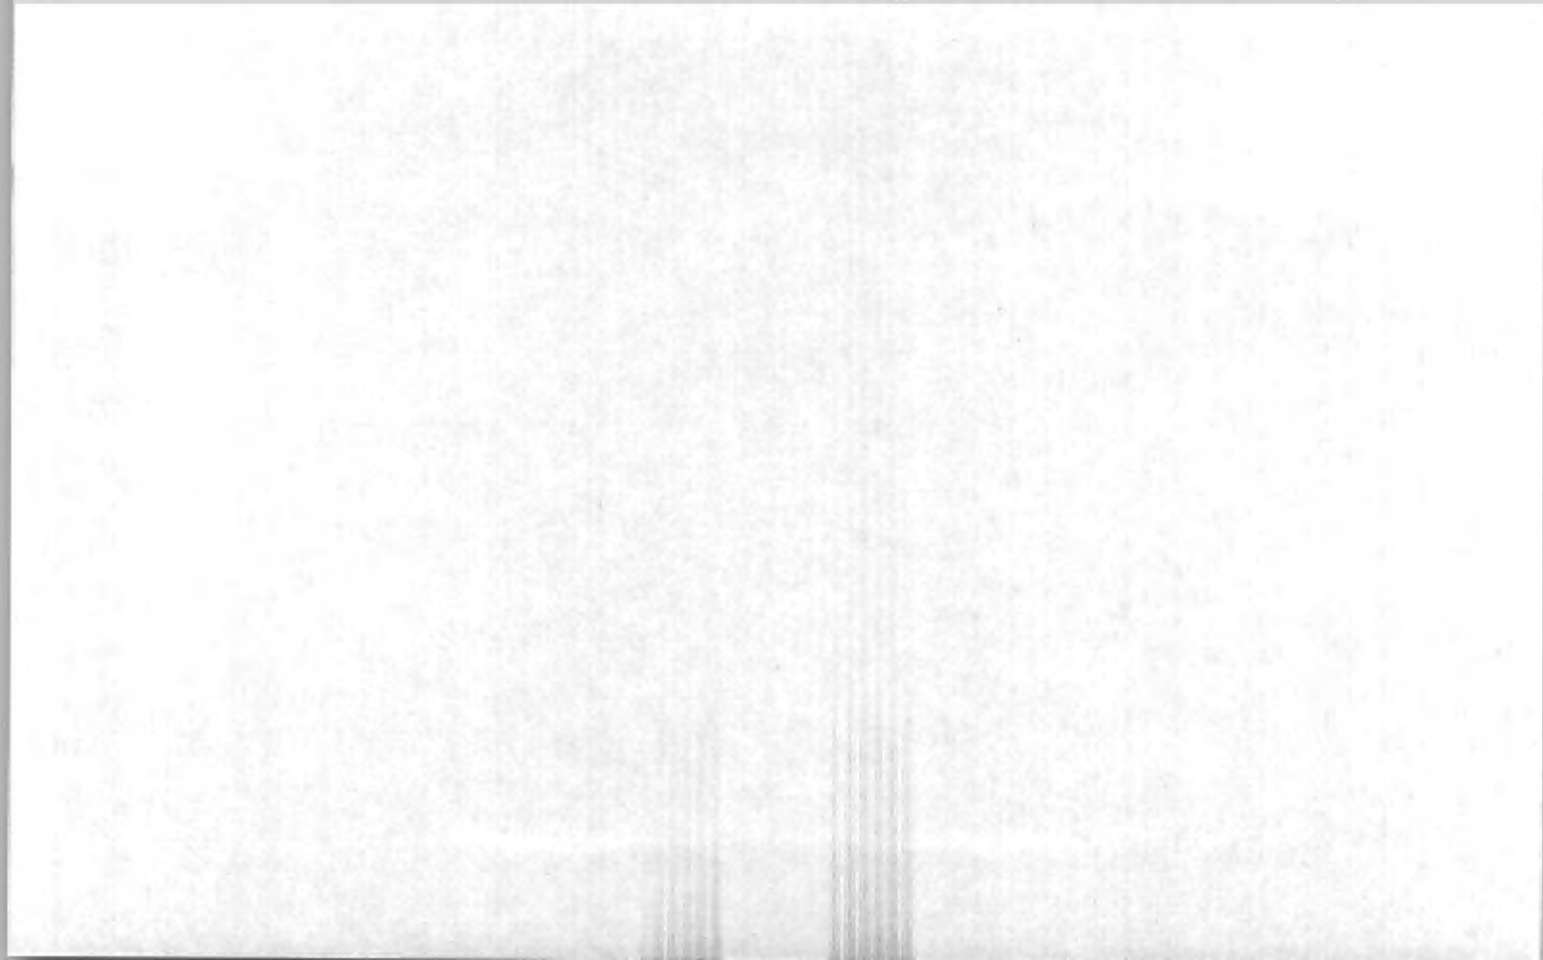

Index No. A 21
(Alphabetical - Numerical)


LAND CORNER RECORD
(RECTANGULAR SURVEYS)

RS-5680-11 (5/12/64)

T. 145 N R. 31 W Mer. N.F. Chippewa County Cass State Minnesota
Section Corner common to sections 1 and 2

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>1873</u>	Year of search _____ By _____
Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found _____
Bearing Trees	Dead Original Bearing Trees Found
Species _____	Species <u>white pine</u>
Diameter _____	Diameter <u>28"</u>
Bearing _____	Bearing <u>S11°E</u>
Distance _____	Distance <u>42 lks</u>
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>1933</u> By _____	Year of search <u>1964</u> by <u>C. A. SCHLUTER</u>
Where filed or recorded _____	<u>Concrete is still in place but brass tablet is gone.</u>
Monument _____ <small>(Original, concrete post, iron rod, etc.)</small>	_____
_____	_____
Bearing Trees, Reference Objects	
Species <u>Burr Oak</u> <u>Burr Oak</u> <u>Burr Oak</u>	<u>Burr Oak</u> <u>Burr Oak</u> <u>Burr Oak</u>
Diameter <u>8"</u> <u>8"</u> <u>6"</u>	<u>8"</u> <u>8"</u> <u>6"</u>
Bearing <u>N37½E</u> <u>S56°E</u> <u>S49½W</u>	<u>N37½E</u> <u>S56°E</u> <u>S49½W</u>
Distance <u>61 lks</u> <u>54 lks</u> <u>42 lks</u>	<u>61 lks</u> <u>54 lks</u> <u>42 lks</u>

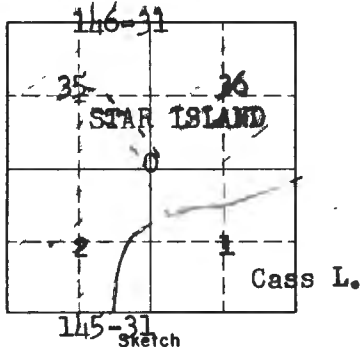

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

A-21

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

At time of search:

1. Did you have the record description?

Yes _____ No X

2. How was search area located?

Pacing, chaining, photos, maps,
 etc. accident

3. Man hours spent in search _____

4. Do you think additional search might
 recover evidence? Yes _____ No _____

5. Signature CEDRIC A. SCHLUTER

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

The concrete is still there, but the brass tablet is gone.

Section corner is in an old logging road.

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records of _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

T. 145N R. 31W Mer. N.F. Chippewa County Cass State Minnesota
1/4 Corner common to sections 35, 146N, R31W and 2

EXISTING SURVEYS

Original Government Survey

Year surveyed _____
Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)Species Bearing Trees
Needle Field
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1933 By GIO
Where filed or recorded _____
Monument Brass cap
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species R. Pine R. Pine
Diameter 16" 15"
Bearing S 30 $\frac{1}{2}$ ° E N 23 $\frac{1}{2}$ °
Distance 23 lks 21 lks

Original Evidence Found

Year of search _____ By _____
Monument found _____

Original Bearing Trees Found


Species _____
Diameter _____
Bearing _____
Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search 1965 By Cedric A. Schluter
Brass cap found. Bearing trees are cut off.
Stumps are rotting.

Stump _____ Stump _____

Relation of Evidence to Record Features Along Section Lines

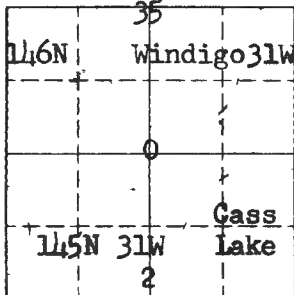

Sketch

○ Corner ▨ F.S. Land

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

Corner is in a small stand of large red pine west of small meadow. It is near an old trail that runs northerly to Lake Windigo.

At time of search:

1. Did you have the record description?
Yes No _____

2. How was search area located?
Pacing, chaining, photos, maps,
etc. compass and chaining

3. Man hours spent in search 5

4. Do you think additional search might
recover evidence? Yes _____ No

5. Signature Cedric A. Schluter

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. A-B-21
(Alphabetical - Numerical)

BOOK # 1
PAGE # 2

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

RD-7150-4 (Rev. 6/13/67)
 GPO 802-127

T. 145N R. 31W
MEANDER

5TH Mer. N.F. CHIPPEWA County CASS
 Corner common to sections _____

State MN.
 _____ and 2

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875 by GLO

Original monument Set post
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species	<u>W. Pine</u>	<u>W. Oak</u>	_____
Diameter	<u>12"</u>	<u>7"</u>	_____
Bearing	<u>N44 W</u>	<u>N45 E</u>	_____
Distance	<u>50.8'</u>	<u>34.3'</u>	_____

Original Evidence Found

Year of search _____ By _____

Monument found _____
GLO found no evidence of Orig. postor BT's.

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1933 By GLO Resurvey

Where filed or recorded _____

Monument Iron post w/brass cap mkd T145N R31W
(Original, concrete post, iron rod, etc.)

S2 S1
MC
1933

Evidence of Subsequent Corner Restoration Found

Year of search 1971 By Curtis Krause


SEE RESTORATION CERTIFICATE.
Iron & cap not found - probably pushed out by ice.

Bearing Trees, Reference Objects

Species	<u>W. Oak</u>	<u>Burr Oak</u>	_____
Diameter	<u>4"</u>	<u>11"</u>	_____
Bearing	<u>N32 3/4 E</u>	<u>N33 1/2 W</u>	_____
Distance	<u>17.8'</u>	<u>129.4'</u>	_____

Bearing Trees, Reference Objects

Species	<u>W. Oak</u>	<u>Burr Oak</u>	_____
Diameter	<u>7"</u>	<u>13"</u>	_____
Bearing	<u>N32 3/4 E</u>	<u>N33 1/2 W</u>	_____
Distance	<u>17.8'</u>	<u>129.4'</u>	_____

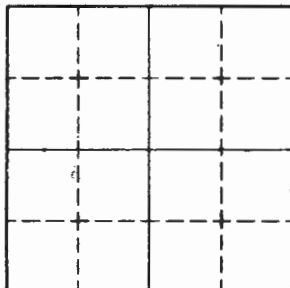

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

A, B-21

Section line to sections _____

Object _____

Record distance _____

Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Corner falls on sandy bank 2 1/2' high.

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional work might recover evidence? _____

5. Signature CURTIS R. KRAUSE

Perpetuation Record

Monument and accessories established. Include brief description of area.

To perpetuate this corner I set a 5 1/2" x 5 1/2" x 24" long conc. mon. flush w/sand, & capped w/3" dia. brass tablet stamped:

T145N R31W N. Pine 6" N44 E 81.7' nail in side (SE)
S2 S1 Elm 7" N19 W 43.7' scribed MC S2 BT

MC

1971 72" steel sign post set 1' North of corner
RLS No. 6807 w/FS sign 54-4 attached. (6-3-71)

CERTIFICATE FILED

Certificate of Survey prepared: _____ Yes _____ No _____ by Miss Stefan

Filed in county _____ at Cass Date 6/17/79 County Document No. 246206

Identified on aerial photo No. _____ Which is filed at _____

Index No. J-20
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
GPO 802-127


T. 145N R. 31W Mer. N.F. Chippewa County Cass State MN
E 1/16 Corner common to sections 11, 14 and _____

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____	Year of search _____ By _____
Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____

Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>1967</u> By <u>BLM</u>	Year of search <u>10/24/79</u> By <u>Alimi-Hayes</u>
Where filed or recorded _____	
Monument <u>Iron pipe 30" long, 2 1/2" dia.</u> <small>(Original, concrete pipe, iron rod, etc.)</small>	<u>Fd. mon. 3" above ground</u>
<u>24" in ground w/ brass cap</u>	

Bearing Trees, Reference Objects			Bearing Trees, Reference Objects		
Species <u>Pine</u>	<u>Pine</u>	<u>Pine</u>	<u>R. Pine</u>	<u>R. Pine</u>	<u>R. Pine</u>
Diameter <u>15"</u>	<u>14"</u>	<u>14"</u>	<u>14"</u>	<u>17"</u>	<u>21"</u>
Bearing <u>S35 1/2 E</u>	<u>S20E</u>	<u>N42W</u>	<u>N42W</u>	<u>S36E</u>	<u>S20E</u>
Distance <u>231ks</u>	<u>351ks</u>	<u>891ks</u>	<u>58.77'</u>	<u>15.10'</u>	<u>22.91'</u>

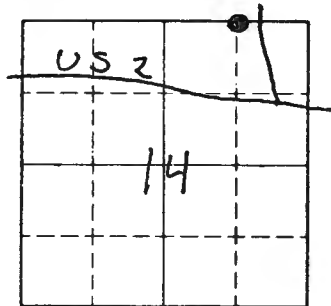

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

Pink ribbon line running west
 Pt 1'x1', 2' S. OF COR.

At time of search:

1. Did you have the record description?
 Yes No _____

2. How was search area located?
 Pacing, chaining, photos, maps,
 etc. _____

3. Man hours spent in search _____

4. Do you think additional search might
 recover evidence? Yes _____ No

5. Signature (M. HAYES)

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Placed BT tags on BT'S

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. K-19
(Alphabetical - Numerical)


LAND CORNER RECORD
(RECTANGULAR SURVEYS)

RR-7 150-4 (Rev. 6/13/67)
 GPO 802-127

T. 145 N R. 31 W 5 Mer. N.F. Chippewa County Cass State MN
CN 1/16 Corner common to sections 14 and _____

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____	Year of search _____ By _____
Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed. <u>1967</u> By <u>BLM</u>	Year of search <u>10/24/1979</u> By <u>Hayes - Alimi</u>
Where filed or recorded _____	Fd. mon. - checked BT's by sight. look good except
Monument <u>Iron Pipe 20" x 2 1/2", 24"</u> <small>(Original, concrete post, iron rod, etc.)</small>	<u>NW oak is a Green Ash</u>
<u>IN Ground</u>	
Bearing Trees, Reference Objects	Bearing Trees, Reference Objects
Species <u>Oak</u> <u>Oak</u> <u>Oak</u>	_____
Diameter <u>6"</u> <u>8"</u> <u>7"</u>	_____
Bearing <u>S51 E</u> <u>S44 W</u> <u>N53 W</u>	_____
Distance <u>28 lks</u> <u>65 lks</u> <u>69 lks</u>	_____

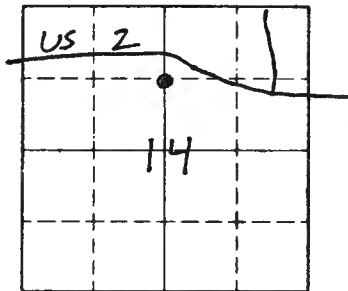

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

At time of search:

1. Did you have the record description?

Yes No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No _____

5. Signature (M. HAYES)

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. L-13
(Alphabetical - Numerical)


LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
 GPO 802-127

T. 145 R. 31 Mer. N.F. CHIPPEWA County CASS State MIN.
QUARTER, BET. Corner common to sections 15 and 16

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>1875</u> <u>B.C. BALDWIN</u>	Year of search _____ By _____
Original monument <u>WOOD POST</u> <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species <u>J. PINE</u> _____ <u>J. PINE</u> _____	Species _____
Diameter <u>18</u> _____ <u>12</u> _____	Diameter _____
Bearing <u>N60E</u> _____ <u>S76W</u> _____	Bearing _____
Distance <u>12 LKS.</u> _____ <u>30 LKS.</u> _____	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>1907</u> By <u>J.W. CURD CO. SURV.</u>	Year of search <u>1982</u> By <u>CK-GB</u>
Where filed or recorded <u>BOOK A PAGE 282</u>	<u>FD. IRON PIPE UNDER BLACKTOP</u>
Monument <u>SET IRON PIPE</u> <small>(Original, concrete post, iron rod, etc.)</small>	<u>NO TIES AS OF NOW - NEED TO CHECK</u>
<u>SURVEY RECORD # 144 SEC. 15</u>	<u>DISTANCE SOUTH TO SECTION COR.</u>
<u>NO RT'S.</u>	
Bearing Trees, Reference Objects	Bearing Trees, Reference Objects
Species _____	_____
Diameter _____	_____
Bearing _____	_____
Distance _____	_____

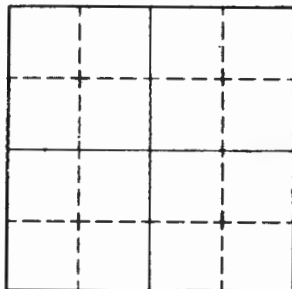

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____

Object _____

Record distance _____

Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional search might

recover evidence? Yes _____ No _____

5. Signature _____

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

T. 145 R. 31 Mer. N.F. CHIP County CASS State IND.
SECTION Corner common to sections 15, 16, 21 and 22

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees			
Species	<u>N. PINE</u>	<u>N. PINE</u>	<u>N. PINE</u>
Diameter	<u>16"</u>	<u>20"</u>	<u>22"</u>
Bearing	<u>N55°W</u>	<u>N33°E</u>	<u>S59°E</u>
Distance	<u>120</u>	<u>98</u>	<u>212</u>

Subsequent Corner Restoration

Year surveyed 2-7-35 By J. A. GJELHAUG
Where filed or recorded C.C.C. NOTES
Monument Post
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects			
Species	<u>N. PINE</u>	<u>N. PINE</u>	<u>N. PINE</u>
Diameter	<u>16"</u>	<u>20"</u>	<u>22"</u>
Bearing	<u>N55W</u>	<u>N33E</u>	<u>S59E</u>
Distance	<u>120</u>	<u>98</u>	<u>212</u>
Feet =	<u>79.2'</u>	<u>64.7'</u>	<u>210.0'</u>

NE N.E. STP. STP. N.E.

Original Evidence Found

Year of search 1935 By J. A. GJELHAUG
Monument found Post

Original Bearing Trees Found

Species	<u>J. PINE</u>	<u>J. PINE</u>
Diameter	<u>10"</u>	<u>8"</u>
Bearing	<u>S37°E</u>	<u>N80°E</u>
Distance	<u>51.7</u>	<u>73.1ks.</u>
	<u>58.7</u>	<u>48.2</u>


Evidence of Subsequent Corner Restoration Found

Year of search 8-9-73 By CURT KRAUSE
NO MONUMENT FOUND
PUT SPIKE IN ROAD 4" BELOW
SURFACE.

Bearing Trees, Reference Objects

Species	<u>PINE STP.</u>	<u>J. PINE</u>	<u>J. PINE</u>	<u>PINE STP.</u>
Diameter	<u>20"</u>	<u>15"</u>	<u>18"</u>	<u>24"</u>
Bearing	<u>N33E</u>	<u>N80°E</u>	<u>S37°E</u>	<u>S59°E</u>
Distance	<u>64.7</u>	<u>48.2'</u>	<u>58.7</u>	<u>140.0'</u>

NO MARKS SCRIBE OPEN SCRIBE OPEN SCRIBE MARKS

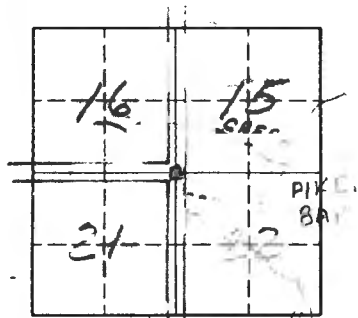

Sketch
 ○ Corner ▨ F.S. Land

142

Relation of Evidence to Record Features Along Section Lines

N-13
 142

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

FOUND NE J PINE SCRIBED AT BR. - DIST.
 FOUND SE J PINE SCRIBED AT BR. - DIST.

FSLP ON 14" J PINE N87°E 37.3'

At time of search:

1. Did you have the record description?

Yes No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search 1 1/2

4. Do you think additional search might recover evidence? Yes _____ No

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____


Identified on aerial photo No. _____ Which is filed at _____

5. Signature Curt Krause

T. 145 N R. 31W 5th Mer. N.F. Chp County CASS State MN
Section CORNER Corner common to sections 15, 16, 21 and 22

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____	Year of search _____ By _____
Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____	Year of search <u>5/14/81</u> By <u>C. KRAUSE, G. BRAMA</u>
Where filed or recorded _____	<u>Fd. remains of two original BT</u>
Monument _____ <small>(Original, concrete post, iron rod, etc.)</small>	<u>Stamps.</u>
_____	<u>Fd two U.S. BT's from 1935 (living)</u>
_____	<u>at bearing + distance. Scribe visible.</u>
_____	<u>No monument found.</u>
Bearing Trees, Reference Objects	Bearing Trees, Reference Objects
Species _____	<u>Pine Stp. Pine Stp. J. Pine J. Pine</u>
Diameter _____	<u>20" 24" 15" 18"</u>
Bearing _____	<u>N33°E S59°E N80°E S37°E</u>
Distance _____	<u>64.7' 140.0' 48.2' 58.7'</u>
_____	<u>No marks Scribe marks.</u>

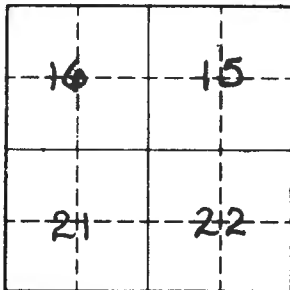

Sketch

○ Corner F.S. Land

At time of search:

1. Did you have the record description?

Yes No

2. How was search area located?

Pacing, chaining, photos maps
etc.

3. Man hours spent in search 1.5 Hr.

4. Do you think additional search might recover evidence? Yes No

Signature

Gary Brown

② of 2

Relation of Evidence to Record Features Along Section Lines

N-13
2 of 2

Section line to sections

Object

Record distance

Measured distance

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

The J.P. at S37°E at 58.7 is marked to be cut because of a sewer project south of CASS LAKE in the year of 1981.

Perpetuation Record

Monument and accessories established. Include brief description of area. 5-14-81

NEW BT'S:

- 1. R. PINE, 10", S56°E AT 97.57'
- 2. R. PINE, 10", S81°E AT 89.38'
- 3. R. PINE, 12", N63°E AT 84.70'
- 4. W. OAK, 14", N16°E AT 142.08'

Place "PK" nail in Blk. Top marking corner position.

Certified corner restoration certificate prepared:

Yes No

Filed in county records at

Date

County Document No.


Identified on aerial photo No.

Which is filed at

T. 145 R. 31 Mer. N.F. CHIP County CASS State MN.
WEST 1/16 BET Corner common to sections 15, 22 and _____

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>NONE</u> Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Year of search _____ By _____ Monument found _____
<p style="text-align: center;">Bearing Trees</p> Species _____ Diameter _____ Bearing _____ Distance _____	<p style="text-align: center;">Original Bearing Trees Found</p> Species _____ Diameter _____ Bearing _____ Distance _____
<p style="text-align: center;">Subsequent Corner Restoration</p> Year surveyed <u>1935</u> By <u>J.A. GJELHAUG</u> Where filed or recorded <u>SURVEY BOOK #10 PAGE 67</u> Monument _____ <small>(Original, concrete post, iron rod, etc.)</small>	<p style="text-align: center;">Evidence of Subsequent Corner Restoration Found</p> Year of search <u>8-8-73</u> By <u>CURT KRAUSE</u> <u>FOUND LARGE PINE STUB AT BEARING AND DISTANCE AS CALLED FOR BY GJELHAUG PINE WAS SCRIBED - NO MONUMENT WAS FOUND AS CORNER IS IN HIGH BRUSH</u>
<p style="text-align: center;">Bearing Trees, Reference Objects</p> Species <u>R. PINE</u> Diameter <u>30"</u> Bearing <u>S14°W</u> Distance <u>198'</u> <u>SCRIBED</u>	<p style="text-align: center;">Bearing Trees, Reference Objects</p> <u>PINE STUB</u> <u>36"</u> <u>S14W</u> <u>198'</u>

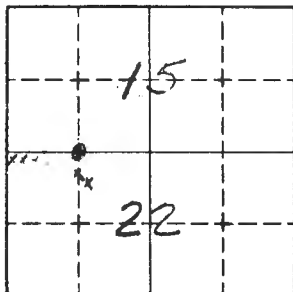

Sketch

○ Corner F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections EAST FROM SEC. COR.
 Object W 116
 Record distance 20.03
 Measured distance 1322'

PUT FLAG ON A 8" N. ALONG TRAIL 675' SOUTH ALONG TRAIL
 Other Evidence
 Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

CHAINED EAST FROM SEC. COR. TO THIS LOCATION.
FOLLOWED FENCE FOR 500' THEN FENCE WENT
IN A SE DIRECTION ALONG HIGHLAND
OUR LINE WAS RUN THROUGH VERY HEAVY BRUSH.
TO THE W 116 APPROX. CORNER - THEN CHAINED
SOUTH TO HIGHLAND 175' ENTER PINE-ASPEN
TRAIL - WE WERE 50' EAST OF PINE

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps,
 etc. _____

3. Man hours spent in search _____

4. Do you think additional search might
 recover evidence? Yes _____ No _____

5. Signature Chris Krause

Perpetuation Record

Monument and accessories established. Include brief description of area.

STUB AS WE RAN LINE SOUTH
CROSSED WOODS TRAIL AT 660' SOUTH OF
W 116 - THEN CROSSED LOOP ROAD AT 1250'
FOR APPROX. NW 116 SEC. 22
BLAZED LINE RAN ALONG OUR LINE TO THE
WEST AND GOT CLOSER AS WE WENT SOUTH
DIDN'T PUT UP FSLP AS THERE WAS NOTHING TO
PUT FLAG ON IN SWAMP

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

T. 145 R. 31 Mer. N.F. CHIP County CASS State MN.
NORTH 1/16 BET. Corner common to sections 21, 22, and _____

EXISTING SURVEYS

Original Government Survey

Year surveyed NONE

Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species _____

Diameter _____

Bearing _____

Distance _____

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found

Species _____

Diameter _____

Bearing _____

Distance _____

Subsequent Corner Restoration

Year surveyed _____ By _____

Where filed or recorded _____

Monument _____
(Original, concrete post, iron rod, etc.)

Evidence of Subsequent Corner Restoration Found

Year of search 8-9-73 By CURT KRAUSE
CHAINED SOUTH FROM SEC. COR.
1323' ALONG CENTER OF ROAD
PUT FSLP ON 8" J. PINE N83°E 31' FROM
NAIL IN ROAD AS APPROX. N 1/16

Bearing Trees, Reference Objects


Species _____

Diameter _____

Bearing _____

Distance _____

Bearing Trees, Reference Objects

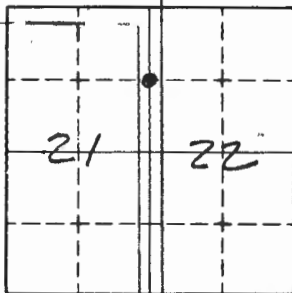

Sketch

○ Corner  F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections SOUTH FROM SEC. COR.
 Object N 116
 Record distance 20.04
 Measured distance 1323'

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No _____

5. Signature Curt Krause

Perpetuation Record

Monument and accessories established. Include brief description of area.

Certified corner restoration certificate prepared: Yes _____ No _____
 Filed in county records at _____ Date _____ County Document No. _____
 Identified on aerial photo No. _____ Which is filed at _____

T. 145 R. 31 Mer. N.F. CHIP County CASS State MN.
NORTHWEST 1/16 Corner common to sections 22 and _____

EXISTING SURVEYS

Original Government Survey

Year surveyed NONEOriginal monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species _____
 Diameter _____
 Bearing _____
 Distance _____

Subsequent Corner Restoration

Year surveyed 2-7-35 By J.A. GJELVAUGWhere filed or recorded FIELD BOOK #110 PAGE 67Monument _____
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species J. PINE
 Diameter 12"
 Bearing S1°W
 Distance 38 lks.
25.1'

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found


Species _____
 Diameter _____
 Bearing _____
 Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search 8-9-73 By CURT KRAUSECHAIN 25.1' FROM NW 1/161319' - FALLS APPROX. 40' SOUTH OFWEST PIKE BAY LOOP ROADFSLP ON 25" N. PINE 22' EAST TOAPPROX. NW 1/16 S-22

Bearing Trees, Reference Objects

Species _____
 Diameter _____
 Bearing _____
 Distance _____

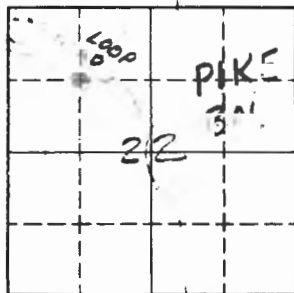

Sketch

○ Corner F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections SOUTH FROM W 116
 Object NW 116
 Record distance 19.98
 Measured distance 1319'

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

PUT FSLP ON 25th NORWAY PINE APPROX. COR. IS
EAST 22' FROM PINE
FOUND PINE STP. S1°W 25' FROM THIS POINT

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps,
 etc. _____

3. Man hours spent in search _____

4. Do you think additional search might
 recover evidence? Yes _____ No _____

5. Signature Curt Krause

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. R-13 Bk 7. 12

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Def 2

X

T. 195 N R. 31 W Mer. N.F. Chippewa County Cass State MINN
Section Corner common to sections 21, 22, 27 and 28

EXISTING SURVEYS

Original Government Survey

Year surveyed _____
Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species Maple
Diameter 0-60
Bearing _____
Distance _____

Original Evidence Found

Year of search _____ By _____
Monument found _____

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration


Year surveyed _____ By _____
Where filed or recorded _____
Monument _____
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search 1962 By RH McDonald
Corney Falls in "T" intersection of Co.
roads and was found to be marked by a
2 inch dia. galvanized iron pipe w/ a pipe
cap stamped 21 22 Pipe was being
exposed w/ excavation so I lower it 6 inches
28 27

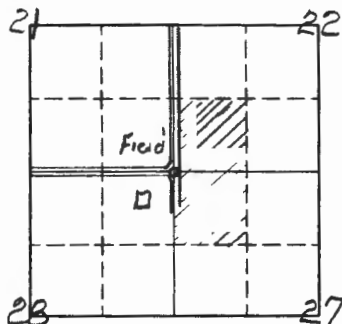

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

① of 2
R-15

Section line to sections _____

Object _____

Record distance _____

Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. corner is in T intersection of county roads. 2" below surface. NO BT SEARCHED for. No tag found. (8-5-63)

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps,

etc. reported by Cass Lake district persnal

3. Man hours spent in search _____

4. Do you think additional search might

recover evidence? Yes _____ No _____

5. Signature

[Handwritten Signature]

Perpetuation Record

Monument and accessories established. Include brief description of area.

I marked new BTs

Red Pine 5" N55°E 43.6 Feet MKD 522 BT

Red Pine 7" S68½°E 34.8 Feet MKD 527 BT

Cedar post 4x4x72 inches penta-treated and w/ red top set due EAST 35.0 Feet w/ sign 54-9 attached

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____

Date _____

County Document No. _____

Identified on aerial photo No. _____


Which is filed at _____

2/2

T. 145N R. 31W 5th Mer. N.F. Chip County Cass State Mn.
SECTION Corner common to sections 21, 22, 27 and 28

EXISTING SURVEYS

Original Government Survey			Original Evidence Found		
Year surveyed _____			Year of search <u>1913</u> By <u>J. CURD</u>		
Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>			Monument found <u>fd. SE & SW BT'S. STANDING</u> <u>GREEN PLAINLY MKD.</u>		
Bearing Trees			Original Bearing Trees Found		
Species _____	_____	_____	Species <u>J. PINE</u>	_____	<u>J. PINE</u>
Diameter _____	_____	_____	Diameter <u>6</u>	_____	<u>8</u>
Bearing _____	_____	_____	Bearing <u>S3 1/2 E</u>	_____	<u>SSW</u>
Distance _____	_____	_____	Distance <u>130.93</u>	_____	<u>123.88'</u>
Subsequent Corner Restoration			Evidence of Subsequent Corner Restoration Found		
Year surveyed <u>1913</u> By <u>J.W. CURD</u>			Year of search <u>5/19/81</u> By <u>Krause, BRAMA</u>		
Where filed or recorded <u>BOOK A PAGE 611 SRN 237</u>			Corner falls in "T" intersection of		
Monument <u>2 1/2" X 48" GALV. IRON PIPE</u> <small>(Original, concrete post, iron rod, etc.)</small>			Co. roads, 2" X 48" galv. pipe with		
<u>MKD NEW BT'S.</u>			cap marked. Pipe is set approx. 4"		
_____			below the road but in very loose		
_____			sugar sand on top. fd. both BT'S mkd.		
_____			by McDonald's Bearing Trees, Reference Objects		
Bearing Trees, Reference Objects <u>1935</u>			but they're mkd. to be cut. <u>R.Pt.</u> <u>R.P</u>		
Species <u>J. PINE</u>	<u>J. PINE</u>	<u>J. PINE</u>	_____	_____	_____
Diameter <u>8</u>	<u>8</u>	<u>8</u>	_____	_____	_____
Bearing <u>N33W</u>	<u>N65E</u>	<u>S85E</u>	_____	_____	_____
Distance <u>49.05'</u>	<u>80.54'</u>	<u>43.2'</u>	_____	_____	_____
<u>OPEN Field</u>	<u>7" X 2 1/2" IR. I.P.</u>	<u>NO EVIDENCE</u>	_____	_____	_____
_____	<u>st p.w. th nail in face.</u>	_____	_____	_____	_____

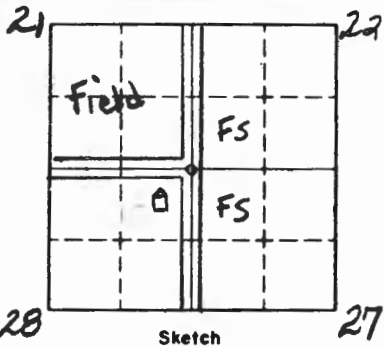

○ Corner ■ F.S. Land

At time of search:

1. Did you have the record description? Yes No

Yes No

2. How was search area located?

Pacing, chaining, photos maps
etc.

3. Man hours spent in search 30 min.

4. Do you think additional search might recover evidence? Yes No

5. Signature

Ray Bunn

(2) of 2

Relation of Evidence to Record Features Along Section Lines

R-13
2 of 2

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

*Sewer project w. I take the BT'S that were in'd in 1922.
Field ~~to the NW~~
House to the SE approx. 300'.
I.P. was not lowered today, because it may be removed during the sewer project.*

Perpetuation Record

Monument and accessories established. Include brief description of area. 5-14-81

Mkd. New BTS:

Mkd.

1. Red Pine, 10" N30°E at 106.47'
2. Red Pine, 19" N52°E at 70.03'
3. Red Pine, 14" S83°E at 112.25'
4. Red Pine, 10" S50°E at 99.78'

Certified corner restoration certificate prepared: Yes No

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____


T. 145 R. 31 Mer. N.F. CHIP. County CASS State MN.
WEST 1/4 BET. Corner common to sections 22, 27, and _____

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>NONE</u>	Year of search _____ By _____
Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>1935</u> By <u>J.A. GJELHAUG</u>	Year of search _____ By _____
Where filed or recorded <u>BOOK #110 PAGE 70</u>	_____
Monument _____ <small>(Original, concrete post, iron rod, etc.)</small>	_____
_____	_____
_____	_____
Bearing Trees, Reference Objects	Bearing Trees, Reference Objects
Species <u>R. PINE</u>	_____
Diameter <u>20"</u>	_____
Bearing <u>S 21° E</u>	_____
Distance <u>20</u>	_____
<u>13.2</u>	_____

Relation of Evidence to Record Features Along Section Lines

Section line to sections	<u>EAST</u>	<u>SOUTH</u>		
Object	<u>114</u>	<u>TRAIL</u>		
Record distance	<u>20.07</u>	<u>17.00</u>		
Measured distance	<u>1324.5'</u>	<u>1122'</u>		

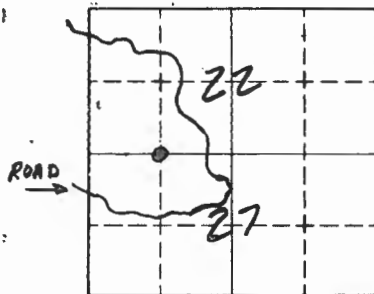

Sketch

○ Corner ▨ F.S. Land

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc.

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No _____

5. Signature _____

Perpetuation Record

Monument and accessories established. Include brief description of area.

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. R-15 ^{Book 1} p 9 23
(Alphabetical - Recorred)LAND CORNER RECORD
(RECTANGULAR SURVEYS)

2 of 2


R9-7 150-4 (Rev. 6/13/67)

GPO 502-127

T. 145 R. 31 S. Mer. N.F. CHIPPEWA County CASS State MN
QUARTER BET. Corner common to sections _____, _____, _____, _____, _____, _____, _____, _____
_____ 22 and 27

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed	<u>1875</u> <u>B.C. BALDWIN</u>	Year of search	<u>2-8-34</u> By <u>J. A. GJELHAUG</u>
Original monument	<u>WOOD POST</u> <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found	<u>FD. OLD POST LYING UNDER</u> <u>ORIG. BT TO SW) FALLEN OVER POST</u>
Bearing Trees		Original Bearing Trees Found	
Species	<u>N. PINE</u> _____ <u>N. PINE</u> _____	Species	<u>N. PINE</u> _____ <u>N. PINE</u> _____
Diameter	<u>6</u> _____ <u>16</u> _____	Diameter	<u>10</u> _____ <u>18</u> _____
Bearing	<u>N19W</u> _____ <u>S31W</u> _____	Bearing	<u>N19W</u> _____ <u>S31W</u> _____
Distance	<u>20 LKS.</u> _____ <u>7 LKS.</u> _____	Distance	<u>20 LKS.</u> _____ <u>7 LKS.</u> _____
	<u>13.2'</u> _____ <u>4.6'</u> _____		<u>13.2'</u> _____ <u>FALLEN DOWN</u> _____
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed	<u>1934</u> By <u>J. A. GJELHAUG</u>	Year of search	<u>8-10-73</u> By <u>C. KRAUSE</u>
Where filed or recorded	<u>BOOK #110</u> <u>PAGE 70</u>		<u>FOUND OLD OAK POST ON GROUND FAIRLY SOLID</u> <u>AND ORIG. BT N. PINE 10 N72W 27.1'</u> <u>SCRIBE CLOSED - TAGGED THIS DAY</u> <u>FD. BOTH OF GJELHAUG'S BT'S.</u> <u>BYER'S SUMMER HOME IS 80' S12W FROM COR.</u>
Monument	<u>SET NEW OAK POST</u> <small>(Original, concrete post, iron rod, etc.)</small>		
	<u>MKD. NEW BT'S.</u>		
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species	<u>N. PINE</u> _____ <u>J. PINE</u> _____	<u>J. PINE</u> _____ <u>N. PINE</u> _____	
Diameter	<u>10</u> _____ <u>6</u> _____	<u>13</u> _____ <u>17</u> _____	
Bearing	<u>N72W</u> _____ <u>S80W</u> _____	<u>S80W</u> _____ <u>N72W</u> _____	
Distance	<u>41 LKS.</u> _____ <u>54 LKS.</u> _____	<u>35.6'</u> _____ <u>26.4'</u> _____	
	<u>27.1'</u> _____ <u>35.6'</u> _____	<u>SCRIBE VISIBLE</u> _____ <u>SCRIBE CLOSED</u> _____	

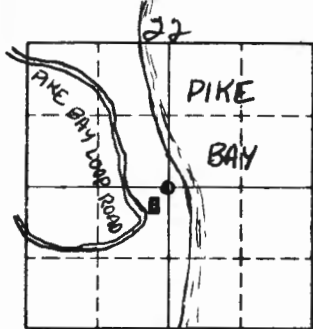

○ Corner ▣ F.S. Land

Relation of Evidence to Record Features Along Section Lines

R-15
2 of 2

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

BYER'S SUMMER HOME IS 512W 80 TO NE COR OF HOUSE
ON WEST PIKE BAY

At time of search:

1. Did you have the record description?

Yes No _____

2. How was search area located?

Pacing, chaining, photos, maps,
 etc. _____

3. Man hours spent in search 1/2 HR.

4. Do you think additional search might
 recover evidence? Yes _____ No

5. Signature Curtis R. Krause

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. R-15
(Alphabetical-Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

RD-7150-4 (Rev. 6/13/67)
GPO 802-127

T. R25N R. 31W S. 5 Mer. N.F. Chippewa County CASS State MINNESOTA
N 1/4 Corner common to sections 27 and _____

EXISTING SURVEYS

Original Government Survey

Year surveyed _____
Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed _____ By _____
Where filed or recorded _____
Monument _____
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Original Evidence Found

Year of search _____ By _____
Monument found _____

Original Bearing Trees Found


Species _____
Diameter _____
Bearing _____
Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

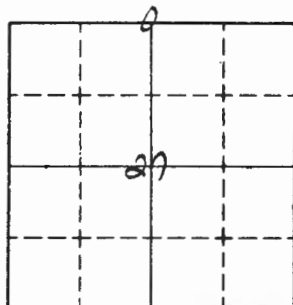

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

R-15
1 of 2

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. *No corner found. Found 2 BTs on path along the Bay. The South west corner of Block is.*

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No _____

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

5. Signature *Cedric Schluter*

Index No. R15-
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)


RS-5660-11 (5/12/61)

T. 145 N R. 31 W Mer. N.F. Chippewa County Cass State Minn.
N 1/4 Corner common to sections 27 and

X

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____ Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Year of search _____ By _____ Monument found _____
<p style="text-align: center;">Bearing Trees</p> Species _____ Diameter _____ Bearing _____ Distance _____	<p style="text-align: center;">Original Bearing Trees Found</p> Species _____ Diameter _____ Bearing _____ Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc.)</small>	Year of search _____ By _____ _____ _____ _____
<p style="text-align: center;">Bearing Trees, Reference Objects</p> Species _____ Diameter _____ Bearing _____ Distance _____	_____ _____ _____ _____

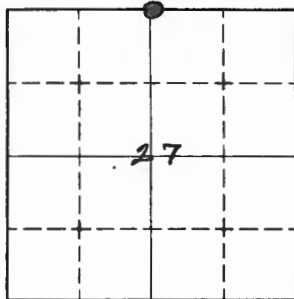

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. *NO CORNER FOUND*
Found 2 BT on Path along the Bay, the South East Corner of Bubars Lot.

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Mon hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No _____

5. Signature *[Handwritten Signature]*

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. 5-14
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

RS-7 150-4 (Rev. 6/13/67)
GPO 802-127

T. 145 R. 31 Mer. N.F. CHIP County CASS State MN.
NORTH WEST 1116 Corner common to sections 27 and _____

EXISTING SURVEYS

Original Government Survey

Year surveyed NONE

Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species _____

Diameter _____

Bearing _____

Distance _____

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found

Species _____

Diameter _____

Bearing _____

Distance _____

Subsequent Corner Restoration

Year surveyed 1935 By J A GJELHAUG

Where filed or recorded BOOK #110 PAGE 70

Monument _____
(Original, concrete post, iron rod, etc.)

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

CHAINED EAST FROM N'116 1338'
TO LOCATION OF NW'116
FOUND TAM. SCRIBED - NOW A SNAG
LINE RUNS UNDER POWER LINE

Bearing Trees, Reference Objects

Species TAM.

Diameter 3"

Bearing N10°30'E

Distance 46 lks.
30.4'

Bearing Trees, Reference Objects


TAM. SNAG

8"

N11°E

30.4'

SCRIBE OPEN

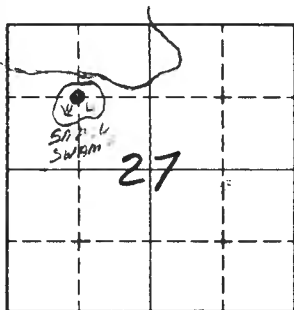

Sketch

○ Corner F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections EAST
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc. Cite source of testimony if any. 8-10-73

FOUND SCRIBED 8" TAM. SNAG AT N11°E 30.4'
SET 4" X 4" X 10' TAM. POST AS NW 1/16 COR. SEC. 27
BT TAG ON 9" NORWAY PINE N10°W 37.0' NOT SCRIBED
" " " 9" NORWAY PINE N28°E 49.0' NOT SCRIBED
FSLP ON TAM. POST

FOUND SCRIBED 3" X 3" X 4' TAM. POST WITH POINT IN
PLACE - TOP 29 LYING ON GROUND UNDER GRASS

Perpetuation Record

Monument and accessories established. Include brief description of area. _____
POST IS 13' NORTH OF POWER LINE POLES IN LINE E 1/4
FSLP ON 19" N. PINE 230' NORTH OF NW 1/16
ON NORTH SIDE OF WEST PIKE BAY LOOP ROAD

- At time of search:
1. Did you have the record description?
 Yes _____ No _____
 2. How was search area located?
 Pacing, chaining, photos, maps,
 etc. _____
 3. Man hours spent in search _____
 4. Do you think additional search might
 recover evidence? Yes _____ No _____
 5. Signature _____

Certified corner restoration certificate prepared: Yes _____ No _____
 Filed in county records at _____ Date _____ County Document No. _____
 Identified on aerial photo No. _____ Which is filed at _____

T. 145 R. 31 Mer. N.F. CHIP County CASS State MN.
CENTER NORTH '116 Corner common to sections 27 and _____

EXISTING SURVEYS

Original Government Survey

Year surveyed NONE
Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1935 By J.A. GJELHAUG
Where filed or recorded BOOK #110 PAGE 70
Monument _____
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species J. PINE
Diameter 6"
Bearing N3°W
Distance 14
9.2'

Original Evidence Found

Year of search _____ By _____
Monument found _____

Original Bearing Trees Found


Species _____
Diameter _____
Bearing _____
Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CHAINED EAST FROM NW '116 1324
TO LOCATION OF CN '116
LINE RUNS AT NORTH EDGE OF CLEARING
FOUND 13" J PINE SNAG 25' HIGH
WITH SCRIBE 1116 #5 BT VISIBLE

Bearing Trees, Reference Objects

Species J. PINE SNAG
Diameter 13"
Bearing N3°W
Distance 9.2'
SCRIBED

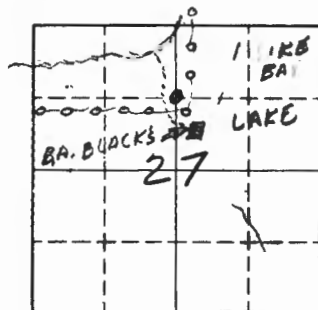

Sketch

○ Corner F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections	EAST	EAST	EAST
Object	CN 116	TRAIL	MC
Record distance	20.06	18.25	9.25
Measured distance	1324'	1204.5	280.5

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. 8-10-73

NO POST FOUND - FALLS IN POWER LINE CLEARING AT NORTH EDGE - FOUND 13" J. PINE SNAG 25' HIGH WITH SCRIBE MARKS - POST IS 13' NORTH OF POWER LINE POLES E/W SAME AS NW 1/16 COR.

PUT BT. TAG ON 13" J. PINE SNAG SCRIBED 116 #5 BT
" BT. " " 19" NORWAY PINE S87°E 36.4' NOT SCRIBED
" BT. " " 20" NORWAY PINE N60°W 21.9' NOT SCRIBED

Perpetuation Record

Monument and accessories established. Include brief description of area. SET NORWAY PINE POST 3" X 8' AT CN 116 COR.
PUT FSLP ON 7" N. PINE 145' WEST OF CORNER
PINE IS ON WEST EDGE OF PVT. ROAD TO B.A. BLACK'S HOME ON SHORE OF WEST PIKE BAY LOOP

At time of search:
 1. Did you have the record description?
 Yes _____ No _____

2. How was search area located?
 Pacing, chaining, photos, maps,
 etc. _____

3. Man hours spent in search _____

4. Do you think additional search might
 recover evidence? Yes _____ No _____

5. Signature _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. S15
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)


T. 145N R. 31W
CA 416

Mer. N.F. Chippewa County Cass State MINN

Corner common to sections 27 and _____

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____ Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Year of search _____ By _____ Monument found _____
<p style="text-align: center;">Bearing Trees</p> Species _____ Diameter _____ Bearing _____ Distance _____	<p style="text-align: center;">Original Bearing Trees Found</p> Species _____ Diameter _____ Bearing _____ Distance _____
<p style="text-align: center;">Subsequent Corner Restoration</p> Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc.)</small>	<p style="text-align: center;">Evidence of Subsequent Corner Restoration Found</p> Year of search _____ By _____ _____ _____ _____ _____ _____
<p style="text-align: center;">Bearing Trees, Reference Objects</p> Species _____ Diameter _____ Bearing _____ Distance _____	

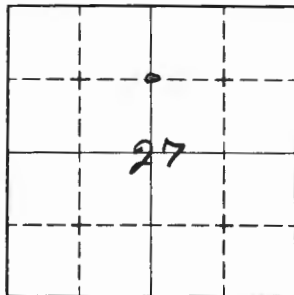

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. One BT found, NO corner, BT is 12 ft north of REA line.

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No _____

5. Signature L Schluter

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. S15
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

T. 145 N R. 31 W 5th Mer. N.F. Chippewa County Cass State Minnesota
N 1/4 Corner common to sections 27 and _____

EXISTING SURVEYS

Original Government Survey

Year surveyed _____
 Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees
 Species Maple Red Pine
 Diameter _____
 Bearing _____
 Distance _____

Original Evidence Found

Year of search _____ By _____
 Monument found _____

Original Bearing Trees Found

Species _____
 Diameter _____
 Bearing _____
 Distance _____

Subsequent Corner Restoration


Year surveyed _____ By _____
 Where filed or recorded _____
 Monument _____
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species _____
 Diameter _____
 Bearing _____
 Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

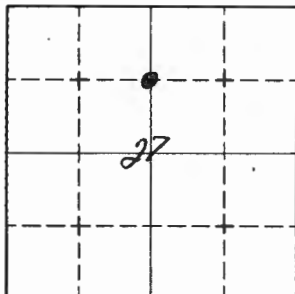

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

S-15

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. *One BT found. The corner BT is 12 feet north of RFA line.*

At time of search:

1. Did you have the record description?

Yes _____ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes No _____

5. Signature _____

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

T. 145 N R. 31 W Mer. N.F. Chip County CASS State MN
SECTION Corner common to sections 27 28 33 and 34

EXISTING SURVEYS

Original Government Survey

Year surveyed _____

Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species _____

Diameter _____

Bearing _____

Distance _____

Subsequent Corner Restoration

Year surveyed. 1913 By J.W. CURROWhere filed or recorded BOOK A PAGE 611 SRN 237Monument 2 1/2" x 48" GALV. IRON PIPE
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species J. PINE J. PINEDiameter 10 5Bearing S47W S40EDistance 54.50' 64.72'

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found

Species _____


Diameter _____

Bearing _____

Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search 5/14/81 By C. KRAUSE & G. BRAMAFd 2" x 48" I.P. which was set byJohn Curro in 1913. Cap has beensheared off. Some threads were visible.Iron is set in position marking cornerFd, a 13" I.P. with a upper + lower flangebut no set bearing trees, reference objects. The size ofNo BT'S Fd, the J.P. when blazedwas around 5".

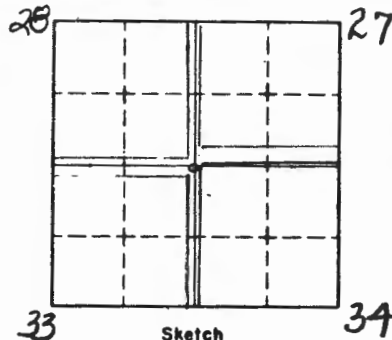

Sketch

○ Corner F.S. Land

Relation of Evidence to Record Features Along Section Lines

V-13

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Corner falls in the center of the roads that bears north, south, & west. The road that bears east is about 15' north of corner.

At time of search:

1. Did you have the record description?

Yes No _____

2. How was search area located?

Pacing, chaining, photos (maps)
 etc. _____

3. Man hours spent in search 1.5 Hr.

4. Do you think additional search might recover evidence? Yes No _____

Try to find out who blazed the J.P.

5. Signature Dary Biama

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

New PT'S:

1. R. PINE, 17" S70°E at 77.68'

2. R. PINE, 17" S36°E at 100.55'

3. J. PINE, 8" N57°E at 89.80'

4. N. PINE, 8" N34°E at 83.93'

Put F.S.L.P. ON W. PINE, 10" S87°E at 47.23

Lowered the J. Pipe with a maul to .5' below surface of road.

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. X-13
(Alphabetical - Numerical)

Book 1 Pg. 15

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

NO-7150-4 (Rev. 6/13/67)
GPO 808-127

T. 145N R. 31W.
QUARTER

5th

Mer. N.F. Chap. County CASS

State MN.

Corner common to sections

33

and 34

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875 By B. C. BALDWIN
Original monument WOOD POST
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species	<u>R. OAK</u>	<u>IRONWOOD</u>
Diameter	<u>8</u>	<u>4</u>
Bearing	<u>S77W</u>	<u>S86E</u>
Distance	<u>28 LKS.</u>	<u>20 LKS.</u>

Original Evidence Found

Year of search 1913 By J. CURO
Monument found Fd. SW R. OAK STANDING - GREEN
PLAINLY MKD. - Fd. ROOTS OF IRONWOOD

Original Bearing Trees Found

Species	<u>R. OAK</u>	<u>IRONWOOD</u>
Diameter	<u>STANDING</u>	<u>STP.</u>
Bearing	<u>S77W</u>	<u>S86E</u>
Distance	<u>28 LKS.</u>	<u>20 LKS.</u>

Subsequent Corner Restoration

Year surveyed 1913 By J. W. CURO
Where filed or recorded BOOK A PAGE 611 SRN 237
Monument 2 1/2" X 48" GALV. IRON PIPE
(Original, concrete post, iron rod, etc.)

MKD NEW BT'S.

Bearing Trees, Reference Objects

Species	<u>ELM</u>	<u>W. PINE</u>
Diameter	<u>10</u>	<u>30</u>
Bearing	<u>S50W</u>	<u>N86E</u>
Distance	<u>63.73'</u>	<u>89.26'</u>

Falls under power line. Fd. stp. at S89E
(Rotted)


Evidence of Subsequent Corner Restoration Found

Year of search 5/14/81 By C. KRAUSE, G. BRAMA
Fd. I.P. with cap (J. Curo) set in place
8" below top of road.

Fd. no remains of ^{orig.} BT'S.

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

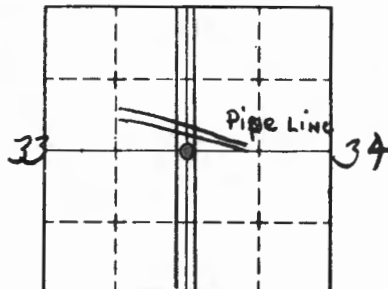

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

X-13

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Fence wire grown into a 14" R. OAK at N87°E,
 Corner falls in center of road.
 Corner falls approx. 300' south of pipe line.

At time of search:

1. Did you have the record description?

Yes No _____

2. How was search area located?

Pacing, chaining photos maps
 etc. _____

3. Man hours spent in search 1.0 Hr.

4. Do you think additional search might recover evidence? Yes _____ No

5. Signature Bary Beama

Perpetuation Record

Monument and accessories established. Include brief description of area.

New BT'S 5/14/81
 1. R. OAK, 11", N65°E at 69.60.
 2. R. OAK, 10", N31°E at 135.25.
 3. W OAK, 10", S50°E at 112.05.

Certified corner restoration certificate prepared: Yes _____ No _____
 Filed in county records at _____ Date _____ County Document No. _____
 Identified on aerial photo No. _____ Which is filed at _____

Index No. 2-13
(Alphabetical - Numerical)Book 1 Page 916LAND CORNER RECORD
(RECTANGULAR SURVEYS)R9-7150-4 (Rev. 6/13/67)
GPO 802-127T. 145N R. 31WMer. N.F. 5th Chip County CassState MN.Standard Section 33Corner common to sections 33 and 34

EXISTING SURVEYS

Original Government Survey

Year surveyed _____

Original monument _____
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species _____

Diameter _____

Bearing _____

Distance _____

Subsequent Corner Restoration

Year surveyed. 1913 By J.W. CUROWhere filed or recorded BOOK A PAGE 611 SRN 237Monument 2 1/2" X 48" GALV. IRON PIPE
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species _____

Diameter _____

Bearing _____

Distance _____

Original Evidence Found

Year of search 1913 By J. CUROMonument found NO ORIG. EVIDENCE FD.
SET GOV'T CHAIN FROM 1/4 COR'S, E & W

Original Bearing Trees Found

Species _____

Diameter _____

Bearing _____


Distance _____

Evidence of Subsequent Corner Restoration Found

Year of search 5/14/81 By C. KRAUSE, G. BRAMAFd. Iron Pipe with cap mkd. set
48" below ground in center of
county road # 143.*See back side of card under
other evidence.

Bearing Trees, Reference Objects

GLOBT.N. PINE25N70W83 LKS.54.8'

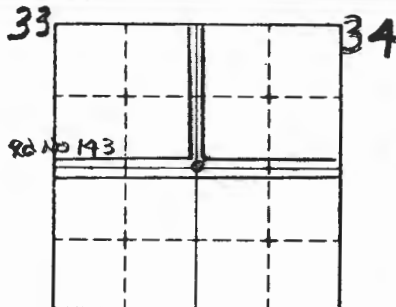

Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Z-13

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

County road runs east + west from corner.
 The corner falls in the center of this road.

Township road runs north of corner.

* Fd. 2" X 48" I.P. with cap mkd. (1912) set in the ground but flush with road. Iron was bent so it was removed for straightening. Pipe split in a couple of places, but was welded up.

Perpetuation Record

Monument and accessories established. Include brief description of area.

New BT'S: 5/14/81

1. W. OAK, 8" N59W AT 123.60'

2. W. OAK, 7" N41W AT 147.70'

3. W. OAK, 6" NR1W AT 161.07'

Large rocks were placed along the length of iron

Put FSLP on a telephone N45W at 51.46'

Iron was reset 1.0' below surface of road. Anchor was cut into two places. One piece still through iron, other is along side.

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

At time of search:

1. Did you have the record description?

Yes No _____

2. How was search area located?

Pacing chaining, photos maps,

etc. _____

3. Man hours spent in search 1.5 Hr.

4. Do you think additional search might recover evidence? Yes _____ No

5. Signature Larry Beerna

Index No. 2-17
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
 GPO 808-924

T. 145N R. 31W 5th Mer. N.F. Chippewa County Cass State Minnesota
Sec Corner common to sections 34, 35, and

EXISTING SURVEYS

Original Government Survey

Year surveyed 1876
 Original monument wood post
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species	<u>N Pine</u>	<u>N Pine</u>	
Diameter	<u>14"</u>	<u>20"</u>	
Bearing	<u>N53°E</u>	<u>N5°W</u>	
Distance	<u>116 lks</u>	<u>166 lks</u>	

Subsequent Corner Restoration

Year surveyed 1930 By GIO
 Where filed or recorded _____
 Monument Cass County Galvanized pipe
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species	<u>NPine</u>		
Diameter	<u>10"</u>		
Bearing	<u>N57°W</u>		
Distance	<u>62 lks</u>		

Original Evidence Found

Year of search 1968 By Martinson
 Monument found None

Original Bearing Trees Found

Species	<u>None</u>		
Diameter			
Bearing			
Distance			


Evidence of Subsequent Corner Restoration Found

Year of search 1968 By Martinson
No corner located

Bearing Trees, Reference Objects

Species	<u>NPine</u>		
Diameter	<u>8"</u>		
Bearing	<u>N57°W</u>		
Distance	<u>62 lks</u>		

Relation of Evidence to Record Features Along Section Lines

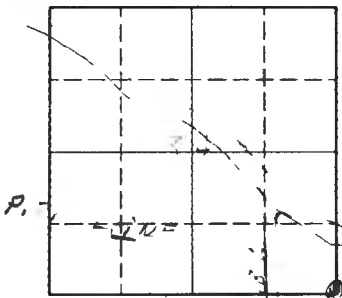

Sketch

○ Corner ▨ F.S. Land

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

C-C plantation probably removed corner

Pipe line passes 10' North of corner. Other bearing trees in pipe line right of way

At time of search:

1. Did you have the record description?

Yes X No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. pacing, compass

3. Man hours spent in search 2

4. Do you think additional search might recover evidence? Yes X No _____

5. Signature Larry Martinson

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____


Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

T. 145N R. 31W Mer. N.F. Chippewa County Cass State Minnesota
MC Corner common to sections 36 and _____

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____	Year of search _____ By _____
Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species <u>Needle leaf</u> <u>White</u>	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>1930</u> By <u>GIO</u>	Year of search <u>1964</u> By <u>C. Schluter</u>
Where filed or recorded _____	<u>Brass cap found</u>
Monument <u>MKD brass cap</u> <small>(Original, concrete post, iron rod, etc.)</small>	<u>Jack pine bearing tree</u>
Bearing Trees, Reference Objects	
Species <u>J Pine</u> <u>W Pine</u>	<u>J Pine</u> <u>W Pine</u>
Diameter <u>15"</u> <u>22"</u>	<u>15"</u> <u>22"</u>
Bearing <u>N46°E</u> <u>N55°30'W</u>	<u>N46°E</u> <u>N55°30'W</u>
Distance <u>81 lks</u> <u>55 lks</u>	<u>81 lks</u> <u>55 lks</u>

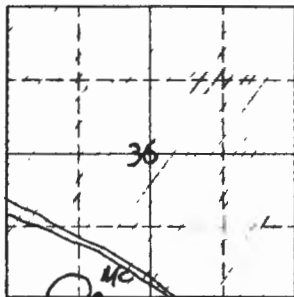

N. TWIN L. Sketch

○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Z-2223

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Corner is west 2.25 chains of S $\frac{1}{4}$ corner of Section 36, T145N, R31W which is visible from Lake 13 gravel pit road, north end of Twin Lakes.

At time of search:

1. Did you have the record description?

Yes _____ No X

2. How was search area located?

Pacing, chaining, photos, maps, etc. compass and pacing

3. Man hours spent in search 1 hour

4. Do you think additional search might recover evidence? Yes _____ No _____

Perpetuation Record

Monument and accessories established. Include brief description of area.

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____


Identified on aerial photo No. _____ Which is filed at _____

5. Signature CEDRIC SCHLUTER

T. 145N R. 31W Mer. N.F. Chippewa County Cass State Minn
1/4 Corner common to sections 36 and

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____ Original monument _____ <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Year of search _____ By _____ Monument found _____
<p style="text-align: center;">Bearing Trees</p> Species _____ Diameter _____ Bearing <u>N 1/2 1/4 Sec 36</u> Distance _____	<p style="text-align: center;">Original Bearing Trees Found</p> Species _____ Diameter _____ Bearing _____ Distance _____
<p style="text-align: center;">Subsequent Corner Restoration</p> Year surveyed <u>1930</u> By _____ Where filed or recorded _____ Monument <u>G10 Brass Cap</u> <small>(Original, concrete post, iron rod, etc.)</small>	<p style="text-align: center;">Evidence of Subsequent Corner Restoration Found</p> Year of search <u>1964</u> By <u>C. J. ...</u> <u>Found Brass Cap and the stump of J.P. Bearing Tree.</u>
<p style="text-align: center;">Bearing Trees, Reference Objects</p> Species <u>Red Pine J.P.</u> Diameter <u>17</u> <u>17</u> Bearing <u>N x 60° 30' E</u> <u>72° 45' W</u> Distance <u>73 LKS</u> <u>153 LKS</u>	<u>Red Pine - J.P.</u> <u>STUMP</u> <u>13 LKS</u>

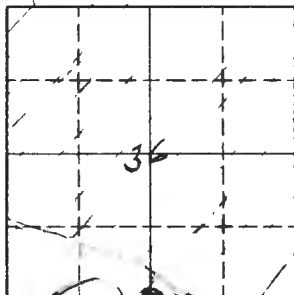

Sketch

○ Corner ▨ F.S. Land

Section line to sections _____

Object _____

Record distance _____

Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. *The corner is*

set with

At time of search:

1. Did you have the record description?

Yes No _____

2. How was search area located?

Pacing, chaining, photos, maps,

etc. *Compu*

Routing

3. Man hours spent in search _____

1 hr

4. Do you think additional search might

recover evidence? Yes _____ No _____

5. Signature *[Signature]*

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____