
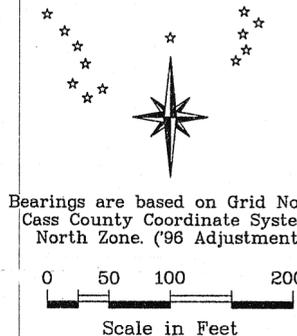


Certificate of Survey for: Ken Meixner

Part of the NW 1/4 of the NW 1/4,
Section 36, Township 144 North, Range 26 West,
Cass County, Minnesota

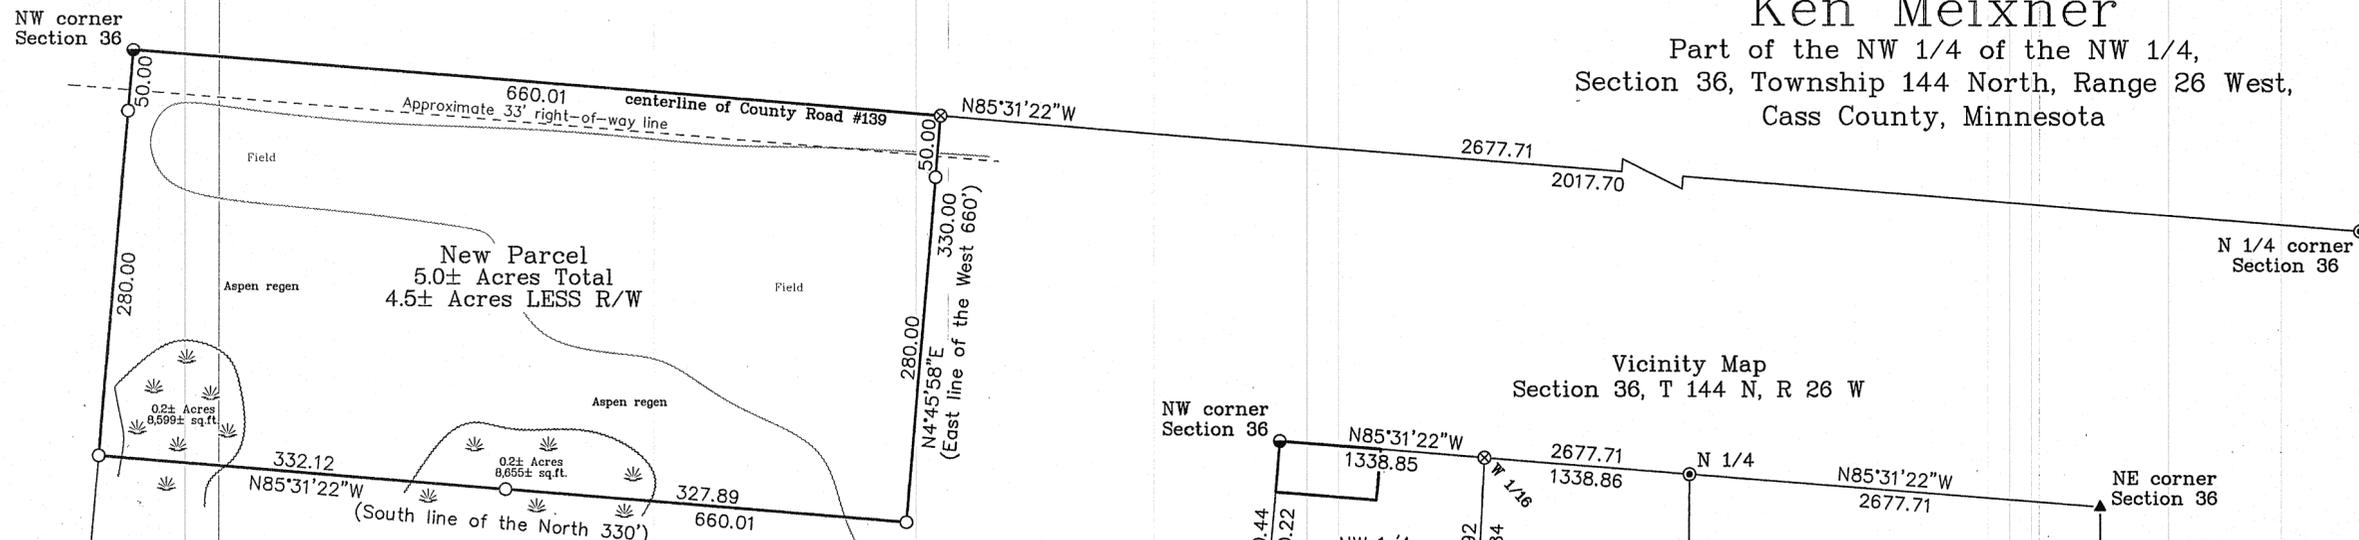

Bearings are based on Grid North,
Cass County Coordinate System,
North Zone. ('96 Adjustment)

NW 1/4
NW 1/4

Legend

- Set 5/8" Rebar marked RLS 16089 @ USFS ties
- Set 5/8" rebar marked RLS 16089
- ⊙ Set 5/8" Rebar marked RLS 16089 for GLO corner
- ⊕ Found County Monument
- ⊙ Found USFS Monument
- ▲ Found spike @ ties
- ⊙ Calculated Position
- Approximate wetland boundary
- Field edge
- Approximate 33' right-of-way line

Proposed Legal Descriptions

New Parcel
North 330 feet of the West 660 feet of the Northwest Quarter of the Northwest Quarter, Section 36, Township 144 North, Range 26 West, of the Fifth Principal Meridian.
Subject to reservations, restrictions and easements of record.



Remnant Parcel
The Northwest Quarter of the Northwest Quarter, Section 36, Township 144 North, Range 26 West, of the Fifth Principal Meridian, LESS the North 330 feet of the West 660 feet thereof.
Subject to reservations, restrictions and easements of record.

North Quarter corner Section 36

On December 11th, 2009, we set a 5/8" Rebar marked by a yellow plastic cap, stamped RLS 16089. Monument is 0.3' under road surface and falls 5.5' south of the centerline of County Road #139. The references are shown below:

7" Aspen	N60E	67.35'
Power Pole	S27W	37.10'
Fence Corner	N50W	53.90'

Although the same Forest Service work sheet showed a N 1/4 at a non-'lost' position which would line up with the rough location of a north-south fenceline in Section 25 & a now gone north-south fenceline in Section 36, its position was rejected because there was no evidence that it was set from GLO or other survey evidence. There is also no evidence that the fence was constructed in the aftermath of a survey which had a N 1/4. It is our belief that the fencelines in Section 25 & 36 were set at a straight distance of 2640 feet from the Northwest corner position. To accept it, would do damage to the landowners in the West half of the Sections.

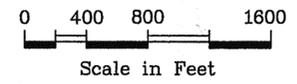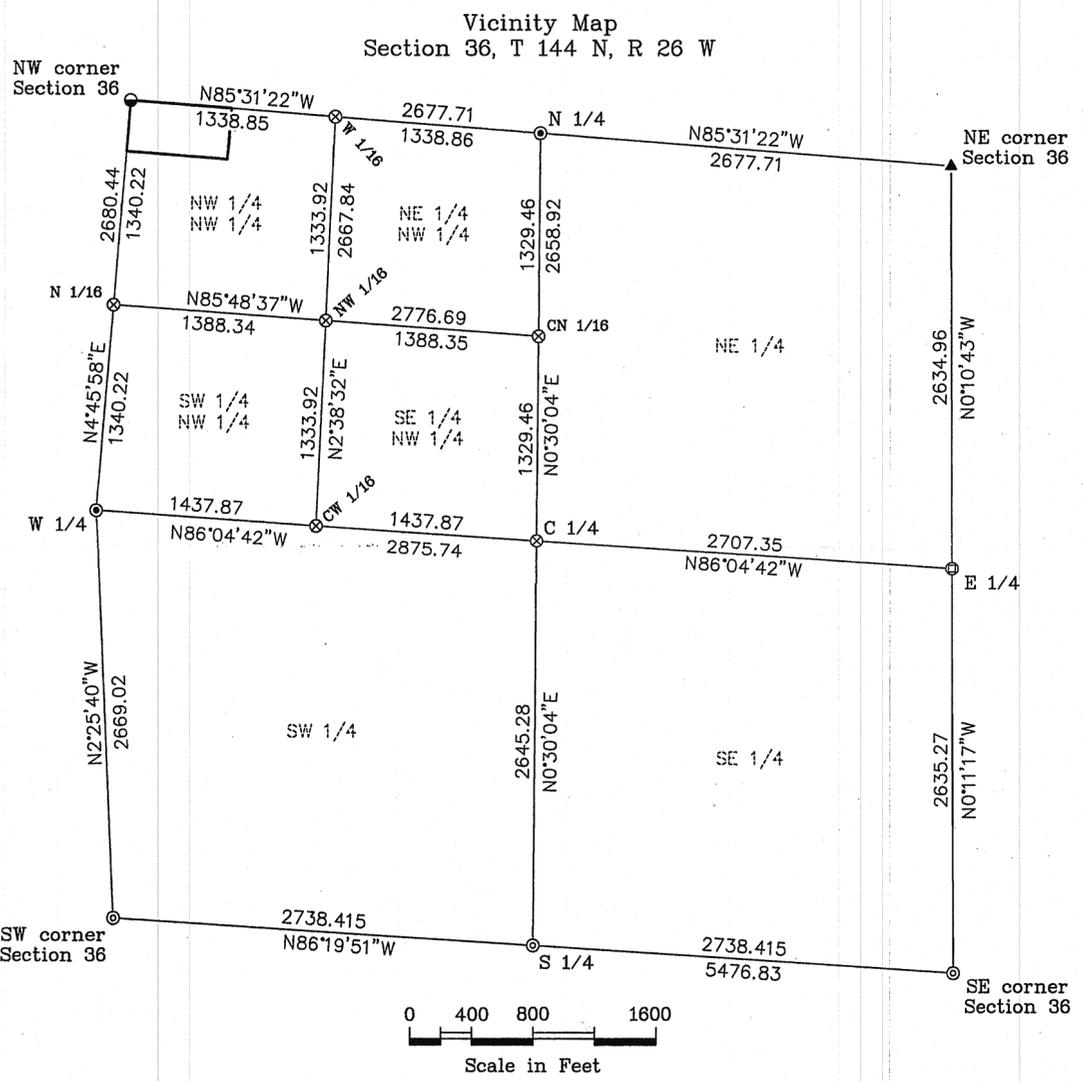


West Quarter corner Section 36

On November 30th, 2009, we set a 5/8" Rebar marked by a yellow plastic cap, stamped RLS 16089. Monument is 87' west of the centerline of a walking trail. The references are shown below:

9" Cedar	S41W	28.04'
10" Aspen	N72E	36.15'

This monument was set in conformance with a 1953 Forest Service photogrammetric retracement survey that allegedly recovered 1 GLO bearing tree at record bearing & distance from the computed position. The information is shown on the 2nd of 2 worksheets in the possession of the Chippewa National Forest & the Cass County Surveyor's office.

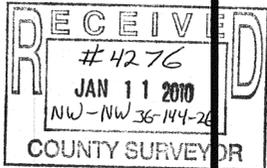

Surveyor's Affidavit

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

LaVerne Leuelling
LaVerne Leuelling



Date: 12-16-09 Registration No. 16089

NORTHERN LIGHTS
SURVEYING & MAPPING, INC.
1007 NW 4th Street
Grand Rapids, MN 55744
Phone/Fax: (218) 326-5325
nlsurveying1001@qwestoffice.net

Certificate of Survey for:

Ken Meixner

Part of the NW 1/4 of the NW 1/4,
Section 36, Township 144 North, Range 26 West,
Cass County, Minnesota

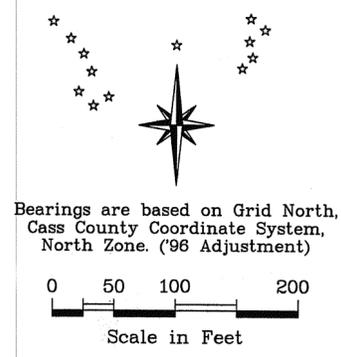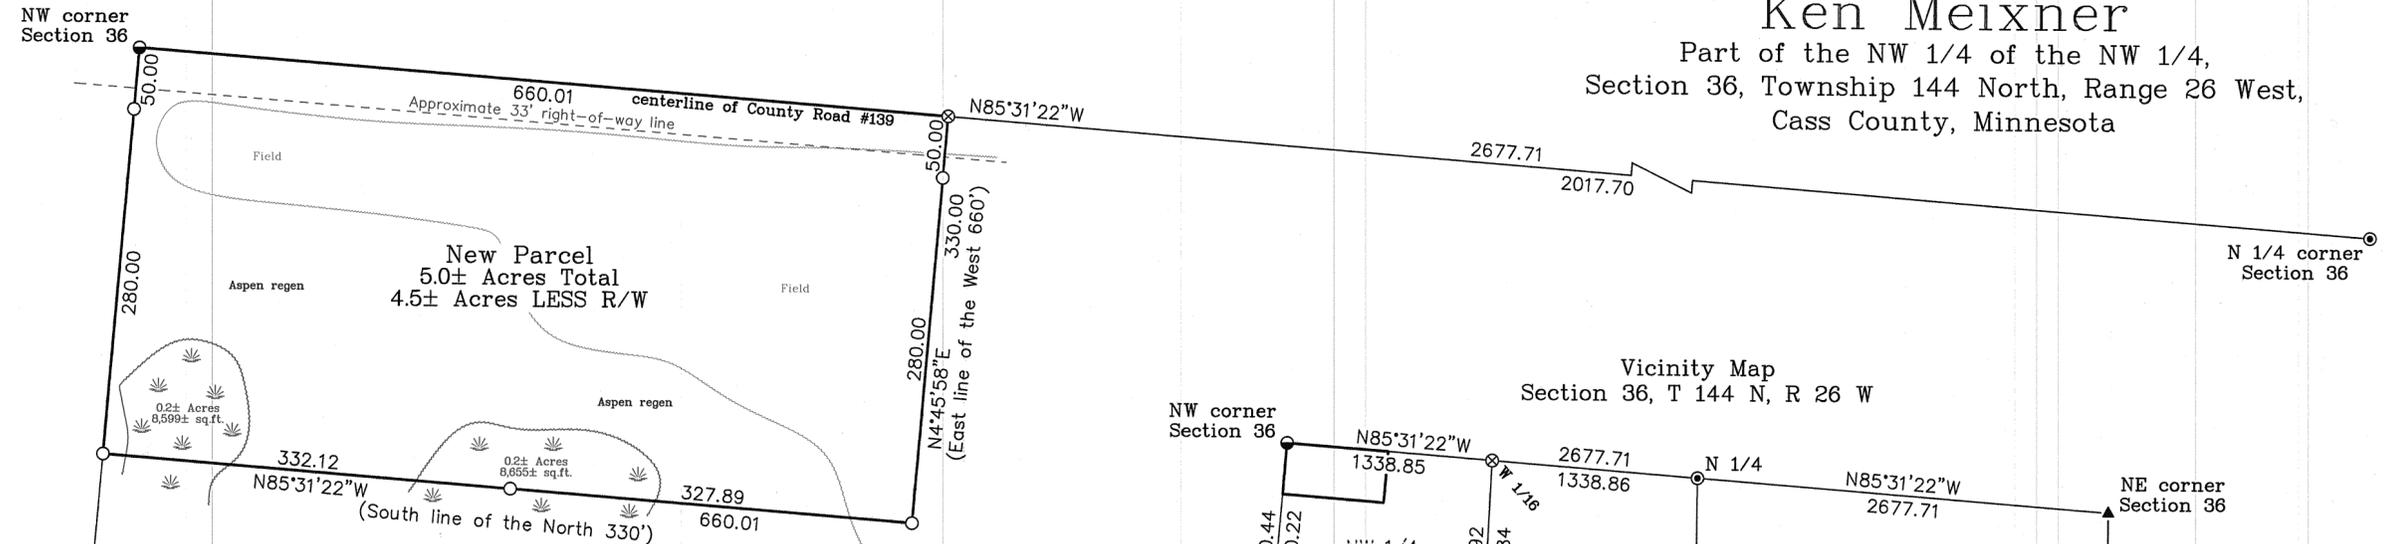

Bearings are based on Grid North,
Cass County Coordinate System,
North Zone. ('98 Adjustment)

- Legend**
- Set 5/8" Rebar marked RLS 16089 @ USFS ties
 - Set 5/8" rebar marked RLS 16089
 - ⊙ Set 5/8" Rebar marked RLS 16089 for GLO corner
 - ⊕ Found County Monument
 - ⊗ Found USFS Monument
 - ▲ Found spike @ ties
 - ⊗ Calculated Position
 - Approximate wetland boundary
 - - - Field edge
 - - - Approximate 33' right-of-way line

Proposed Legal Descriptions

New Parcel
North 330 feet of the West 660 feet of the Northwest Quarter of the Northwest Quarter, Section 36, Township 144 North, Range 26 West, of the Fifth Principal Meridian.
Subject to reservations, restrictions and easements of record.



Remnant Parcel
The Northwest Quarter of the Northwest Quarter, Section 36, Township 144 North, Range 26 West, of the Fifth Principal Meridian, LESS the North 330 feet of the West 660 feet thereof.
Subject to reservations, restrictions and easements of record.

North Quarter corner Section 36

On December 11th, 2009, we set a 5/8" Rebar marked by a yellow plastic cap, stamped RLS 16089. Monument is 0.3' under road surface and falls 5.5' south of the centerline of County Road #139. The references are shown below:

7" Aspen	N60E	67.35'
Power Pole	S27W	37.10'
Fence Corner	N50W	53.90'

Although the same Forest Service work sheet showed a N 1/4 at a non-"lost" position which would line up with the rough location of a north-south fenceline in Section 25 & a now gone north-south fenceline in Section 36, its position was rejected because there was no evidence that it was set from GLO or other survey evidence. There is also no evidence that the fence was constructed in the aftermath of a survey which had a N 1/4. It is our belief that the fencelines in Section 25 & 36 were set at a straight distance of 2640 feet from the Northwest corner position. To accept it, would do damage to the landowners in the West half of the Sections.

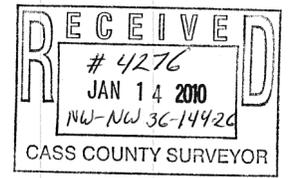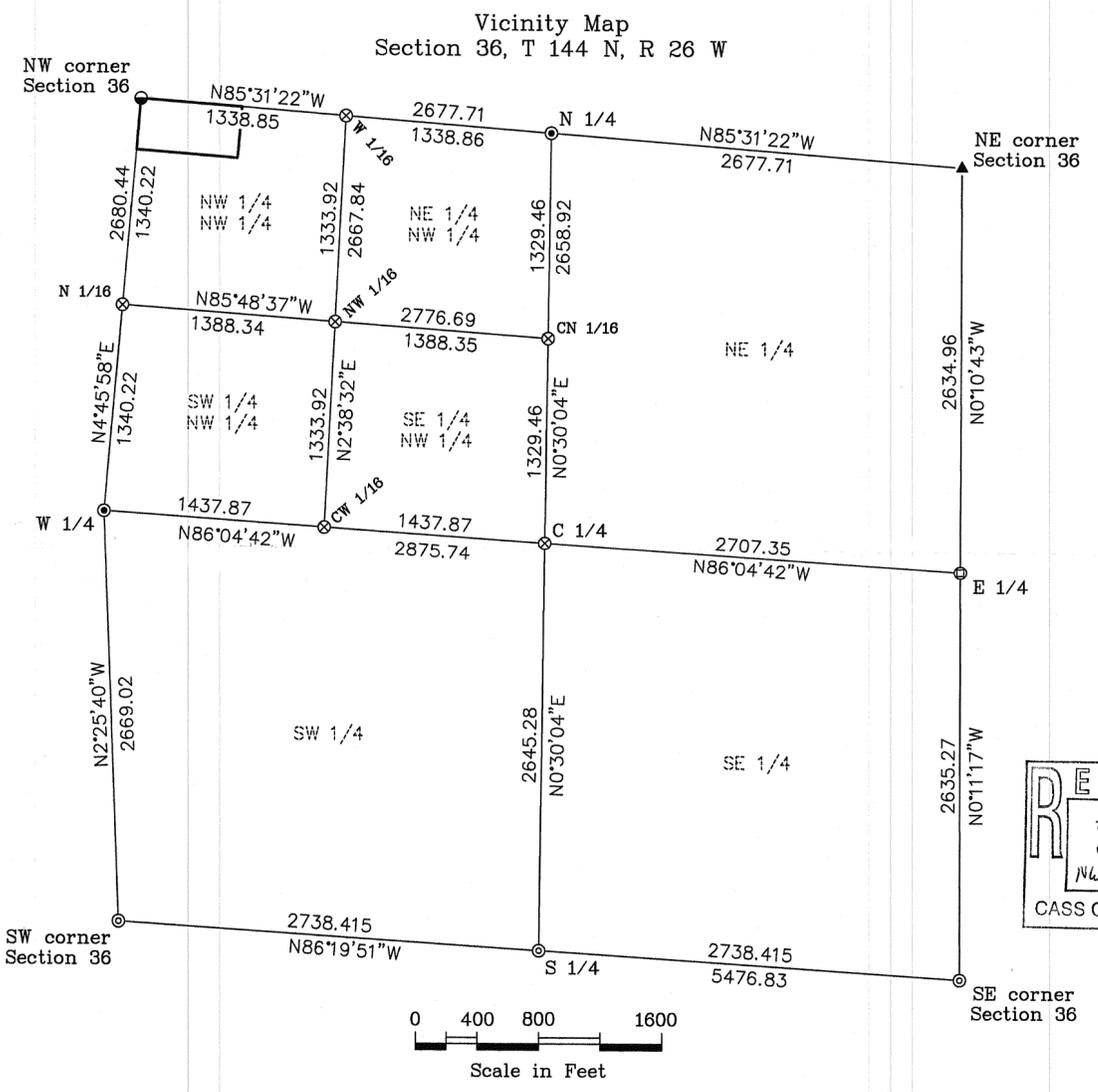

Surveyor's Affidavit

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

LaVerne Leuelling
Date: _____ Registration No. 16089

NORTHERN LIGHTS
SURVEYING & MAPPING, INC.
1007 NW 4th Street
Grand Rapids, MN 55744
Phone/Fax: (218) 326-5325
nlsurveying1001@qwestoffice.net