


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 15, Township 137 N, Range 32 W
5TH Principal Meridian, State of Minnesota, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
- left monument as found, lowered monument, removed monument (explain)
- On 7/29/04 Placed a PK IN CENTERLINE OF NORTH-SOUTH ROAD, 14' NORTH OF CENTERLINE ROAD WEST

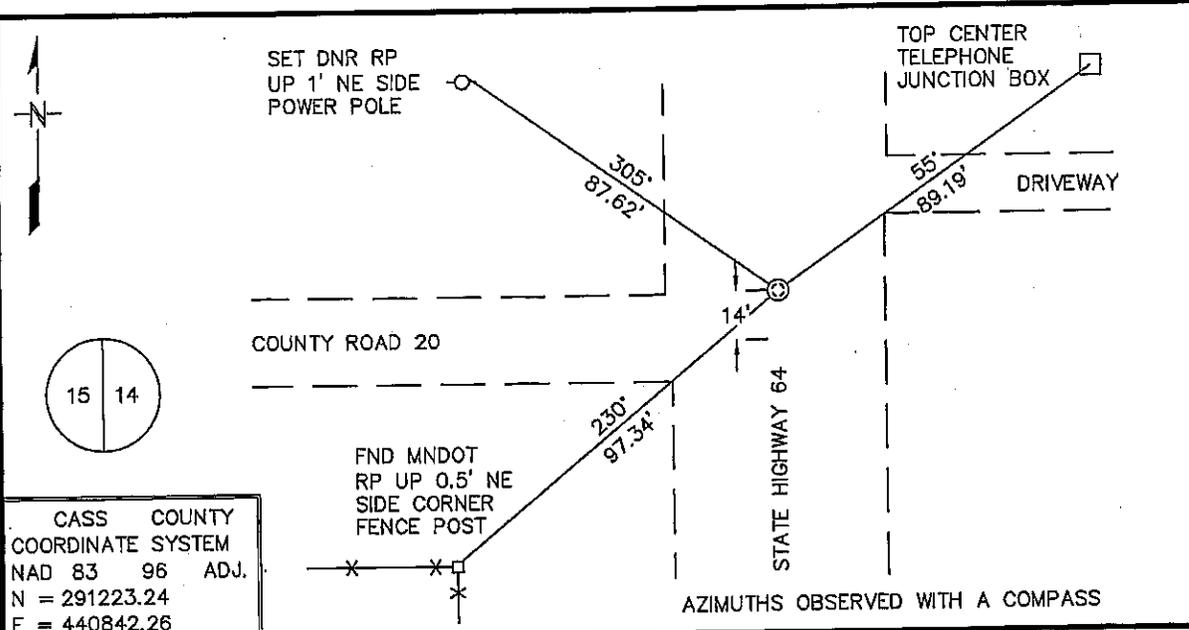

CASS COUNTY
COORDINATE SYSTEM
NAD 83 96 ADJ.
N = 291223.24
E = 440842.26

Statement of evidence for this corner location is on back of this page. JANUARY 2005
SFT00019

I certify that this document was researched and prepared by me or under my direct supervision.

SIGNATURE _____ DATE _____ License Number 16098

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

East Quarter Corner Section 15, Township 137 North, Range 32 West

The Department of Natural Resources, Division of Lands and Minerals, contacted the following offices for information regarding this corner:

MN Secretary of State
 MN Department of Transportation
 Cass County Highway Department
 Cass County Surveyor
 Cass County Auditor
 Cass County Recorder

- 1870 The US General Land Office field notes, on file in the Secretary of State's Office, show this corner to be marked with a post and the following bearing trees were marked:
 Lynn 5" N 80° E 33 links (21.78')
 Maple 8" N 37° W 1.10 chains (72.60')
- 1913 John Curo, Cass County Surveyor, in a resurvey of many sections in this township, stated that N.W. Hicks, Deputy Cass County Surveyor, had established this location five years previously from the old GLO bearing trees and marked the following ties:
 Stone S 45° E 45'
 Stone N 45° W 45'
 From these ties Curo set a 2 ½" x 48" galvanized iron pipe capped on top and set its full length in the center of a graded wagon road south and west.
- 1916 E.B. Horst, Cass County Survey Office, in a resurvey of Ansel Township, found the iron pipe set by Curo.
- 19?? MNDOT construction plan for State Highway 64 show in place spike for the corner at intersection of State Highway 64 and centerline Township Road west. A distance of 2628.4' is listed to the Southeast Corner of Section 15 and 2634.6' to the Northeast Corner of Section 15.
- 1964 Cass County Highway Dept. Construction plan for C.S.A.H. 20, show the corner location assumed as 14' north of the intersection of centerline State Highway 64 at centerline C.S.A.H. 20. The plan shows the new road built 14' south of the old road. The assumed station for the corner is 321+68.0. Nothing is indicated if corner was found or set.
- 2004 In March, the DNR survey crew searched for evidence of the corner and found no bearing trees or corner. Crew did locate the intersection of centerline State Highway 64 at centerline road west. The corner was determined obliterated and a PK nail was set in the centerline of the north-south highway and 14' north of the centerline of the road west.