

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 3, Township 142 N, Range 25 W, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On 10/26/90 found a 2½ inch aluminum capped monument 8 inches
DATE
above ground
- left monument as found, lowered monument, removed monument (explain)
- On _____ placed a _____
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
 Not to Scale

All distances are horizontal to nail in side of tree

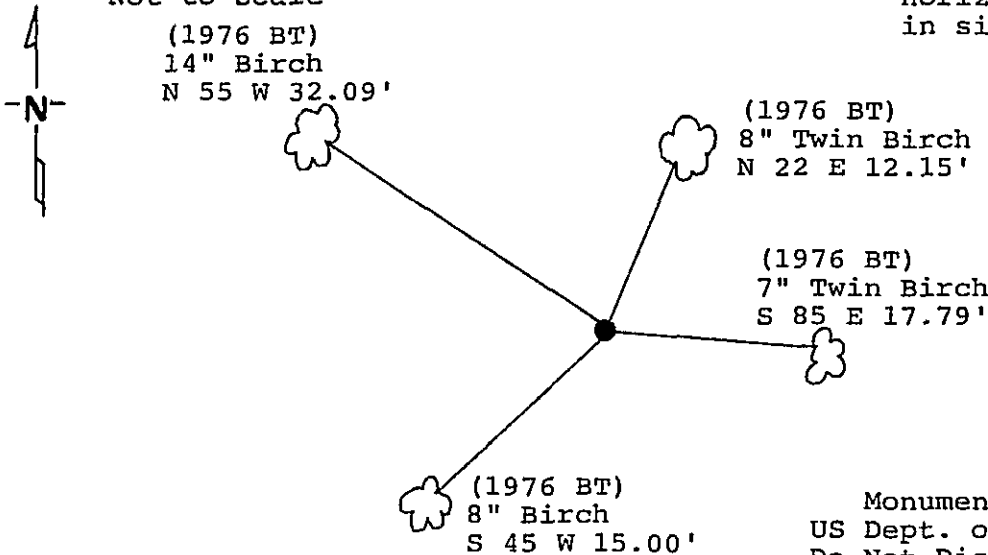

Monument is locate on north facing slope of hill.
 8' steel sign post 3.0' West.

Monument Stamped
 US Dept. of the Interior
 Do Not Disturb
 T143N R25W
S34 | S35
S3 | S2
 T142N
 1976
 Cadastral Survey
 Bur. of Land Management

All trees found with blazing and scribing per 1976 BLM. Painted with red enamel and marked with a 54-3 (Bearing Tree) tag.

Statement of evidence relative to this corner location is on back of page. 325281

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David L. Loh 11/28/90
SIGNATURE DATE

Registration No. 17008

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS

County of Cass

I hereby certify that this document was filed in the Reg. of Deeds office at 4:20 P.M. on the 29 day of November A.D., 19 90

Register of Deeds *Claudia K. Kaylor*

By *ms*, Deputy

DOCUMENT NO. 325281

Northeast corner, Section 3, Township
142 North, Range 25 West, Cass County,
Minnesota

A-17

1871 Walker, Putnam and Allen, U.S. Deputy Surveyors, originally established this corner position while running the line between Townships 142 and 143 North, Range 25 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 14 inch Birch North 80 degrees East a distance of 12 links; a 4 inch Birch North 52 degrees West a distance of 16 links; a 4 inch Maple South 4 degrees West a distance of 10 links; and a 4 inch Spruce South 40 degrees East a distance of 9 links.

1976 Bureau of Land Management dependent resurvey reestablished this corner at the single proportionate position between the Meander corner on the West side of Willow Lake and the North Quarter corner of Section 4. A 2 and 1/2 inch by 28 inch aluminum pipe with an aluminum cap was set to mark the corner. The following bearing trees were marked: an 8 inch Birch North 17 degrees East a distance of 20 links (13.20 feet); a 6 inch Birch South 89 degrees East a distance of 27 links (17.82 feet); an 8 inch Rich South 60 degrees West a distance of 23 and 1/2 links (15.51 feet); and a 10 inch Birch North 49 degrees West a distance of 50 links (33.00 feet).

1979 Gary Stevenson & Associates, Inc., survey crew found the 1976 Bureau of Land Management monuments around Section 34, Township 143 North, Range 25 West. They were used to subdivide said section.

1990 on October 26, a Landecker & Associates, Inc., survey crew found the 2 and 1/2 inch aluminum capped monument 8 inches above ground as set by the Bureau of Land Management in 1976. Bearing trees were found as shown and a steel sign post was set as noted on front of this certificate.