

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

MC #26 of Section 01, Township 141 N., Range 30 W., 5th P.M.
State of Minnesota, County of Cass

At the corner location shown on the sketch:


On 03-11-2011 found GLO brass cap lying on ground. Found 1981 northwest BT
and stump of southwest BT and two sign posts.

left monument as found lowered monument removed monument (explain)

On 04-18-2011 placed a 1/2" rebar with a 3.5" diameter brass cap,
flush with the surface grade, wired to an 8' sign post.



SKETCH OF REFERENCE TIES (NOT TO SCALE)

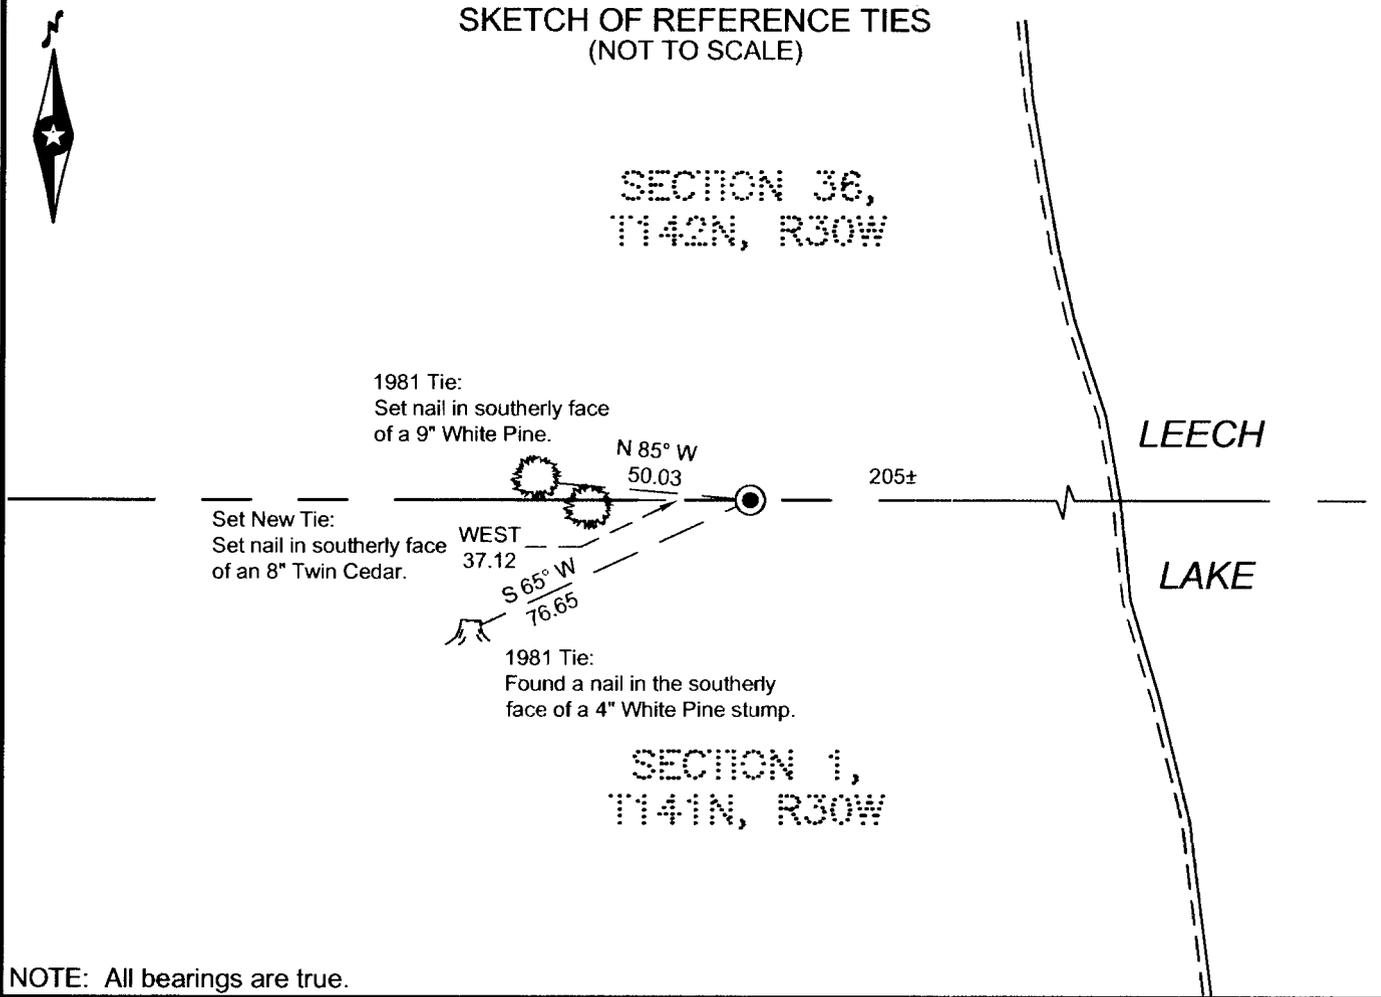

NOTE: All bearings are true.

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed land Surveyor under the laws of the State of Minnesota. I further certify that this United States public land survey monument record is correct and complete to the best of my knowledge and belief.

Terry L. Freeman, Land Surveyor

Date 2/28/12 MN License No. 21367

A000578312
OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
03/01/2012 2:29:48 PM
AS DOC #: A000578312
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER

Index No. A.0 - 24.9

STATEMENT ON EVIDENCE

Meander Corner #26 of Section 01, Township 141 North, Range 30 West of the 5th Principal Meridian.

In 1873, P.H. Conger, U.S. Deputy Surveyor, set a wood post inplace for the location of this corner and established bearing trees as follows: an 8" Tamarack, N88°W 172 links and a 5" Tamarack, S89°W 172 links.

1903-1904, U.S. Army Corps of Engineers' map for the Leech Lake Reservoir shows a corner found by surveyor Horace Dunaway. A copy of the map is on file in the Cass County Survey Department.

In 1917, Earl G. Harrington, U.S. Surveyor, finds a 3" x 36" Cedar post and sets a 1" x 36" iron pipe with brass cap and marked two BT's: a 12" Tamarack, N33°W 553 links and an 8" Birch, S2-1/2°W 427 links. Running notes on file in the Cass County Survey Department.

In 1981, Surveyor Walter E. Curo finds GLO brass cap leaning in bog. He marks two BT's: a 4" White Pine, N85°W 50.03 feet and a 3" White Pine, S65°W 76.65 feet and sets sign posts West 2.65 feet and South 3.5 feet. He files corner certificate as Doc #A000265243. Also in Curo restoration Book 309, Page 102.

On March 11, 2011, a Northern Engineering & Consulting survey crew found the GLO iron tipped out and the two 1981 BT's and two sign posts. They set a 1/2" rebar with a 3.5" diameter brass cap, flush with the surface grade. One new tie was set as shown on the front page of this certificate. Corner position accepted as a perpetuation of the 1917 GLO position.

Minnesota State Plane (Central Zone)

Northing 1081458.927
Easting 2585750.244

County Coordinates (Cass County North)

Northing 195699.164
Easting 452773.468

