


Index No. C 21

CASS COUNTY LAND CORNER RECORD

T. 134 R. 31 M. 5TH Coordinates: X _____ Y _____
E 1/4 R Corner common to sections 1, 2

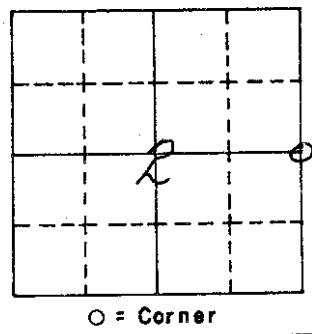

EXISTING SURVEYS

Original Government Survey

Year surveyed 1869
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Species	Bearing	Trees
<u>Aspen</u>	<u>Aspen</u>	
Diameter <u>4"</u>	<u>16"</u>	
Bearing <u>N 85 W</u>	<u>S 88 E</u>	
Distance <u>16 LKS.</u>	<u>14 LKS</u>	

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1915 By N.O. Gorman
Location filed County Book 'B' P. 484-495
Monument SET IRON MONUMENT PROPORTIONALLY
also on microfilm - roll 115 BK 79 P. 139

Evidence of Subsequent Corner Restoration

Year of search 5/14/86 By Freeman, Glen Williams
Backhoe
dug at fence east; 6' N-S Road
6' E-W X 12' N-S 3' deep
6" top of road, 2' fill, 6" natural-black
dirt w/ layer of large rocks - broke to top line
of road cable in middle

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Bearing Trees, Reference Objects

Found nothing

Subsequent Corner Restoration

Year surveyed 1986 By T. FREEMAN
Location filed _____
Monument SET 2" X 18" TELESPAR MON W/ALUM
CAP

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CEAT - W. CURD - 1990
Doc. # 319826
Jan. 1914, Twp rd order shows no survey

BURR OAK	RED OAK	RED OAK
<u>5"</u>	<u>3"</u>	<u>5"</u>
<u>N 34 W</u>	<u>N 62 E</u>	<u>S 62 W</u>
<u>46.15</u>	<u>39.35</u>	<u>61.61</u>

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____