


T. 136 R. 29 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
E 1/4 8 Corner common to sections 8, 9

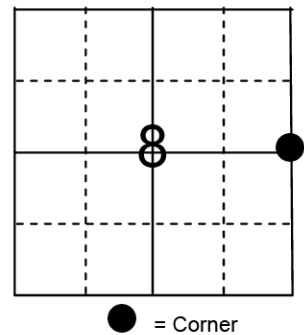

EXISTING SURVEYS

Original Government Survey

Year surveyed 1870  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species	<u>Norway Pine</u>	<u>Norway Pine</u>	_____
Diameter	<u>14"</u>	<u>15"</u>	_____
Bearing	<u>N 62° W</u>	<u>S 60° E</u>	_____
Distance	<u>17 links</u>	<u>69 links</u>	_____

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 6/1911 By W.H. Lufman  
Location filed: Loon Lake Township Road Order #11  
Monument: 1/4 sec post

Evidence of Subsequent Corner Restoration

Year of search 7/1915 By J. Ingram  
Location filed: Loon Lake Township Road Order #4  
Monument: old stake at corner

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 10/1918 By J.D. Middleton, Dept Co. Surv  
Location filed: Survey Rec. #402, Book C, page 138  
Monument: Set I.M.  
find no evidence for corner. Set corner at 2672.60 and witness  
5" Jack Pine, N 54°18' W, 79.45'  
8" Jack Pine, N 16°20' E, 105.05'

Evidence of Subsequent Corner Restoration Found

Year of search 8/2018 By CCHD/SO  
Location filed: #2018.019  
Monument: Found 2" ODIP  
down 1.6', 19'+/-, S. of centerline CSAH #17 and 16.5'+/-, E. of 13th Ave. and witnesses.  
Corner Post, S 50° W, 60.91'(2004) 60d spike, up 0.6', N. side  
11" Spruce, N 49° W, 89.49' duplex nail, up 1.0', S. side  
Power Pole, N 11° E, 31.39' duplex nail, up 1.0', E. side  
7/8" Pipe, N 11° W, 19.35' flush, on centerline/centerline

3/1919, J.H. Flynn, Cass County Surveyor  
Subdivision Section 8  
Indicates 2.5 x 30" Iron Monument established by this survey.

11/1997, B. Grivna, LS 17253  
Certificate of Survey for Nelson, #5495  
Indicates found iron monument.

3/2004, B. Grivna, LS 17253  
Certificate of Survey for Hogle, #2238  
Indicates iron monument found.

5/2004, B. Grivna, LS 17253  
Certificate of Location of Government Corner  
Indicates a found 2" iron, down 1.6', 19'+/-, S. of centerline  
CSAH #17 and 16.5'+/-, E. of 13th Ave. and witnessed.  
Power Pole, N 10° E, 49.45' spike  
Power Pole, S 05° E, 220.38' spike  
Corner Post, S 50° W, 60.91' spike

4/2020, CCHD/SO  
#2018.019  
After reconstruction of CSAH #17, set a 1"x 20" alum. Co. mon.  
over the recovered iron pipe, down 0.05', 14'+/-, E. of centerline  
of 13th Ave. and 19', S. of new centerline of CSAH #17.

5/2020, T.L. Freeman, LS 21367  
Filed a Certificate of Location, Doc. #A000659268 on the above  
information.

