


T. 141 R. 27 M. 5th Coordinates: X _____ Y _____

NE 10 and MC #10 Corner common to sections 2, 3, 10, 11

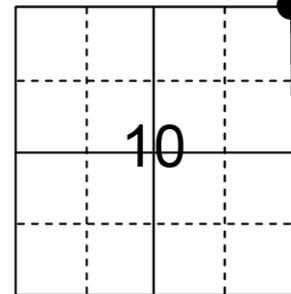

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
Original monument Post

Original Evidence Found

Year of search 1919 by GLO
Monument found _____

Resurvey Notes

Bearing Trees

Species	<u>Norway Pine</u>	<u>Norway Pine</u>	_____	_____
Diameter	<u>10"</u>	<u>8"</u>	_____	_____
Bearing	<u>S 28° W</u>	<u>N 35° E</u>	_____	_____
Distance	<u>59 links</u>	<u>50 links</u>	_____	_____

Original Bearing Trees Found

Species	<u>Pine Stump</u>	_____	_____	_____
Diameter	<u>16"</u>	_____	_____	_____
Bearing	<u>S 28° W</u>	_____	_____	_____
Distance	<u>59 links</u>	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1919 By D. Clement, GLO
Location filed: Resurvey Notes, MN Hist. Soc. T141N R27W
Monument: Set 2" iron pipe w/brass cap S 3 | S 2
from original witness stump. S 10 | S 11
New witness as follows. 1919

Evidence of Subsequent Corner Restoration

Year of search 10/1968 By W.H. Okerman, LS 6807
Location filed: USFS Field Book 2, page 51
Monument: Found GLO iron pipe with brass cap and remains of 1919 witness trees, all down.

Bearing Trees, Reference Objects

Species	<u>Jack Pine</u>	<u>Jack Pine</u>	<u>Jack Pine</u>	<u>Jack Pine</u>
Diameter	<u>6"</u>	<u>8"</u>	<u>10"</u>	<u>10"</u>
Bearing	<u>N 19°45' E</u>	<u>S 31°45' E</u>	<u>S 63°45' W</u>	<u>N 20°15' W</u>
Distance	<u>67 links</u>	<u>39 links</u>	<u>18 links</u>	<u>13 links</u>

Bearing Trees, Reference Objects

Species	<u>Red Pine</u>	<u>Red Pine</u>	<u>Jack Pine</u>	_____
Diameter	<u>8"</u>	<u>16"</u>	<u>8"</u>	_____
Bearing	<u>N 44° E</u>	<u>N 10° W</u>	<u>S 77° E</u>	_____
Distance	<u>88.7'</u>	<u>32.2'</u>	<u>7.3'</u>	_____

Subsequent Corner Restoration

Year surveyed 10/1987 By R.L. Kovanen, LS 16459
Location filed: Certificate of Location, #302626
Monument: Found 2" iron pipe with brass cap
15'+/-, E. of Mabel Lake and witnesses.
20" Red Pine, N 10° W, 32.2'(1968)
J. Pine stump, S 77° E, 7.3'(1968)

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____


1/1988, R.L. Kovanen, LS 16459
Certificate of Location and Certificate of Survey, #302653
added new witnesses as follows.
8" Red Pine, S 62° E, 49.89' 20d spike
8" Red Oak, S 10° W, 59.26' 20d spike

7/2018, CCHD/SO
#2017.018
Found 2" GLO iron pipe with brass cap, up 0.5', 10'+/-, N. of
Camp site path, 25'+/-, E. of Mabel Lake and witnessed.
20" Red Pine, N 10° W, 32.2'(1968) dead snag
10" Red Pine, S 62° E, 49.89'(1988) 20d spike
14" Red Oak, S 10° W, 59.26'(1988) 20d spike, up 1.4', W.side
8" Red Oak, N 14° E, 43.74' duplex nail, up 1.0', W. side

Index No. E 17

CASS COUNTY LAND CORNER RECORD

T. 141 R. 27 M. 5TH Coordinates: X _____ Y _____
NE 10 Corner common to sections R, 3, 10, 11
MC # 10

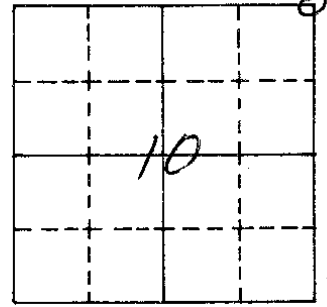

○ = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874

Original monument POST

LINE NORTH RUNS ALONG E. EDGE OF LAKE

Bearing Trees

Species	<u>N. PINE</u>	<u>N. PINE</u>	_____	_____
Diameter	<u>10"</u>	<u>8"</u>	_____	_____
Bearing	<u>S28W</u>	<u>N35E</u>	_____	_____
Distance	<u>59 LKS</u>	<u>50 LKS</u>	_____	_____

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1919 By GLO

Location filed SECRETARY OF STATE

Monument Find old Govt B.T. Stump: 10" Pine S28W
59 LKS SET 2x36" I.P. w/BRASS CAP T141N R27W
53 | 52
510 | 511

Evidence of Subsequent Corner Restoration

Year of search 1988 By Robert Kovanen

Corner Certificate - Doc # 302626

Find 2" I.P. w/ GLO brass cap

Bearing Trees, Reference Objects 1919

Species	<u>J. PINE</u>	<u>J. PINE</u>	<u>J. PINE</u>	<u>J. PINE</u>
Diameter	<u>6"</u>	<u>8"</u>	<u>10"</u>	<u>10"</u>
Bearing	<u>N19-45E</u>	<u>S31-45E</u>	<u>S63-45W</u>	<u>N20-15W</u>
Distance	<u>67 LKS</u>	<u>39 LKS</u>	<u>18 LKS</u>	<u>13 LKS</u>

Bearing Trees, Reference Objects

<u>Red pine</u>	<u>J. Pine Stump</u>	<u>Red pine</u>	<u>Red oak</u>
<u>20"</u>		<u>8"</u>	<u>8"</u>
<u>N10W</u>	<u>S77E</u>	<u>S62E</u>	<u>S10W</u>
<u>32.20'</u>	<u>7'</u>	<u>49.89'</u>	<u>59.26'</u>

Subsequent Corner Restoration

Year surveyed _____ By _____

Location filed _____

Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

CERTIFICATE - BILL OKERMAN - 1968

Certificate - Robert Kovanen - 1988

Remonumentation certificate prepared _____ By _____

Filed at _____ Date _____