


T. 144 R. 26 M. 5th Coordinates: X _____ Y _____

NE 13 Corner common to sections 12,13 and 7,18/144/25

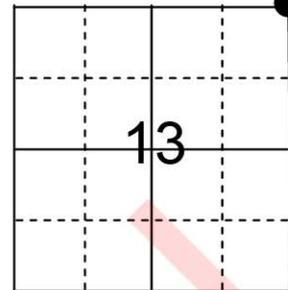

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search 1900 by COE
Monument found Stake

Pokegama Reservoir Map

● = Corner

Bearing Trees

Species	N. Pine	Cedar	Birch	Cedar
Diameter	15"	8"	5"	5"
Bearing	N 30° W	S 74° E	S 3° W	N 41° E
Distance	15 links	11 links	12 links	15 links

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 3/1900 By F.V. Abbot, COE
Location filed: Pokegama Reservoir Map
Monument: Found Stake
One GLO tree standing all others are stumps with scribing.

Evidence of Subsequent Corner Restoration

Year of search 2/1912 By H.S. Todd
Location filed: Survey Record #211, Book A, page 517 and Curo
Monument: Set temp hub
Curo Book 98, page 82. Recovered some BT's not in original notes. The Curo Book entry is omitted from the Survey Record.

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1/1914 By J.W. Curo, LS 1428
Location filed: Survey Record #322, Book B, page 414
Monument: New corner
Dated Jan. 5, 1914, marked wrong.

Evidence of Subsequent Corner Restoration Found

Year of search 1/1985 By J.H. Parker, LS 9235
Location filed: Certificate of Location
Monument: Set 5/8"x 36" aluminum rod monument with cap
2' north of centerline to west at bolt location and witnessed.
10" Cedar, N 50° E, 108.60'
6" J. Pine, S 57° E, 80.69'
7" Balsam, S 59° W, 130.77'

7/1919, J.H. Flynn
Survey Record #415, Book C, page 178
Set 2.5"x 30" I.M. in center of road on range line and witness
7" Balm of Gilead, N 35° W, 39.5'
12" Elm, S 36°30' E, 75.0'
10" Elm, S 63°15' W, 67.0'

7/2011, CCHD/SO
#2011.015
Excavated a 1.5' x 1.5' hole, down 1.5' to change in soil, at
1985 location, no evidence of aluminum rod monument. Set
P.K. from remaining 1985 witnesses, on center line Co. Rd. #3
and 3'+, - north of center line Co. Rd. #139 and add the
following:
10" N. Pine, N 71° W, 157.07'
P. Pole, S 60° W, 68.65'

3/1935, N.F. Shaw, CCC
USFS Form 874- 9
Found a witness tree, add a FSLP as follows:
16" Elm, SE, 50 links

12/1983, J.R. Worcester, CCHD
S.P. 11-603-05
Corner assumed at Station 20+81.8

8/2011, CCHD/SO
#2011.015
Set Mag nail from witnesses after construction, 0.5' east of new
center line CSAH #3.

5/1984, J.H. Parker, LS 9235
Certificate of Location
Excavate 8'x 10' hole, down 4' at centerline intersection and
found 1/2" x 8" bolt down 3.8' as best evidence of corner.

7/2019, CCHD/SO
#2011.015
Found Conc. nail, 0.5', E. of centerline. 1984 and 2011 good.



T. 144 R. 26 M. 5th Coordinates: X _____ Y _____

NE 13 Corner common to sections 12, 13 and 7, 18/144/25

Subsequent Corner Restoration


Evidence of Subsequent Corner Restoration Found

Year surveyed _____ By _____
Location filed:
Monument:

Year of search _____ By _____
Location filed:
Monument:

Index No. J 25

CASS COUNTY LAND CORNER RECORD

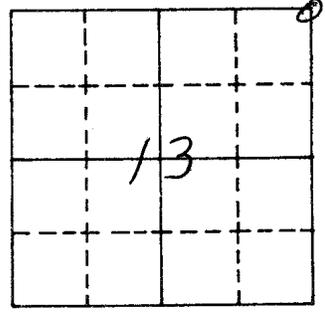

T. 144 R. 26 M. 5TH Coordinates: X _____ Y _____
NE 13 Corner common to sections 12, 13 and 7, 18-144-25

EXISTING SURVEYS

Original Government Survey
 Year surveyed 1873
 Original monument Post

Original Evidence Found
 Year of search _____ By _____
 Monument found _____

	Bearing Trees			
Species	<u>N. Pine</u>	<u>Cedar</u>	<u>Birch</u>	<u>Cedar</u>
Diameter	<u>15"</u>	<u>8"</u>	<u>5"</u>	<u>5"</u>
Bearing	<u>N30W</u>	<u>S74E</u>	<u>S3W</u>	<u>N41E</u>
Distance	<u>15 LKS</u>	<u>11 LKS</u>	<u>12 LKS</u>	<u>15 LKS</u>

Original Bearing Trees Found			
Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration
 Year surveyed 1919 By JAMES FLYNN
 Location filed COUNTY BOOK "C" P. 178
 Monument SET 2 1/2 X 30" IRON MONUMENT PROPORTIONALLY

Evidence of Subsequent Corner Restoration
 Year of search _____ By _____

Bearing Trees, Reference Objects			
Species	<u>BALM OF GILEAD</u>	<u>ELM</u>	<u>ELM</u>
Diameter	<u>7"</u>	<u>12"</u>	<u>10"</u>
Bearing	<u>N35W</u>	<u>S36-30E</u>	<u>S63-15W</u>
Distance	<u>39.5'</u>	<u>75.0'</u>	<u>67.0'</u>

Bearing Trees, Reference Objects		
Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration
 Year surveyed _____ By _____
 Location filed _____
 Monument _____

Evidence of Subsequent Corner Restoration Found
 Year of search _____ By _____
Certificate - Jim Parker - 1985
Find 1/2" x 8" bolt - set 5/8 x 36" aluminum rod
w/ cap
10" Cedar N50°E 108.60'
6" J. Pine S57°E 80.69'
7" Balsam S59°W 130.17'
2' N. of G Rd west
Doc. #281679

Remonumentation certificate prepared _____ By _____
 Filed at _____ Date _____