


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____

CW 1/16 Corner common to sections 1

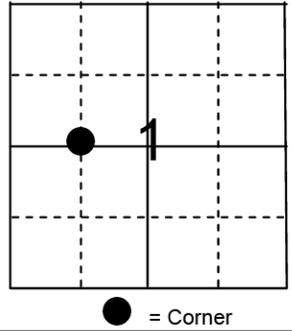

EXISTING SURVEYS

Original Government Survey

Year surveyed 5/1930, H.D. Craig, US Surveyor W1/16
 Original monument Set 1"x 36" iron pipe w/brass cap c S1 c
 1930

Original Evidence Found

Year of search 1936 by Folsom
 Monument found GLO iron
 Form 874-9

Bearing Trees

Species	<u>Ash</u>	<u>Cedar</u>	_____
Diameter	<u>6"</u>	<u>10"</u>	_____
Bearing	<u>N 5° E</u>	<u>S 18 1/2° E</u>	_____
Distance	<u>12 links</u>	<u>20 links</u>	_____

Original Bearing Trees Found

Species	<u>Cedar</u>	<u>Ash</u>	_____
Diameter	<u>11"</u>	<u>10"</u>	_____
Bearing	<u>S 21°30' E</u>	<u>N 6°30' E</u>	_____
Distance	<u>20.6 links</u>	<u>12.8 links</u>	_____

Subsequent Corner Restoration

Year surveyed 12/1936 By L. Folsom, CCC
 Location filed: Form 874-9
 Monument: Found metal pipe, capped and witnesses as follow.

Evidence of Subsequent Corner Restoration

Year of search 3/1968 By MS and LM
 Location filed: USFS Book 2, page 66
 Monument: Found corner placed BT tags on GLO witnesses and FSLP on Ash.

Bearing Trees, Reference Objects

Species	<u>Cedar</u>	<u>Ash</u>	_____
Diameter	<u>11"(1930)</u>	<u>10"</u>	_____
Bearing	<u>S 21°30' E</u>	<u>N 6°30' E</u>	_____
Distance	<u>20.6 links</u>	<u>12.8 links</u>	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 9/1983 By M.C. Hayes, LS 20774
 Location filed: USFS Book 2, page 66
 Monument: Found iron with brass cap up 1', in good condition, 45'+/-, S. of N. edge of Ash swamp and witnesses as follows.
11" Twin Ash, N 5° E, 7.9'(1930) cut off 3' above ground
10" Cedar, S 14° E, 13'(1930) tipped up
11" White Oak, N 27° E, 85.02' 50d nail, scribed
6" Ash, N 22° W, 67.97' 50d nail, scribed
7" White Oak, N 9° W, 86.70' 50d nail, scribed
7" Ash, S 30° E, 35.29' 50d nail, scribed
6" Ash, S 21° W, 14.70' 50d nail, scribed
Steel Sign Post, North, 4.2' 54-2 and 54-9 signs
Steel Sign Post, West, 4.45' 54-2 and 54-9 signs


Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
 Location filed: _____
 Monument: _____

Index No. C 22

CASS COUNTY LAND CORNER RECORD

T. 144 R. 30 M. 57H Coordinates: X _____ Y _____
C.W. 116 Corner common to sections 1

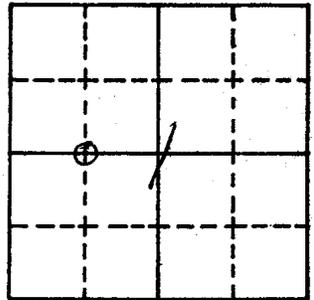

○ = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1930
Original monument 1x36" 1/2" w/ brass cap C.W. 116
51
1930

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees

Species Ash Cedar _____
Diameter 6" 10" _____
Bearing N5E S18 1/2 E _____
Distance 12 LKS 20 LKS _____

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration

Year of search _____ By _____

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Bearing Trees, Reference Objects

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____