


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____

NE 13 Corner common to sections 12, 13 and 8, 18-144-29

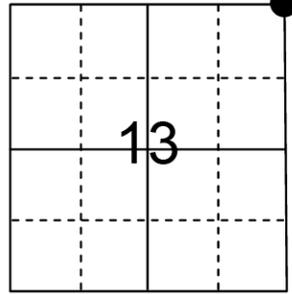

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search 1907 by Curo
Monument found _____
Survey Rec #122, Bk A, pg. 245

Bearing Trees

Species	<u>Black Ash</u>	<u>Cedar</u>	<u>Black Ash</u>	<u>Cedar</u>
Diameter	<u>12"</u>	<u>4"</u>	<u>13"</u>	<u>5"</u>
Bearing	<u>N 61° E</u>	<u>N 3° W</u>	<u>S 55° W</u>	<u>S 45° E</u>
Distance	<u>12 links</u>	<u>11 links</u>	<u>6 links</u>	<u>20 links</u>

Original Bearing Trees Found

Species	<u>Black Ash</u>	<u>Cedar</u>	<u>Black Ash</u>	<u>Cedar</u>
Diameter	<u>12"</u>	<u>4"</u>	<u>13"</u>	<u>5"</u>
Bearing	<u>N 61° E</u>	<u>N 3° W</u>	<u>S 55° W</u>	<u>S 45° E</u>
Distance	<u>12 links</u>	<u>11 links</u>	<u>6 links</u>	<u>20 links</u>

Subsequent Corner Restoration

Year surveyed 1/1907 By J.W. Curo, LS 1428, Co. Survey
Location filed: Survey Record #122, Book A, page 245
Monument: Set wood stake from remains of GLO witness trees.

Evidence of Subsequent Corner Restoration

Year of search 6/1930 By H.D. Craig, US Surveyor
Location filed: Resurvey Notes, MN Historical Soc. T144N
Monument: Set 2"x36" iron pipe with brass cap up 6", from remains of GLO witnesses and marked new witnesses as follows. R30W R29W S12 | S7 S13 | S18 1930

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	<u>Cedar</u>	<u>Cedar</u>	<u>Cedar</u>	<u>Cedar</u>
Diameter	<u>12"</u>	<u>12"</u>	<u>10"</u>	<u>9"</u>
Bearing	<u>N 64° E</u>	<u>S 72 1/2° E</u>	<u>S 60° W</u>	<u>N 76° W</u>
Distance	<u>19 links</u>	<u>39 links</u>	<u>31 links</u>	<u>21 links</u>

Subsequent Corner Restoration

Year surveyed 11/1930 By E.H. Juntunen, CCC
Location filed: Form 874-9
Monument: Metal stake with brass cap up 10" in good condition, notes witnesses as follows.
11" Cedar, E 59° N, 18 links(11.88')
9" Cedar, E 10° S, 39 links(25.74')
6" Cedar, W 8° N, 20 links(13.20')
7" Cedar, W 49° W, 30 links(19.80')
12 Ash, W 62° S, 12 links(7.92') Metal Location Poster

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

12/1965, J. Ekstrom, USFS
USFS T144NR29W, Book 1, page 80
Found GLO iron pipe with brass cap and witnesses as follows.
14" Cedar, S 72° E, 25.74'(1930)
10" Cedar, N 76° W 13.86' (1930)
10" Cedar, N 7° E, 8.0'
7" Cedar, S 64° W, 9.1'
Steel Sign Post, East, 5.8' 54-2 and 54-4 signs

12/1999, R. Main, USFS
USFS T144NR29W, Book 3, page 72
Found GLO monument, witnesses are down or standing dead.
Corner is 320'+/-, W. of old trail.
14" Birch, East, 320' FSLP

