


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____
NE 21 Corner common to sections 15, 16, 21, 22

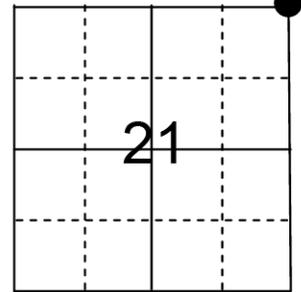

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1875</u>		Year of search <u>1930</u> by <u>Craig</u>	
Original monument <u>Post</u>		Monument found _____	
		Minn. Hist. Society, notes pg 102	

Bearing Trees				
Species	<u>Norway Pine</u>	<u>Norway Pine</u>	<u>Norway Pine</u>	<u>White Birch</u>
Diameter	<u>10"</u>	<u>12"</u>	<u>12"</u>	<u>3"</u>
Bearing	<u>N 82° E</u>	<u>S 42° E</u>	<u>S 34° W</u>	<u>N 22° W</u>
Distance	<u>48 links</u>	<u>33 links</u>	<u>65 links</u>	<u>26 links</u>

Original Bearing Trees Found				
Species	<u>Norway Pine</u>	<u>Norway Pine</u>	<u>Pine stump</u>	<u>Stump</u>
Diameter	<u>24"</u>	<u>33"</u>	<u>24"</u>	<u>Hole</u>
Bearing	<u>N 80° E</u>	<u>S 42° E</u>	<u>S 36 1/2° W</u>	<u>N 19 1/4° W</u>
Distance	<u>48 links</u>	<u>33 links</u>	<u>65 links</u>	<u>29 links</u>

Subsequent Corner Restoration	
Year surveyed <u>7/1930</u> By <u>H.D. Craig, US Surveyor</u>	
Location filed: <u>Minn. Hist. Society, notes pg 102 T144N R30W</u>	
Monument: <u>Set 2"x 36" iron pipe with brass cap up 6", from original witnesses and marked witness trees as follows.</u>	<u>S16 S15</u> <u>S21 S22</u> <u>1930</u>

Evidence of Subsequent Corner Restoration	
Year of search <u>11/1966</u> By <u>J. Ekstrom, USFS</u>	
Location filed: <u>USFS Book 1, page 10</u>	
Monument: <u>Found brass cap iron pipe and notes witnesses as follow.</u>	

Bearing Trees, Reference Objects				
Species	<u>Norway Pine</u>	<u>Norway Pine</u>	<u>Norway Pine</u>	<u>Norway Pine</u>
Diameter	<u>24"(GLO)</u>	<u>33"(GLO)</u>	<u>12"</u>	<u>18"</u>
Bearing	<u>N 80° E</u>	<u>S 42° E</u>	<u>S 28 1/4° W</u>	<u>N 62 1/2° W</u>
Distance	<u>48 links</u>	<u>33 links</u>	<u>202 links</u>	<u>255 links</u>

Bearing Trees, Reference Objects				
Species	<u>Norway Pine</u>	<u>Norway Pine</u>	<u>Steel Sign</u>	
Diameter	<u>17"(1930)</u>	<u>21"(1930)</u>	<u>Post</u>	
Bearing	<u>S 28° W</u>	<u>N 62° W</u>	<u>West</u>	
Distance	<u>133.32'</u>	<u>168.30'</u>	<u>6.6'</u>	


Subsequent Corner Restoration	
Year surveyed <u>4/1987</u> By <u>G. Brama, USFS</u>	
Location filed: <u>USFS Book 1, page 10</u>	
Monument: <u>Found GLO brass capped pipe and witnesses as follows.</u>	
<u>24" Norway Pine, N 80° E, 31.7'(1875) scribe visible</u>	
<u>33" Norway Pine, S 42° E, 21.8'(1875) scribe visible</u>	
<u>24" Pine stump, S 36 1/2° W, 42.9'(1875) scribed BT at base</u>	
<u>20" Norway Pine stump, S 28° W, 133'(1930)</u>	
<u>4" White Oak, N 77° W, 32.25' scribed "X"</u>	
<u>5" White Oak, S 63° E, 18.0' scribed</u>	

Evidence of Subsequent Corner Restoration Found	
Year of search _____ By _____	
Location filed: _____	
Monument: _____	

Index No. N13

CASS COUNTY LAND CORNER RECORD

T. 144 R. 30 M. 5TH Coordinates: X _____ Y _____
NE 21 Corner common to sections 15, 16, 21, 22

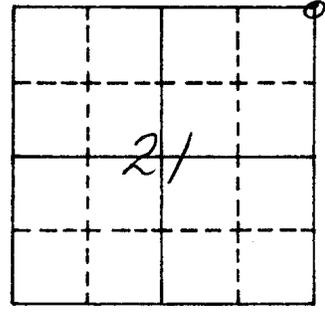

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Species	Bearing	Tree	
<u>N. Pine</u>	<u>N. Pine</u>	<u>N. Pine</u>	<u>W. Birch</u>
<u>10"</u>	<u>12"</u>	<u>12"</u>	<u>3"</u>
<u>N82E</u>	<u>S42E</u>	<u>S34W</u>	<u>N72W</u>
<u>48LKS</u>	<u>33LKS</u>	<u>65LKS</u>	<u>26LKS</u>

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1930 By GLO
Location filed Sec. of State
Monument Find NE & SE BITS and Stumps of NW & SW
BITS Set 2x36" l.p. w/brass cap T144N R30W
NE BIT. Now 24", SE BIT. Now 33" S16 S15
S21 S22

Species	Bearing	Tree	Reference Objects
<u>N. Pine</u>	<u>N. Pine</u>		<u>1930</u>
<u>12"</u>	<u>18"</u>		
<u>S20 1/4 W</u>	<u>N62 1/2 W</u>		
<u>202LKS</u>	<u>255LKS</u>		

Evidence of Subsequent Corner Restoration

Year of search 1966 By William Okerman
Found GLO monument and BT's in good condition.

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CERTIFICATE Bill Okerman - 1966

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____