

T. 144 R. 30 M. 5th Coordinates: X _____ Y _____

NE 22 Corner common to sections 14, 15, 22, 23



EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1930 by Craig
Monument found 4" stake
MN Historical Soc. notes pg 71

Bearing Trees

Species	<u>White Pine</u>	<u>White Pine</u>	<u>Maple</u>	<u>Cedar</u>
Diameter	<u>48"</u>	<u>40"</u>	<u>8"</u>	<u>16"</u>
Bearing	<u>N 39° W</u>	<u>N 78° E</u>	<u>S 26° E</u>	<u>S 37° W</u>
Distance	<u>36 links</u>	<u>30 links</u>	<u>15 links</u>	<u>28 links</u>

Original Bearing Trees Found

Species	<u>Pine stump</u>	<u>Maple rotted</u>	<u>Cedar stump</u>	<u>Pine stump</u>
Diameter	<u>40"</u>	<u>fallen</u>	<u>25"</u>	<u>56"</u>
Bearing	<u>N 65° E</u>	<u>S 26° E</u>	<u>S 37° W</u>	<u>N 39° W</u>
Distance	<u>30 links</u>	<u>15 links</u>	<u>28 links</u>	<u>36 links</u>

Subsequent Corner Restoration

Year surveyed 1900 By H. Dunaway, COE
Location filed: Leech Lake Reservoir Map
Monument:
Map indicates a known corner.

Evidence of Subsequent Corner Restoration

Year of search 6/1930 By H.D. Craig, US Surveyor
Location filed: MN Historical Soc. notes pg 71 T144N R30W
Monument: Set 2"x 36" iron pipe with brass cap S15 | S14
up 6", from original witnesses and marked S22 | S23
new witnesses as follows. Reset original stake 1930
alongside or iron pipe.

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	<u>Spruce</u>	<u>Spruce</u>	<u>Poplar</u>	<u>Balsam</u>
Diameter	<u>5"</u>	<u>5"</u>	<u>10"</u>	<u>9"</u>
Bearing	<u>N 20 1/2° E</u>	<u>S 30 1/2° E</u>	<u>S 74 1/4° W</u>	<u>N 69 1/2° W</u>
Distance	<u>18 links</u>	<u>32 links</u>	<u>44 links</u>	<u>52 links</u>

Subsequent Corner Restoration

Year surveyed 11/1934 By P. Zeleagraff, Estimator CCC
Location filed: Form 874-9
Monument: Found brass capped I. pipe
up 5" in good condition and notes witnesses as follows.
4" White Spruce, N 15° E, 12' (1930)
9" Balsam, N 78° W, 33' (1930)
10" Aspen, S 65° W, 30' (1930)
5" White Spruce, S 30° E, 21' (1930)


Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

12/1975, C.R. Krause, USFS
USFS Book 1, page 45
Found GLO brass cap, up 6", in good condition and witnesses.
8" White Spruce, N 20° E, 11.9'(1930) windfall
10" White Spruce, S 31° E, 21.1'(1930) scribe overgrown
Aspen stub, S 74° W, 29.0'(1930) scribe overgrown
Balsam, N 69° W, 34.3'(1930) rotted windfall
12" Balsam, S 60° E, 4.0' FSLP

Index No. N17

CASS COUNTY LAND CORNER RECORD

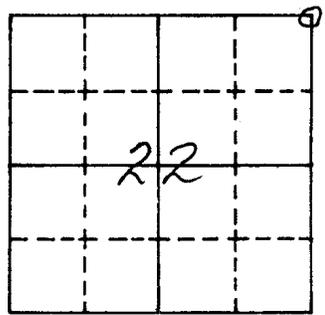

T. 144 R. 30 M. 5th Coordinates: X _____ Y _____
NE 22 Corner common to sections 14, 15, 22, 23

EXISTING SURVEYS

Original Government Survey
 Year surveyed 1875
 Original monument Post

Species	Bearing	Tree	Distance
<u>White Pine</u>	<u>48"</u>	<u>White Pine</u>	<u>36 LKS</u>
<u>Maple</u>	<u>8"</u>	<u>Maple</u>	<u>15 LKS</u>
<u>Cedar</u>	<u>16"</u>	<u>Cedar</u>	<u>28 LKS</u>

Original Evidence Found
 Year of search _____ By _____
 Monument found _____

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration
 Year surveyed 1930 By GLO
 Location filed Sec. of State
 Monument End stake & stumps of all 4 B.T.S. - Set 2x36"
11 P. will brass cap 7144N R30W
515/514
522/523

Bearing Trees, Reference Objects 1930

Species	Bearing	Distance
<u>Spruce</u>	<u>5"</u>	<u>18 LKS</u>
<u>Spruce</u>	<u>5"</u>	<u>32 LKS</u>
<u>Poplar</u>	<u>10"</u>	<u>44 LKS</u>
<u>Balsam</u>	<u>9"</u>	<u>52 LKS</u>

Evidence of Subsequent Corner Restoration
 Year of search _____ By _____

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration
 Year surveyed _____ By _____
 Location filed _____
 Monument _____

Evidence of Subsequent Corner Restoration Found
 Year of search _____ By _____

Remonumentation certificate prepared _____ By _____
 Filed at _____ Date _____