


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____

E 1/4 22 Corner common to sections 22, 23

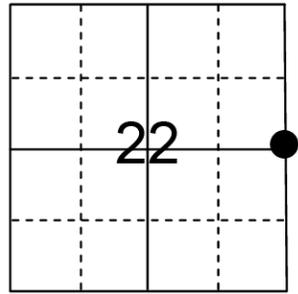

22

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1930 by Craig
Monument found 2"x 4" stake
MN Historical Soc. notes pg 70

Bearing Trees

Species	<u>Cedar</u>	<u>Cedar</u>
Diameter	<u>4"</u>	<u>6"</u>
Bearing	<u>N 40° W</u>	<u>N 38° E</u>
Distance	<u>10 links</u>	<u>27 links</u>

Original Bearing Trees Found

Species	<u>Cedar</u>	<u>Cedar</u>
Diameter	<u>8"(Dead)</u>	<u>5"(fallen)</u>
Bearing	<u>N 48 1/4° E</u>	<u>N 40° W</u>
Distance	<u>27 links</u>	<u>10 links</u>

Subsequent Corner Restoration

Year surveyed 1900 By H. Dunaway, COE
Location filed: Leech Lake Reservoir Map
Monument:
Map indicates a known corner.

Evidence of Subsequent Corner Restoration

Year of search 6/1930 By H.D. Craig, US Surveyor
Location filed: MN Historical Soc. notes pg 70-71 1/4
Monument: Set 1"x 36" iron pipe with brass cap up 9", in place of original stake and notes new witnesses as follows. Reset original stake alongside of iron pipe. S22 | S23
1930

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Bearing Trees, Reference Objects

Species	<u>Cedar</u>	<u>Birch</u>
Diameter	<u>7"</u>	<u>4"</u>
Bearing	<u>N 65° E</u>	<u>S 25° W</u>
Distance	<u>50 links</u>	<u>45 links</u>

Subsequent Corner Restoration

Year surveyed 4/1977 By C.R. Krause, USFS
Location filed: USFS Book 1, page 72
Monument: Found iron pipe with brass cap up 12", in good condition at W. edge of cedar swamp, witnesses as follows.
8" Cedar snag, N 48° E, 17.8'(GLO) dead
10" Cedar, N 65° E, 33.0'(1930) scribe visible
6" Birch, S 25° W, 29.7'(1930) scribed on outside
4" Cedar, N 28° E, 3.0' FSLP

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

