


T. 144 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 30 Corner common to sections 19, 20, 29, 30

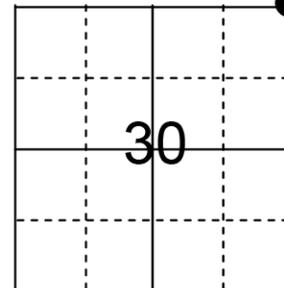

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875  
Original monument Post

Original Evidence Found

Year of search 1930 by Craig  
Monument found \_\_\_\_\_  
Minn. Hist. Society, notes pg 134

Bearing Trees

Species	Balsam	White Pine	Balsam	Lynn
Diameter	10"	10"	10"	10"
Bearing	N 33° E	S 62° E	N 32° W	S 79° W
Distance	19 links	21 links	45 links	22 links

Original Bearing Trees Found

Species	Badly rotted	White Pine	Basswood	Balsam stp
Diameter	stump	fallen	rotted	rotted
Bearing	N 33° E	S 62° E	S 79° W	N 32° W
Distance	19 links	21 links	22 links	45 links

Subsequent Corner Restoration

Year surveyed Circ 1915 By Unknown  
Location filed: Minn. Hist. Society, notes pg 134  
Monument:  
at proportionate position and marked new

Evidence of Subsequent Corner Restoration

Year of search 7/1930 By H.D. Craig, US Surveyor  
Location filed: Minn. Hist. Society, notes pg 134 T144N R30W  
Monument: Set 2"x36" iron pipe with brass cap S19|S20  
up 6", from remains of original witnesses and S30|S29  
marked new witnesses trees as follows. 1930

Bearing Trees, Reference Objects

Species	Birch	Maple		
Diameter	18"	5"		
Bearing	S 16° E	N 30° W		
Distance	37 links	79 links		

Bearing Trees, Reference Objects

Species	Ash	Ash	White Oak	Ash
Diameter	4"	12"	12"	6"
Bearing	N 35° E	S 64 3/4° E	N 83 1/4° W	N 15 1/4° W
Distance	32 links	58 links	62 links	39 links

Subsequent Corner Restoration

Year surveyed 8/1934 By D.B. Rosk, Compassman, CCC  
Location filed: Form 874-9  
Monument: Found brass cap  
and witnesses as follows.  
14" White Birch, S 16°15' E, 36 1/2 links(24.09')(1915)  
6" Black Ash, N 16°30' W, 38 1/2 links(25.41')(1930)  
4" Elm, N 45°15' E, 31 1/2 links(20.79')(1930)  
12" White Oak, N 83 1/4° W, 61 1/4 links(40.43')(1930)  
12" Black Ash, S 65 1/2° E, 57 3/4 links(38.12')(1930)

Evidence of Subsequent Corner Restoration Found


Year of search \_\_\_\_\_ By \_\_\_\_\_  
Location filed:  
Monument:

3/1975, C.R. Krause, USFS  
USFS Book 1, page 26  
Found GLO brass capped iron pipe up 10" in good condition,  
at toe of slope on S. edge of ash swale and witnesses.  
Birch stump, S 16° E, 24.4'(1915) well rotted  
6" Ash, N 35° E, 21.1'(1930) growing from old stump  
Ash stump, S 65° E, 38.3'(1930) rotted stump and log  
18" White Oak stump, N 83° W, 40.9'(1930) scribe BT  
11" Ash, N 15° W, 25.7'(1930) scribe overgrown  
17" Basswood, S 44° W, 76.6' scribed  
15" Basswood, S 46° E, 85.2' scribed  
10" Ash, N 60° E, 15.8' scribed  
10" Ash, N 23° W, 52.3' scribed  
Steel Sign Post, North, 2.6' 54-4 sign  
6" Ash, East, 11.5' FSLP  
8" Birch, S 4° E, 42.5' FSLP

Index No. R5

CASS COUNTY LAND CORNER RECORD

T. 144 R. 30 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 30 Corner common to sections 19, 20, 29, 30

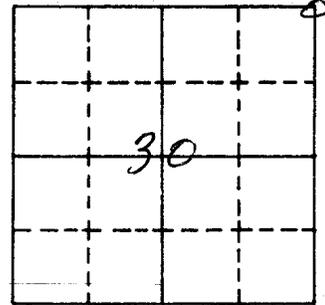

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875  
Original monument lost

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

Species	Bearing	Tree	Distance
<u>Balsam</u>	<u>W 1/4</u>	<u>Balsam</u>	<u>Lynn</u>
<u>10"</u>	<u>10"</u>	<u>10"</u>	<u>10"</u>
<u>N 33 E</u>	<u>S 62 E</u>	<u>N 32 W</u>	<u>S 79 W</u>
<u>19 LKS</u>	<u>21 LKS</u>	<u>45 LKS</u>	<u>22 LKS</u>

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1930 By GLO  
Location filed Sec. of State  
Monument Find remains of all 4 B.T.S. - Set 2x36"  
1/4" w/ brass cap. Find 2 local B.T.S. T1/4 N R20 W  
Marked about 1915; 20' Dead Birch S1/4 E S19 | S20  
37 LKS, 6" Maple N30 W 79 LKS S30 | S29

Evidence of Subsequent Corner Restoration

Year of search \_\_\_\_\_ By \_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

Bearing Trees, Reference Objects <sup>1930</sup>

Species	Bearing	Tree	Distance
<u>Ash</u>	<u>Ash</u>	<u>w. oak</u>	<u>Ash</u>
<u>4"</u>	<u>12"</u>	<u>12"</u>	<u>6"</u>
<u>N 35 E</u>	<u>S 67 3/4 E</u>	<u>N 83 1/4 W</u>	<u>N 15 1/4 W</u>
<u>32 LKS</u>	<u>58 LKS</u>	<u>62 LKS</u>	<u>39 LKS</u>

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed \_\_\_\_\_ By \_\_\_\_\_  
Location filed \_\_\_\_\_  
Monument \_\_\_\_\_

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
CERTIFICATION - MILO STEFAN - 1975 - FILED IN 1980  
Doc. # 258588  
Found GLO monument in good condition  
17" Basswood S44 W 76.60';  
15" Basswood S46 E 85.30';  
10" Ash N60 E 15.80';  
10" Ash N23 W 52.30'

Remonumentation certificate prepared \_\_\_\_\_

By \_\_\_\_\_

Filed at \_\_\_\_\_

Date \_\_\_\_\_