


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____

MC #11 Corner common to sections 25 and 30-144-29

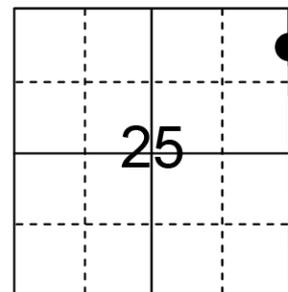

25

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search 1907 by Curo
Monument found _____
Survey Rec. #125, Bk A, pg 250

Bearing Trees

Species	<u>White Birch</u>	<u>Spruce</u>
Diameter	<u>5"</u>	<u>5"</u>
Bearing	<u>N 19° W</u>	<u>N 42° E</u>
Distance	<u>20 links</u>	<u>12 links</u>

Original Bearing Trees Found

Species	<u>White Birch</u>
Diameter	<u>5"</u>
Bearing	<u>N 19° W</u>
Distance	<u>30 links</u>

Subsequent Corner Restoration

Year surveyed 1/1907 By J.W. Curo, LS 1428, Co. Survey
Location filed: Survey Record #125, Book A, page 250
Monument: Set stake from GLO witness and mark new witness as follow.

Evidence of Subsequent Corner Restoration

Year of search 6/1926 By E.G. Harrington, US Cad. Eng.
Location filed: MN Historical Society, notes pg. 10 T144N
Monument: Set 1"x36" iron pipe with brass cap at intersection with the shore of Leech Lake, R30W, R29W, S25, S30, MC 1926
0.59 chains(38.94 feet) S. of proportional point for original MC and witnesses as follows.

Bearing Trees, Reference Objects

Species	<u>Cedar</u>	<u>Cedar</u>
Diameter	<u>12"</u>	<u>8"</u>
Bearing	<u>N 35° W</u>	<u>N 25° E</u>
Distance	<u>16'</u>	<u>22'</u>

Bearing Trees, Reference Objects

Species	<u>Maple</u>
Diameter	<u>12"</u>
Bearing	<u>S 42°45' E</u>
Distance	<u>117 links</u>

Subsequent Corner Restoration

Year surveyed 11/1950 By H.J. Curo, LS 3417
Location filed: Curo Book 270, page 80
Monument: Found Brass cap Monument

6/1951, H.J. Curo, LS 3417, Co. Surveyor
Survey Record #648, Book D, page 403 and Curo Book 270, page 103 and 109, Found I.M. and witnessed as follows.
9" Birch, N 87°22' E, 18.00'
10" Birch, S 58°22' W, 11.20'

8/1969, C.R. Krause, USFS
USFS T144R29, Book 1, page 9
Found GLO corner, up 12", 18" above lake shore and 75" W. to lake shore, 120' E. to rd., 155' S 16° W of Cabin and witnesses as follows.
Maple stump, S 43° E, 77.2'(1926) rotted
6" White Oak, S 35° E, 48.0' scribed MC S30 BT
10" Elm, N 70° E, 66.3' scribed MC S30 BT
7" White Birch, N 50° W, 23.1' scribed MC S25 BT
5" White Birch, S 41° E, 4.0' 54-4 sign

6/1973, W.H. Okerman, LS 6807
Certificate of Survey for Gagola, #5133
Indicates a GLO Brass cap.

Evidence of Subsequent Corner Restoration Found

Year of search 8/1981 By M.E. Stefan, LS 12261
Location filed: Certificate of Location, #258596
Monument: Found GLO corner
Filed on the 1969 information.

3/1983, W.H. Okerman, LS 6807
Certificate of Survey for Tiggemann, #1112
Indicates a GLO monument, 134' N. of Leech Lake.

2/1988, W.E. Curo, LS 11395
Certificate of Survey in Gov't Lot 1, #1108
Indicates a USGLO brass cap MC.

5/1989, W.E. Curo, LS 11395
Certificate of Survey in Gov't Lot 1, #1107
Indicates a USGLO brass cap MC.

1/1992, W.E. Curo, LS 11395
Certificate of Survey in Gov't Lot 2, Sec. 30 #5134
Indicates a USGLO brass cap M.C.

2/1994, W.E. Curo, LS 11395
Certificate of Survey in Gov't Lot 1, #5176
Indicates a USGLO brass cap, monument.

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 6/1995 By W.E. Curo, LS 11395
Location filed: Certificate of Survey in Gov't Lot 2, Sec. 30 #1111
Monument: Indicates a USGLO brass cap,
120' N. of Leech Lake.

Year of search _____ By _____
Location filed: _____
Monument: _____

9/1999, P.B. Schoborg, LS 14700
Certificate of Survey for Country-N-Lakes, #1106
Indicates an iron monument.


2/2003, T.L. Freeman, LS 21367
Certificate of Location
Found GLO brass cap monument, up 1' and witnessed.
8" Birch, N 50° W, 23.10'(1969)
9" Oak, S 35° E, 48.00'(1969)
8" Maple, N 6° E, 44.68'

2/2004, T.L. Freeman, LS 21367
Plat of BLACK BEAR ESTATES, Doc. #A000480493
Indicates a monument found at corner.

Index No. R-5 25

CASS COUNTY LAND CORNER RECORD

T. 144 R. 30 M. 5TH Coordinates: X _____ Y _____
MC # 11 Corner common to sections 25 AND 30-144-29

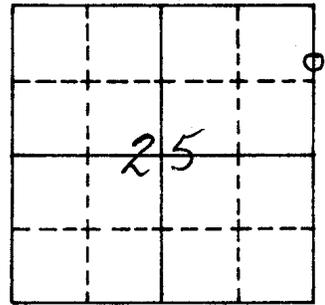

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees

Species	<u>W. BIRCH</u>	<u>SPRUCE</u>	_____	_____
Diameter	<u>5"</u>	<u>5"</u>	_____	_____
Bearing	<u>N19W</u>	<u>N42E</u>	_____	_____
Distance	<u>20KS</u>	<u>12KS</u>	_____	_____

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1907 By JOHN CURO
Location filed COUNTY SURVEY RECORD BOOK 'A' P250-251
Monument FND OLD GOVT. B.T. 5" W. BIRCH N19W 19.8'
1926 - GLO SET 1236" I.P. W/BRASS CAP T 144N
R30W/R29W
S25/S30

Evidence of Subsequent Corner Restoration

Year of search 1952 By HAROLD CURO
COUNTY BOOK 'D' P402-403 FND IRON MONUMENT

Bearing Trees, Reference Objects

Species	<u>CEDAR</u>	<u>CEDAR</u>	<u>Maple</u>	<u>MC</u>
Diameter	<u>12"</u>	<u>8"</u>	<u>12"</u>	<u>1926</u>
Bearing	<u>N35W</u>	<u>N75E</u>	<u>S42-45E</u>	_____
Distance	<u>16LKS</u>	<u>22'</u>	<u>117LKS</u>	_____
			<u>GLO TIE</u>	_____

Bearing Trees, Reference Objects

Species	<u>BIRCH</u>	<u>BIRCH</u>	_____	_____
Diameter	<u>9"</u>	<u>10"</u>	_____	_____
Bearing	<u>N07-22E</u>	<u>S58-22W</u>	_____	_____
Distance	<u>18.00'</u>	<u>11.20'</u>	_____	_____

R,5-25

Subsequent Corner Restoration

Year surveyed 2-27-03 By J. Freeman # 21367
Location filed CCRO # A000 483075
Monument G.L.O. BRASS CAP MONUMENT 1'
above ground.

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CERTIFICATE - BILL OKERMAN - 1969
CERTIFICATE - MILO STEFAN - 1969 - FILED IN 1980
(Same one as above)

Bearing Trees:

<u>BIRCH</u>	<u>OAK</u>	<u>MAPLE</u>	_____	_____
<u>8"</u>	<u>9"</u>	<u>8"</u>	_____	_____
<u>N150°W</u>	<u>S35°E</u>	<u>N6°E</u>	_____	_____
<u>23.10'</u>	<u>48.00'</u>	<u>44.68'</u>	_____	_____

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____