


T. 144 R. 31 M. 5th Coordinates: X _____ Y _____
NE Corner common to sections 4,5,8,9

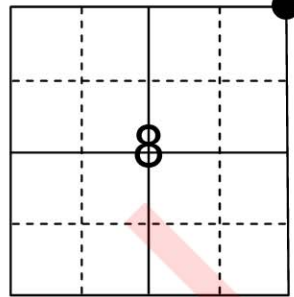

EXISTING SURVEYS

Original Government Survey
 Year surveyed 1875
 Original monument Post

Original Evidence Found
 Year of search 1910 by J Middleton
 Monument found Found Spruce Post
 set from old Gov't B.Ts.

Bearing Trees				
Species	Oak	W. Pine	W. Birch	W. Pine
Diameter	4"	7"	6"	6"
Bearing	S 11° E	S 17° W	N 32° W	N 52° E
Distance	122 links	226 links	187 links	17 links

Original Bearing Trees Found			
Species	Oak(down)	W. Pine(stump)	W. Birch(stump)
Diameter	4"	7"	6"
Bearing	S 11° E	S 17° W	N 32° W
Distance	122 links	226 links	187 links

Subsequent Corner Restoration

Year surveyed 1910 By James Middleton
 Location filed: County Book B, pg. 578
 Monument:
 Set 4" Oak Hub. County Road Survey BTs.

Evidence of Subsequent Corner Restoration

Year of search 1930 By GLO
 Location filed: Sec of State
 Monument:
 Set concrete monument 6"x 24" w/brass cap.

Bearing Trees, Reference Objects			
Species	Spruce	Spruce	
Diameter	8"	8"	
Bearing	S 82°30' E	N 45°22' E	
Distance	95.40'	144.28"	

Bearing Trees, Reference Objects			
Species	Poplar	Poplar	
Diameter	4"	4"	
Bearing	S 16 1/2° E	S 67° W	
Distance	62 links	62 1/2 links	

Subsequent Corner Restoration

Year surveyed 1925 By Minn Hwy, Dept.
 Location filed: R/W map Walker to Cass Lake
 Monument:
 Concrete monument w/brass plug 407.5' E. of centerline.
 9/1990, W.E. Curo, LS 11395
 Certificate of Location
 Found bent 1/2" x 18" iron pipe replace with 3/4" x 18" iron pin.
 4'x6'x6' rock, N 5° W, 41.87'
 6" Aspen, N 50° E, 61.90'
 5" Aspen, S 5° E, 52.90'
 4/2001, USFS crew
 Found pin in road and 1990 witnesses.
 4/2002, CCHD/SO
 #2002.009
 Found 5/8" pin in road, 1990 witnesses in good condition, GPS location.
 5/2007, CCHD/SO
 #2002.022
 Excavate 10'x 10' hole, down 2', at pin location, found post point and angle iron, down 0.5, on centerline County Road #145.


Evidence of Subsequent Corner Restoration Found

Year of search 5/2007 By CCHD/SO
 Location filed: #2002.022
 Monument: Found wood post point
 set Aluminum County monument down 0.5', on centerline of County Road #145.
 6'x6'x4' Rock, N,5° W, 42.00'
 8" Aspen, N 50° E, 61.78'
 8" Aspen, S 5° E, 52.98'
 8/2019, T.L. Freeman, LS 21367
 Certificate of Location, A000652200
 Filed on the above information.

Index No. E9

CASS COUNTY LAND CORNER RECORD
(E) (N)

T. 144 R. 31 M. 5TH Coordinates: X 399687.03 Y 284282.71
NE 8 Corner common to sections 4, 5, 8, 9

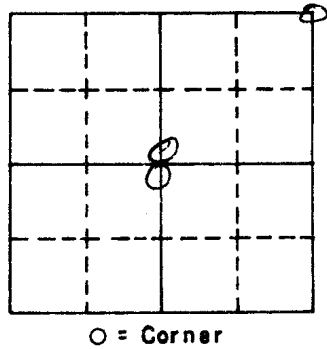

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

	Bearing Trees			
Species	<u>Oak</u>	<u>Willow</u>	<u>Willow</u>	<u>Willow</u>
Diameter	<u>4"</u>	<u>7"</u>	<u>6"</u>	<u>6"</u>
Bearing	<u>S11E</u>	<u>S17W</u>	<u>N32W</u>	<u>N52E</u>
Distance	<u>122 LKS</u>	<u>226 LKS</u>	<u>187 LKS</u>	<u>17 LKS</u>

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1910 By JAMES MIDDLETON
Location filed COUNTY BOOK B' P578
Monument FIND SPRUCE POST SET FROM OLD CORNERS: DOWN
4" OAK S11E 122 LKS, STUMP 7" WILLOW S17W 226 LKS, STUMP
6" BIRCH N32W 187 LKS AND Co. RO. SURVEY B.T.S: 8" SPRUCE
S 82-30 E 95.40', B' SPRUCE N45 27 E 144.28', SET 4" OAK
TRUB

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Evidence of Subsequent Corner Restoration

Year of search 1930 By GLO
Set concrete mon. 24" long 6" dia w/ brass cap
T144N R31W
55/54
58/59
1930

Bearing Trees, Reference Objects

<u>Poplar</u>	<u>Poplar</u>	_____	_____
<u>4"</u>	<u>4"</u>	_____	_____
<u>S16 1/2 E</u>	<u>S67W</u>	_____	_____
<u>62 LKS</u>	<u>62 1/2 LKS</u>	_____	_____

E-9 Subsequent Corner Restoration E 9

Year surveyed 1925 By Miss. Hwy Dept.
Location filed R/W map in Recorder's Office - Walker
Monument Concrete monument w/ brass plug 407.5'
E of G

4/2001 USFS crew found pin
in road and 1990 witnesses.

4/2002 - file #2002,009 CCSO found
5/8" Pin in road, 1990 witnesses
in good condition, GPS location.

Evidence of Subsequent Corner Restoration Found

Year of search 1990 By WALT CURD
Fnd Dent 1/2 x 1/8" IRON ANGLE REPLACED
WITH 3/4 x 1/8 x 1" IRON PIN

TOP POINT ON ROCK	ASPEN	ASPEN
<u>4' H x 6' L x 6' W</u>	<u>6"</u>	<u>9"</u>
<u>N 5W</u>	<u>N50 E</u>	<u>55 E</u>
<u>41.87</u>	<u>61.90</u>	<u>52.90</u>

CERT BY WALT CURD 1990
DOC. # 325738