


T. 144 R. 31 M. 5th Coordinates: X _____ Y _____

NE 24 Corner common to sections 13, 24 and 18, 19-144-30

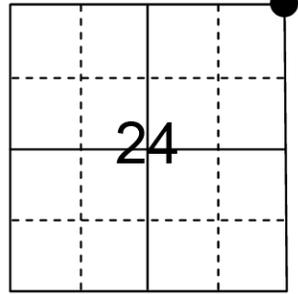

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search _____ by _____
Monument found _____

Bearing Trees

Species	<u>White Pine</u>	<u>White Pine</u>	_____
Diameter	<u>6"</u>	<u>6"</u>	_____
Bearing	<u>S 54° E</u>	<u>N 46° E</u>	_____
Distance	<u>44 links</u>	<u>34 links</u>	_____

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 4/1930 By H.D. Craig, U.S. Surveyor, GLO
Location filed: MN Hist. Soc., 144-30 notes pg 25 T144N
Monument: Set 2"x 3' iron pipe. w/brass cap R31W | R30W
at proportionate distance, up 6", and marked S13 | S18
a new witnessed as follows. States no other S24 | S19
trees available for marking. 1930

Evidence of Subsequent Corner Restoration

Year of search 2/1935 By J.A. Gjelhaug, Engineer, CCC
Location filed: USFS Form 874-9
Monument: Found Brass capped 2" Iron pipe up 8", and notes No B.T.'s.

Bearing Trees, Reference Objects

Species	<u>Norway Pine</u>	_____	_____
Diameter	<u>12"</u>	_____	_____
Bearing	<u>S 88 1/2° E</u>	_____	_____
Distance	<u>279 links</u>	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 2/1984 By C.R. Krause, USFS
Location filed: USFS Field Book 1, page 29
Monument: Found GLO 2" iron pipe with brass cap up 8", line to standard N. and W. of corner and witnesses.
21" Norway Pine, S 88° E, 184.1'(1930) scribe overgrown
5" White Oak, N 1° E, 25.05' 50d spike
7" White Oak, N 78° E, 10.50' 50d spike
5" Ash, S 12° E, 76.30' 50d spike
8" White Oak, S 60° W, 47.25' 50d spike
5" Basswood, N 75° W, 17.25' 50d spike
Steel Sign Post, West, 4.0' both signs
Steel Sign Post, North, 4.4' both signs

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

