


T. 144 R. 31 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 32 Corner common to sections 29, 32

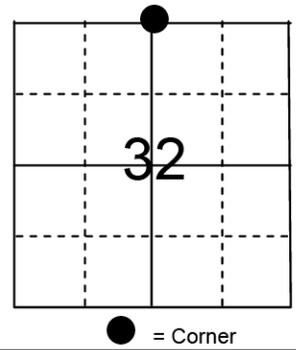

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875  
Original monument Post

Original Evidence Found

Year of search 1905 by Curo  
Monument found Stake  
Survey Rec. #471, Bk C, pg 486

Bearing Trees

Species N. Pine  
Diameter 12"  
Bearing N 32° W  
Distance 622 links

Original Bearing Trees Found

Species N. Pine  
Diameter \_\_\_\_\_  
Bearing N 32° W  
Distance 410.52'

Subsequent Corner Restoration

Year surveyed 1903 By H. Dunaway, COE  
Location filed: Leech Lake Reservoir map, T.143 N., R.31 W.  
Monument: known corner per symbol on map.

Evidence of Subsequent Corner Restoration

Year of search 2/1905 By J.W. Curo, LS 1428  
Location filed: Survey Record #471, Book C, page 486 and Curo  
Monument: Set a new stake Curo Book 42, page 1, find the B.T. from which we run S 32° E, 410.52' where we find the old stake. We a new B.T. as follows.

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Bearing Trees, Reference Objects

Species Aspen  
Diameter 5"  
Bearing S 76° W  
Distance 12.5'

Subsequent Corner Restoration

Year surveyed 8/1914 By J.W. Curo, LS 1428  
Location filed: Survey Record #471, Book C, page 486 and Curo  
Monument: Found the old 1/4 stake Curo Book 87, page 5, corner previously established by me. Stump of old U.S. B.T. is plainly marked set new stake. Pine stump, N 32° W, 410.52'(GLO) 14" Nor. Pine, S 39°33' E, 58.25' 10" Twin Poplar, N 43°24' E, 55.17'

Evidence of Subsequent Corner Restoration Found

Year of search 12/1915 By J.W. Curo, LS 1428, Co Survey  
Location filed: Survey of Section 32, Curo's Contract No. 3  
Monument: 2.25"x 4' I.M. Indicates known corner from old bearing trees. 5/1931, Hal D. Craig, U.S. Surveyor Dependent Resurvey of a Portion T 144 N, R 31 W 1/4 Found Cass Co. galv. iron pipe, 2.5" w/iron cap, S29 4" below road surface and witnessed as follows. S32 14" Pine stump, N 31° W, 622 links(1875)(410.52') 1931 12" J. Pine, S 78° E, 118 links(77.88') 7" J. Pine, N 17 1/2° W, 71 links(46.86')

11/1914, R.E. Bryant, Deputy Co. Surveyor  
Survey Record #471, Bk C, page 487 and Curo Bk 87, pg. 5 ran transit line S. and W. from this corner.

1/1915, N.D. Gorman, Deputy Co Surveyor  
Survey Record #471, Book C, page 487 and 489, Curo Book 87, pages 5, 16, 18, 33, 35 and 38, found old line run S. and W., chain W. to section corner. Run E. and cross R/R at 695'. Find stump of old NW B.T. which checks with spike at cor.

11/1915, F.N. Molyneux, Assistant Engineer  
Survey Record #471, Bk C, page 492 and Curo Bk 87, pg. 64 Set iron monuments at subdivision corners of Sec. 32.

Circa 1932, MnDOT  
File 5-3\_002, right of way map  
Indicates 2" iron pipe/cap 794.9' W. of centerline Hwy. #371.

2/2009, L.R. Pommerening, LS 17005,  
DNR File AMA00050.00.00.01, Steamboat Lake Aquatic Management Area, Certificate of Survey, #4266  
Indicates iron pipe found at the corner.

T. 144 R. 31 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_

N 1/4 32 Corner common to sections 29, 32

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 7/2018 By CCHD/SO

Year of search \_\_\_\_\_ By \_\_\_\_\_

Location filed: #2018.003

Location filed:

Monument: Found 2.25" ODIP

Monument:

down 1.6', on centerline Steamboat Lake Road, top 1' bent, removed monument and straighten, reset vertical over base, top down and witness.

4" Red Oak, N 1° E, 63.29' duplex nail, up 1.0', E. side


8" Balsam, S 46° E, 48.06' duplex nail, up 1.0', S. side

Power Pole, N 52° E, 77.23' duplex nail, up 1.0', N. side

Index No. V 7

CASS COUNTY LAND CORNER RECORD

T. 144 R. 31 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 32 Corner common to sections 29, 32

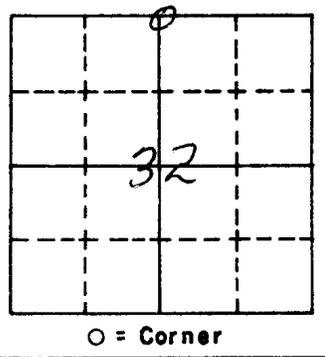

EXISTING SURVEYS

**Original Government Survey**

Year surveyed 1875  
Original monument Post

**Bearing Trees**

Species N. Pine  
Diameter 12"  
Bearing N32W  
Distance 622 LKS

**Original Evidence Found**

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

**Original Bearing Trees Found**

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

**Subsequent Corner Restoration**

Year surveyed 1915 By JOHN CURD  
Location filed COUNTY RESURVEY PLAT E-66"  
Monument 2 1/4 x 4 1/8" IRON MONUMENT  
1905, JOHN CURD, BOOK "C" P. 486 FND B.T.: 12" N. AND N32W  
622 LKS SET NEW STAKE  
1914, CURD, BOOK "C" P. 486 FND STUMP OF OLD B.T. SET NEW STAKE

**Bearing Trees, Reference Objects**

Species <u>ASPEN</u>	<u>N. PINE</u>	<u>TWIN PINE</u>
Diameter <u>5"</u>	<u>14"</u>	<u>10"</u>
Bearing <u>S76W</u>	<u>S39-33E</u>	<u>N43-24E</u>
Distance <u>12.5'</u>	<u>58.25</u>	<u>55.17'</u>
<u>1905 TIE</u>	<u>1914</u>	<u>B.T.S.</u>

**Evidence of Subsequent Corner Restoration**

Year of search 1931 By GLO  
Fnd Cass Co. 2 1/2" galv. i.p. w/iron cap 4" below  
wood surface and stump of orig B.T.  
Mark cap: 11 529  
14 532  
1931

**Bearing Trees, Reference Objects**

<u>J. Pine</u>	<u>J. Pine</u>
<u>12"</u>	<u>7"</u>
<u>S78E</u>	<u>N17 1/2 W</u>
<u>118 LKS</u>	<u>71 LKS</u>

**Subsequent Corner Restoration**

Year surveyed 1925 By Minn. Hwy Dept.  
Location filed R/W map in Recorder's office - Walker  
Monument to Cass Lake  
2" iron pipe iron cap. 794.9' W. of G  
- also 2" i.p. for C.E. 1/16 523.6' E of G

1915- N.D. Gorman- microfilm- roll 115 BK 88 P. 5  
End old line run S & W from corner  
BK 87 P. 16- run W. from corner, P. 18,  
BK 87 P. 33 End stump of old B.T. NW,  
P. 64 Set Iron.

**Evidence of Subsequent Corner Restoration Found**

Year of search \_\_\_\_\_ By \_\_\_\_\_

Remonumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
Filed at \_\_\_\_\_ Date \_\_\_\_\_