


T. 144 R. 31 M. 5th Coordinates: X _____ Y _____

W 1/4 31 Corner common to sections 31 and 36/144/32

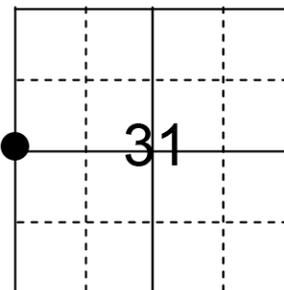

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871
Original monument Post

Original Evidence Found

Year of search _____ by _____
Monument found _____

Bearing Trees

Species	<u>Aspen</u>	<u>Aspen</u>
Diameter	<u>5"</u>	<u>5"</u>
Bearing	<u>N 25° E</u>	<u>S 55° W</u>
Distance	<u>38 links</u>	<u>40 links</u>

Original Bearing Trees Found

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 2/1905 By J.W. Curo, LS 1428
Location filed: Road Calendar Book A, page 58 and Road
Monument: Original Post
Road Calendar Book B, page 37, Wilkinson County Road,
indicates the road runs S. and E. from the corner.

Evidence of Subsequent Corner Restoration

Year of search 5/1931 By Hal D. Craig, U.S. Surveyor
Location filed: Dependent Resurvey of a Portion T 144 N, R 31 W
Monument: Set 2"x 36" iron pipe with brass cap 1/4
at proportional distance, 2" below road surface, S36 | S31
at junction of N-S road and road E. to Wilkinson 1931
and referenced.

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Bearing Trees, Reference Objects

Species	<u>W. Pine</u>	<u>W. Pine</u>
Diameter	<u>8"</u>	<u>14"</u>
Bearing	<u>S 76°45' E</u>	<u>N 42°30' W</u>
Distance	<u>226 links</u>	<u>95 links</u>

Subsequent Corner Restoration

Year surveyed 10/1976 By J.R. Worcester, CCHD
Location filed: SAP 11-666-01
Monument: Found 2" iron pipe
in intersection at station 0+00 and witnessed.
24" W. Pine, SW, 82.3'
6" W. Pine, West, 78.9'
5" Birch, NW, 150.0'

6/1981, Hubbard County Survey Department
Unrecorded Certificate of Location of Government Corner
Found a 1 1/4"x 2 1/2' iron pipe, down 0.9', in road, removed
monument and checked with locater. No other pipe found,
replaced 1 1/4" pipe

1986, Hubbard County Survey Department
Unrecorded Certificate of Location of Government Corner
Found 1 1/4" iron pipe, all CCHD witnesses good, Pine stump
with old blaze faintly visible at bearing and distance for N.W.
1931 B.T. Determine found iron pipe is the 1931 monument
and top 8" and brass cap have been taken off, by road grader.

Evidence of Subsequent Corner Restoration Found


Year of search 5/1991 By D.D. Busker, LS 7203, Hubbard
Location filed: Unrecorded Certificate of Location of Gov't Corner
Monument: Set 16" Hubbard County cast iron monument
Remove 1 1/4" iron pipe and perpetuate it with CIM, witnesses.
24" W. Pine, S 65° W, 82.30'(1973) duplex nail
6" W. Pine, S 84° W, 78.90'(1973) duplex nail
5" Birch, N 57° W, 150.00'(1973) duplex nail
6" W. Pine, S 30° E, 123.11' duplex nail
Power Pole, N 30° E, 54.86' duplex nail

5/2018, CCHD/SO
#2018.003
Found CIM, down 1.0' on centerline CSAH #66, 2'+/-, E. of
centerline Cass Line Rd. and witnessed as follows.
12" W. Pine, S 84° W, 79.12'(1973) duplex nail, up 1.0', S. side
Power Pole, N 30° E, 54.86'(1991) duplex nail, up 2.3', E. side
11" W. Pine, S 30° E, 123.11'(1991) duplex nail, up 1.4', W side
Guy Pole, N 29° W, 64.63' duplex nail, up 1.0', E. side

Index No. X-1

CASS COUNTY LAND CORNER RECORD

T. 144 R. 31 M. 5TH Coordinates: X _____ Y _____
W14 31 Corner common to sections 31

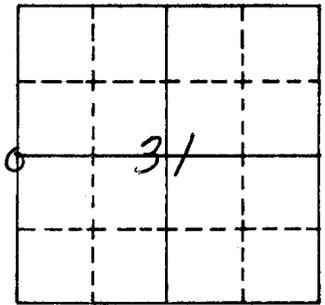

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees
Species Aspen Aspen _____
Diameter 5" 5" _____
Bearing N25E S55W _____
Distance 38LKS 46LKS _____

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1931 By GLO
Location filed Sec. of State
Monument Set 2x36" 1 1/2" w/ brass cap 1/4
Corner at junction of N-S RD i road 536/531
E to Wilkinson 1931

Evidence of Subsequent Corner Restoration

Year of search 1973 By CA HWY Dept
CRP #66
2" 1 1/2" mplece

Bearing Trees, Reference Objects

Species W. Pine W. Pine _____
Diameter 8" 14" _____
Bearing S76-45E N42-30W _____
Distance 226LKS 95LKS _____

Bearing Trees, Reference Objects

w. Pine w. Pine Birch _____
24" 6" 5" _____
SW W NW _____
82.3' 78.9' 150.0' _____

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____