


T. 145 R. 30 M. 5th Coordinates: X _____ Y _____

N 1/4 10 Corner common to sections 3, 10

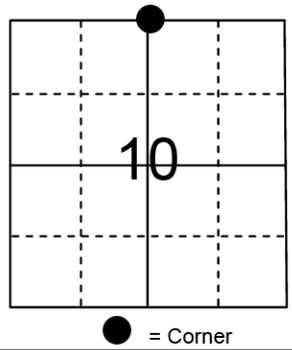

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
Original monument Post

Original Evidence Found

Year of search 1933 by Bandy
Monument found 4"x 3' Pine post
Notes page 67

Bearing Trees

Species	<u>Yellow Pine</u>	<u>Yellow Pine</u>
Diameter	<u>24"</u>	<u>24"</u>
Bearing	<u>S 30° W</u>	<u>N 89° W</u>
Distance	<u>222 links</u>	<u>97 links</u>

Original Bearing Trees Found

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 7/1933 By W.W. Bandy, Surveyor, GLO
Location filed: MN Historical Society, Notes page 67 1/4 S 3
Monument: Set 2"x 36" iron post with brass cap S 10
in place of original corner post, in small open 1933
swamp, 400 links +/-, NE and 150 links S. and
witnessed as follows.

Bearing Trees, Reference Objects

Species	<u>Jack Pine</u>	<u>Jack Pine</u>
Diameter	<u>5"</u>	<u>5"</u>
Bearing	<u>N 3 1/4° W</u>	<u>S 29 1/2° W</u>
Distance	<u>160 links</u>	<u>228 links</u>

Evidence of Subsequent Corner Restoration

Year of search 4/1934 By J.A. Gielhaug, Engineer, CCC
Location filed: USFS Form 874-9
Monument: Found brass capped 1" Iron pipe
up 10" and witness as follows.
Probably 1933 tree.

Bearing Trees, Reference Objects

Species	<u>Jack Pine</u>	_____
Diameter	<u>5"</u>	_____
Bearing	<u>N 4° W</u>	_____
Distance	<u>160 1/2 links</u>	_____

Subsequent Corner Restoration

Year surveyed 2/1992 By G. Brama, USFS
Location filed: USFS Book 2, page 43
Monument: Found GLO iron pipe with brass cap
up 12", in a swamp, 260' NE, 100' S. 65' W. and witnesses as
follows.
5" Jack Pine, N 50° W, 50.85' 60d spike
9" Norway Pine, S 4° W, 104.65' 60d spike
13" Norway Pine, S 72° E, 134.45' 60d spike
Steel Sign Post, North, 1.9' with sign

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

