


T. 145 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 16 Corner common to sections 9, 10, 15, 16

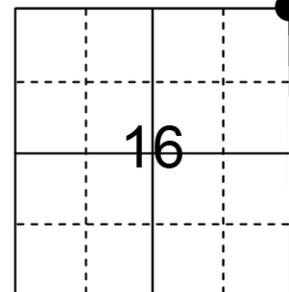

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874  
Original monument Post

Original Evidence Found

Year of search 1933 by Bandy  
Monument found \_\_\_\_\_

Notes page 64

Bearing Trees

Species	Yellow Pine	Black Pine	Yellow Pine	Yellow Pine
Diameter	30"	6"	30"	24"
Bearing	N 48° W	S 38° E	S 34° W	N 45° W
Distance	27 links	130 links	11 links	58 links

Original Bearing Trees Found

Species	N. Pine stump		
Diameter	30"		
Bearing	N 45° W		
Distance	58 links		

Subsequent Corner Restoration

Year surveyed 12/1929 By A.W. Prudlo, Asst. Engr.  
Location filed: Ditch Shelf 1, Book 167, page 3  
Monument:  
S.R. #10 Transit notes, indicates sec line PI at station 38+02.5 and reference points as follows.

Evidence of Subsequent Corner Restoration

Year of search 7/1933 By W.W. Bandy, Surveyor, GLO  
Location filed: MN Historical Society, Notes pg 64 T145 N R30W  
Monument: Set 6" conc cylinder with brass tablet S 9 | S 10  
from remains of original witness tree, up 6", in S 16 | S 15  
center of Black Duck Road and witnessed as 1933  
follow.

Bearing Trees, Reference Objects

Species	Pop.	Pop.		
Diameter	3"	3"		
Bearing	NE	SE		
Distance	40.4'	30.4'		

Bearing Trees, Reference Objects

Species	Jack Pine	White Pine	Burr Oak	Burr Oak
Diameter	6"	5"	20"	4"
Bearing	N 86 1/4° E	S 71 1/2° E	S 46 1/4° W	N 65 3/4° W
Distance	92 links	80 links	63 links	67 links

Subsequent Corner Restoration

Year surveyed 4/1980 By M. Hayes, LS 20774  
Location filed: USFS Book 2, page 48  
Monument: Found corner  
2' W. of centerline of Blackduck Hwy. and witnessed.  
24" White Oak, S 46° W, 41.6'(1933)  
Jack Pine stump, N 86° E, 60.7'(1933)  
White Pine stump, S 71° E, 52.8'(1933)  
4" Cedar Post, West, 46.1' FSLP

Evidence of Subsequent Corner Restoration Found


Year of search \_\_\_\_\_ By \_\_\_\_\_  
Location filed: \_\_\_\_\_  
Monument: \_\_\_\_\_

2/2001, CCHD/SO  
#2001.002  
Found PK nail, 4' W. of centerline Co. Rd. #10 and witnessed.  
White Oak stump, S 46° W, 41.6'(1933)  
13" Spruce, N 30° E, 81.22' 16d duplex nail  
10" Spruce, S 60° E, 49.54' 16d duplex nail  
10" Spruce, S 30° W, 78.56' 16d duplex nail  
10" Spruce, N 78° W, 46.18' 16d duplex nail

Index No. J 13

CASS COUNTY LAND CORNER RECORD

T. 145 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 16 Corner common to sections 9, 10, 15, 16

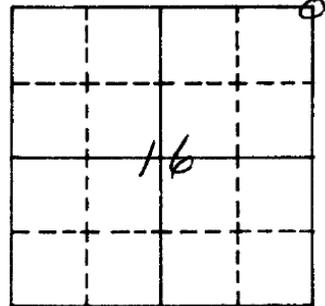

EXISTING SURVEYS

Original Government Survey

Year surveyed 1879  
Original monument lost

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

Species	Bearing	Tree	Species	Bearing	Tree
<u>Y. Pine</u>	<u>30"</u>	<u>Bl. oak</u>	<u>Y. Pine</u>	<u>30"</u>	<u>Y. Pine</u>
<u>30"</u>	<u>6"</u>	<u>30"</u>	<u>24"</u>	<u>N 48 W</u>	<u>538 E</u>
<u>N 48 W</u>	<u>130 LKS</u>	<u>534 W</u>	<u>N 45 W</u>	<u>27 LKS</u>	<u>11 LKS</u>
<u>Distance</u>	<u>130 LKS</u>	<u>11 LKS</u>	<u>50 LKS</u>		

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

O = Corner

Subsequent Corner Restoration

Year surveyed 1933 By GLO  
Location filed Sec. of state  
Monument Find NW BIT stump set concrete man  
24" lang 6" Dia willow cap T145N R30W  
Cor. in center of Blackduck RD 59/510  
516/515

Evidence of Subsequent Corner Restoration

Year of search 4/1980 By USFS  
Found monument 2' W. of & CR#10

Species	Bearing	Tree	Reference Objects	Species	Bearing	Tree	Reference Objects
<u>J. Pine</u>	<u>6"</u>	<u>Willow</u>	<u>Br. oak</u>	<u>Br. oak</u>	<u>4"</u>	<u>1933</u>	
<u>N 86 1/4 E</u>	<u>5"</u>	<u>20"</u>	<u>N 65 3/4 W</u>	<u>GLO Oak</u>	<u>24"</u>	<u>GLO J. Pine</u>	<u>GLO W. Pine</u>
<u>92 LKS</u>	<u>80 LKS</u>	<u>63 LKS</u>	<u>67 LKS</u>	<u>5 46 W</u>	<u>Stp</u>	<u>Stp</u>	
				<u>41.6'</u>	<u>N 86 E</u>	<u>57 E</u>	
					<u>60.7'</u>	<u>52.8'</u>	

Species	Bearing	Tree	Reference Objects
<u>GLO Oak</u>	<u>24"</u>	<u>Stp</u>	<u>Stp</u>
<u>5 46 W</u>	<u>41.6'</u>	<u>N 86 E</u>	<u>57 E</u>
		<u>60.7'</u>	<u>52.8'</u>

J 13

Subsequent Corner Restoration

Year surveyed 2/2001 By CCSO  
Location filed CCSO  
Monument Found PK nail 4' W. of &  
CR #10 at bearing and distance  
from stump which Mike Hayes says  
is remains of GLO Oak. Add  
witnesses as follows

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_

- 13" Spruce N 30 E, 81.22\*
- 10" Spruce S 60 E, 49.54\*
- 10" Spruce S 30 W, 78.56\*
- 10" Spruce N 78 W, 46.18\*
- \*distance to double head nail

Remonumentation certificate prepared \_\_\_\_\_

By \_\_\_\_\_

Filed at \_\_\_\_\_

Date \_\_\_\_\_