



T. 145 R. 30 M. 5th Coordinates: X _____ Y _____
NE 14 Corner common to sections 10, 11, 14, 15

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
 Original monument Post

Original Evidence Found

Year of search 1933 by GLO
 Monument found _____

Resurvey Notes

● = Corner

Bearing Trees

Species	Black Pine	Black Pine	Black Pine	Black Pine
Diameter	14"	6"	6"	3"
Bearing	N 50° E	S 55° E	S 72° W	N 45° W
Distance	80 links	70 links	37 links	80 links

Original Bearing Trees Found

Species	Jack Pine	Jack Pine	Jack Pine	Jack Pine
Diameter	Rotten stump	stump	Rotten stump	Rotten stump
Bearing	N 50 1/2° E	S 52° E	S 72° W	N 44° W
Distance	80 links	70 links	37 links	80 links

Subsequent Corner Restoration

Year surveyed 1928 By J.A. Donery, Forest Ranger
 Location filed: CCC notes USFS
 Monument: 5" stake, properly scribed
 Jack Pine, NW, 21 paces.

Evidence of Subsequent Corner Restoration

Year of search 1/1931 By E. Justenen, Chief Party
 Location filed: Form 874
 Monument: Squared scribed stake
 up 3', in fair condition.

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 5/1936 By W.W. Bandy, Surveyor
 Location filed: Resurvey Notes T145 N R30W
 Monument: Set 6" concret cylinder with brass tablet S 11 | S 12
 from remains of original witnesses. S 14 | S 13
 8" Jack Pine, N 34° E, 46 links (30.36') 1933
 8" Jack Pine, S 36° E, 33 links (21.78')
 6" Jack Pine, S 17 3/4° W, 33 links (21.78')
 16" Norway Pine, N 41 1/2° W, 178 links (117.46')

Evidence of Subsequent Corner Restoration Found

Year of search 4/2010 By Kadmas, Lee & Jackson
 Location filed: Certificate of Location
 Monument: Found GLO concrete with brass cap
 up 0.3' and witnesses.
 13" White Pine, N 15° W, 11.70' (1966)
 20" White Pine, N 46° E, 16.47' (1992) spike in N. side
 20" White Pine, S 76° E, 27.70' (1992) spike in N. side
 22" White Pine, N 78° W, 30.40' spike in S. side
 Steel Sign Post, South, 2.9' (1992)

5/1966, J. Ekstrom, USFS
 USFS Book 1, page 50
 Found GLO concrete with brass tablet and witnessed.
 Norway Pine stump, N 42° W, 117.46' (1933)
 6" Jack Pine, N 15° W, 11.7'
 9" Jack Pine, N 61° E, 17.5'
 9" Jack Pine, S 20° E, 12.4'
 10" Jack Pine, S 47° W, 19.2'


4/2014, R. Wamre, LS 45334
 Certificate of Location, Doc. #A000601395
 Filed on the above information.

3/1992, G. Brama, USFS
 USFS Book 1, page 50
 Found GLO concrete with brass tablet and witnessed.
 12" Jack Pine, S 47° W, 19.2' (1966)
 8" Jack Pine, N 15° W, 11.7' (1966)
 10" N. Pine, S 33° W, 47.74' 12" N. Pine, N 30° W, 99.3'
 8" W. Pine, N 46° E, 16.47' 11" W. Pine, S 76° E, 27.70'
 Steel Sign Post, South, 2.9'

Index No. J 21

CASS COUNTY LAND CORNER RECORD

T. 145 R. 30 M. 5TH Coordinates: X _____ Y _____
NE 14 Corner common to sections 11, 12, 13, 14

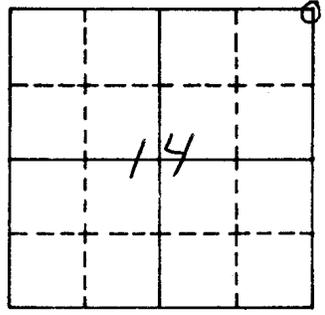

EXISTING SURVEYS

Original Government Survey
Year surveyed 1874
Original monument Post

Original Evidence Found
Year of search _____ By _____
Monument found _____

	Bearing Trees			
Species	<u>Bl. Pine</u>	<u>Bl. Pine</u>	<u>Bl. Pine</u>	<u>Bl. Pine</u>
Diameter	<u>14"</u>	<u>6"</u>	<u>6"</u>	<u>3"</u>
Bearing	<u>N50E</u>	<u>S55E</u>	<u>S72W</u>	<u>N45W</u>
Distance	<u>80 LKS</u>	<u>70 LKS</u>	<u>37 LKS</u>	<u>80 LKS</u>

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

O = Corner

Subsequent Corner Restoration
Year surveyed 1933 By GLO
Location filed Sec. of state
Monument Find remains of all 4 B.T.S - Set concrete mon. 24" long 6" dia w/ brass cap

Evidence of Subsequent Corner Restoration
Year of search 1966 By William Okerman
Found GLO monument in good condition

	Bearing Trees, Reference Objects			
Species	<u>J. Pine</u>	<u>J. Pine</u>	<u>J. Pine</u>	<u>N. Pine</u>
Diameter	<u>8"</u>	<u>8"</u>	<u>6"</u>	<u>16"</u>
Bearing	<u>N34E</u>	<u>S36E</u>	<u>S17 3/4 W</u>	<u>N41 1/4 W</u>
Distance	<u>46 LKS</u>	<u>33 LKS</u>	<u>33 LKS</u>	<u>178 LKS</u>

	Bearing Trees, Reference Objects			
Species	<u>J. Pine</u>	<u>J. Pine</u>	<u>J. Pine</u>	<u>J. Pine</u>
Diameter	<u>6"</u>	<u>9"</u>	<u>9"</u>	<u>10"</u>
Bearing	<u>N15W</u>	<u>N61E</u>	<u>S20E</u>	<u>S47W</u>
Distance	<u>11.7'</u>	<u>17.5'</u>	<u>12.4'</u>	<u>19.2'</u>

Subsequent Corner Restoration
Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found
Year of search _____ By _____
CERTIFICATE - BILL OKERMAN 1966

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____