


T. 145 R. 31 M. 5th Coordinates: X _____ Y _____

MC #20 Corner common to sections 13 and 18-145-30

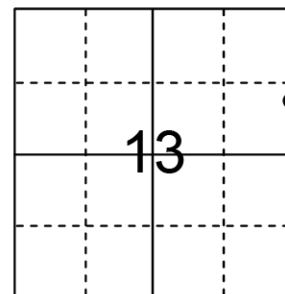

13

● = Corner

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1873</u>		Year of search <u>1900</u> by <u>COE</u>	
Original monument <u>Post</u>		Monument found _____	
		Lake Winnibigoshish Map	

Bearing Trees			
Species	<u>White Oak</u>	<u>Poplar</u>	_____
Diameter	<u>8"</u>	<u>3"</u>	_____
Bearing	<u>S 63° E</u>	<u>S 37° W</u>	_____
Distance	<u>13 links</u>	<u>76 links</u>	_____

Original Bearing Trees Found			
Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1900 By T.M. Fowble, COE
 Location filed: Lake Winnibigoshish Reservoirs Map
 Monument:
 Indicates original corner recovered.

Evidence of Subsequent Corner Restoration

Year of search 6/1933 By W.W. Bandy, Surveyor
 Location filed: Resurvey Notes WC
 Monument: Set 6" concrete cylinder w/ brass tablet at proportionate position. MC
 S 13 | S 18
 R31W | R30W
 T145N
 1933

Bearing Trees, Reference Objects			
Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects			
Species	<u>Norway Pine</u>	<u>Norway Pine</u>	_____
Diameter	<u>25"</u>	<u>12"</u>	_____
Bearing	<u>S 43° E</u>	<u>S 20 1/2° W</u>	_____
Distance	<u>171 links</u>	<u>147 links</u>	_____

Subsequent Corner Restoration

Year surveyed 1/1934 By J.A. Gjelhaug, CCC
 Location filed: 145-30 Form 874
 Monument: Found Brass capped cement up 5", at S. shore Cass Lake and witnesses. 20" N. Pine, S 42 1/2° E, 172 1/2 links(113.85') (1933) 10" N. Pine, S 20 1/2° W, 146 links(96.36') (1933)

 5/2019, A.J. Skattum, LS 54139, USFS
 Certificate of Location LS54139
 Set 2" USFS iron pipe with brass cap WC
 as a witness to the meander corner MC
 10.00' S. and witnessed as follows
 N. Pine Stp, S 44° E, 103.48'(1933) decayed R31W | R30W
 15" N. Pine, S 24° W, 90.40'(1933) 60d nail, E. T145N
 14" R. Oak, N 66° W, 7.05' 60d nail, S. side 2019
 11" N. Pine, S 70° E, 42.96' 60d nail, N. side


Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
 Location filed: _____
 Monument: _____

Index No. K-L 25

CASS COUNTY LAND CORNER RECORD

T. 145 R. 31 M. 5TH Coordinates: X _____ Y _____
m.c. # 20 Corner common to sections 13 AND 18-145-30

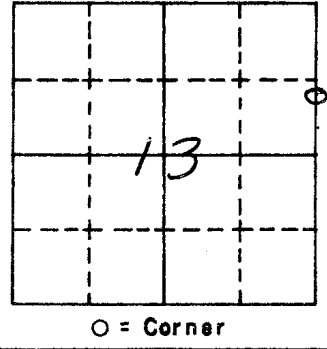

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument lost

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees

Species W. oak Aspen _____
Diameter 8" 3" _____
Bearing S63E S37W _____
Distance 13 Lks 76 Lks _____

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1933 By GLD
Location filed Sec of State
Monument Set Concrete man 24" long 6" dia w/ brass cap

Evidence of Subsequent Corner Restoration

Year of search _____ By _____

Bearing Trees, Reference Objects

Species N. Pine M. Pine _____
Diameter 25" 12" _____
Bearing S43E S20 1/2 W _____
Distance 171 Lks 147 Lks _____

Bearing Trees, Reference Objects

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____