


Index No. L.0-25.0

CASS COUNTY LAND CORNER RECORD

T. 145 R. 31 M. 5th Coordinates: X _____ Y _____

E 1/4 13 Corner common to sections 13 and 18-145-30

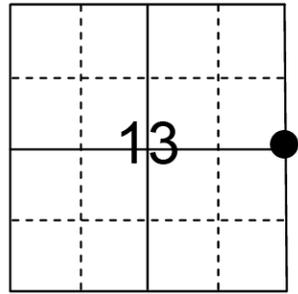

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search 1933 by Bandy
Monument found _____

Resurvey Notes

Bearing Trees

Species	<u>White Pine</u>	<u>Norway Pine</u>	_____
Diameter	<u>16"</u>	<u>16"</u>	_____
Bearing	<u>S 65° E</u>	<u>N 78° W</u>	_____
Distance	<u>27 links</u>	<u>44 links</u>	_____

Original Bearing Trees Found

Species	<u>White Pine</u>	<u>Norway Pine</u>	_____
Diameter	<u>Charred Stp.</u>	<u>Charred Stp.</u>	_____
Bearing	<u>S 64° E</u>	<u>N 77° W</u>	_____
Distance	<u>27 links</u>	<u>44 links</u>	_____

Subsequent Corner Restoration

Year surveyed 6/1933 By W.W. Bandy, Surveyor, GLO
Location filed: Resurvey Notes 1/4
Monument: Set 6" concrete cylinder w/ brass tablet S 13 | S 18
from remains of original witness stumps. 1933
New witnesses.

Evidence of Subsequent Corner Restoration

Year of search 1/1934 By J.A. Gjelhaug, CCC
Location filed: 145-30 Form 874
Monument: Found GLO brass capped cement up 5" and witnesses.

Bearing Trees, Reference Objects

Species	<u>White Pine</u>	<u>Norway Pine</u>	_____
Diameter	<u>14"</u>	<u>25"</u>	_____
Bearing	<u>S 77° E</u>	<u>S 2 1/2° W</u>	_____
Distance	<u>128 links</u>	<u>86 links</u>	_____

Bearing Trees, Reference Objects

Species	<u>N. Pine</u>	<u>W. Pine</u>	_____
Diameter	<u>20"(1933)</u>	<u>12"(1933)</u>	_____
Bearing	<u>S 4° W</u>	<u>S 77° E</u>	_____
Distance	<u>84 1/2 links</u>	<u>127 links</u>	_____

Subsequent Corner Restoration

Year surveyed 5/1994 By C. Krause, USFS
Location filed: USFS 145-30, Book 1, page 21
Monument: Found GLO brass capped concrete monument flush, on side hill, facing SE toward swamp, 200'+/-, SE of pipeline and witnesses.
Pine stump remains, N 77° W, 29'(1873) Birch clump growing 22" White Pine, S 77° E, 84.5'(1933) good condition
Norway Pine, S 2° W, 56.8'(1933) large pine stub, windfall 11" N. Pine, N 12° E, 36.11'
14" N. Pine, N 50° W, 38.23'
Steel Sign Post, East, 3.7'
Steel Sign Post, South, 3.6'


Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

Index No. L 25

CASS COUNTY LAND CORNER RECORD

T. 145 R. 31 M. 574 Coordinates: X _____ Y _____
E114 13 Corner common to sections 13 AND 18-145-30

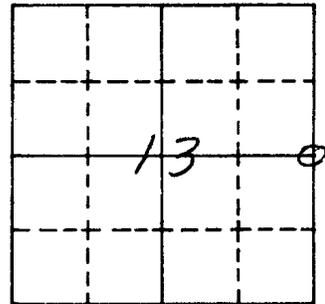

○ = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees

Species White White
Diameter 16" 16"
Bearing S65E N78W
Distance 27 LKS 44 LKS

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1933 By GLO
Location filed Sec. of State
Monument End stumps of both pits set concrete
Mon 24" long 6" Dia
1/4
5131518
1933

Evidence of Subsequent Corner Restoration

Year of search _____ By _____

Bearing Trees, Reference Objects

Species White White
Diameter 14" 25"
Bearing S77E S2 1/2 W
Distance 120 LKS 86 LKS

Bearing Trees, Reference Objects

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____