


T. 145 R. 31 M. 5th Coordinates: X _____ Y _____
E 1/4 21 Corner common to sections 21, 22

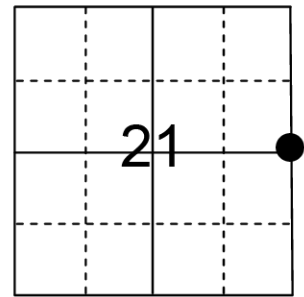

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1912 by Curo
Monument found _____
Survey Rec #216, Bk A, pg 529

Bearing Trees

Species Jack Pine Jack Pine
Diameter 10" 6"
Bearing N 64° W N 61° E
Distance 29 links 30 links

Original Bearing Trees Found

Species J. Pine stp Jack Pine
Diameter 10" 6"
Bearing N 57°30' W N 57°30' E
Distance 29 links 30 links

Subsequent Corner Restoration

Year surveyed 10/1912 By J.W. Curo, LS 1428
Location filed: Survey Record #216, Book A, page 529
Monument: Set 3"x 36" old marked stake
From GLO witnesses, which are plainly marked, by flat
measurement from face of figures and witnesses as follows.

Evidence of Subsequent Corner Restoration

Year of search 1/1913 By A.W. Moulster
Location filed: Ditch shelf 1, Book 11, page 31
Monument:
Indicates corner at station 0+00, S.R. #8.

Bearing Trees, Reference Objects

Species Birch Jack Pine
Diameter 6" 12"
Bearing S 83° W S 44° E
Distance 57.90' 57.50'

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 5/1914 By A.W. Moulster
Location filed: Ditch shelf 5, Book 2, page 69
Monument: Set from old BT's
on line at station 52+81, S.R. #1

2/1935, J.A. Gjelhaug, Eng. CCC
USFS Form 874-9
Found GLO witnesses.

5/1981, C. Krause, USFS
T145N R31W Field Book 1, page 11
Chained from Sec. corner to N. No iron or post, no evidence of
witnesses. Corner lost in road construction and Power line
clearing to west of road.

2000, CCHD/SO
#2000.046
Found what appears to be base of 4" CIM, down 1.6', on
centerline of So. Rd. #146 and witnessed.
12" W. Pine, N 32° E, 87.69' old blaze on tree
16" N. Pine, S 36° E, 77.63' old blaze on tree
Power Pole, S 84° W, 37.13' old blaze on tree

Evidence of Subsequent Corner Restoration Found


Year of search 11/2015 By R.W. Murray, LS 15483
Location filed: Certificate of Location
Monument: Found Mag nail
and 2000 witnesses as follows.
30" W. Pine, N 26° E, 87.69' found spike, NW side
30" N. Pine, S 39° E, 77.63' found spike, SW side
OHP Pole, S 82° W, 37.13' found spike, NW side

1/2016, R.W. Murray, LS 15483
Certificate of Location
Set 1/2"x 14" iron pipe capped LS 15483 from recovered
witnesses and marked new witnesses.
1/2" iron pipe, S 89° W, 33.00' capped LS 15483
Fire Hyd, S 45° W, 49.51' top nut

Index No. P 13

CASS COUNTY LAND CORNER RECORD

T. 145 R. 31 M. 5TH Coordinates: X _____ Y _____
E 1/4 21 Corner common to sections 21, 22

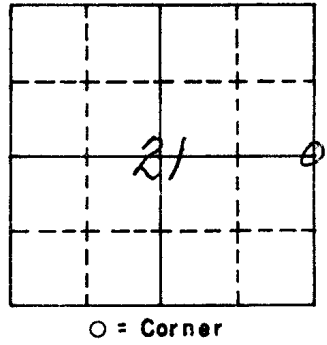

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees
Species Jilne Jilne
Diameter 10" 6"
Bearing N64W N61E
Distance 29LKS 30 LKS

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1912 By JOHN CURD
Location filed COUNTY SURVEY RECORD BOOK "A" P 529-531
Monument FIND OLD GOVT BITS: 6" JILNE N61E 30LKS, STUMP 10" JILNE N64W 29LKS SET 3x3x36" STAKE

Evidence of Subsequent Corner Restoration

Year of search 1981 By JCS

Bearing Trees, Reference Objects

Species BIRCH JILNE
Diameter 6" 12"
Bearing S83W S44E
Distance 57.90' 57.50'

Bearing Trees, Reference Objects

P-13 E 1/4 21/145/31

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search 2000 By CCSO
End. in place; appears to be base of 4" CIM, down 1.6'. Top is totally gone. Referenced to center of base w/ B.T.'s Located @ C.R. 146.
REF. TIES:
12" W. Pine (fnd. old blaze) N 32° E 87.69'
16" N. Pine (fnd. old blaze) S 36° E 77.63'
P. Pole (set dbl. hd. nail) S 84° W 37.13' (TAG)

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____