

T. 145 R. 31 M. 5th Coordinates: X _____ Y _____
NE 28 Corner common to sections 21, 22, 27, 28



EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1900 by COE
Monument found _____
Lake Winnebigoishish Reservoir

Bearing Trees

Species	Jack Pine	Jack Pine	Jack Pine	Jack Pine
Diameter	6"	8"	4"	8"
Bearing	S 3 1/2° E	S 4° W	N 52° W	N 49 1/2° E
Distance	196 links	190 links	78 links	370 links

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1904 By T.M. Fowble
Location filed: Lake Winnebigoishish Reservoir
Monument:
Indicates known corner

Evidence of Subsequent Corner Restoration

Year of search 1/1913 By A.W. Moulster
Location filed: Ditch shelf 1, Book 11, page 33
Monument:
page 33 corner is 18' left at station 26+44.4, S.R. #8.

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 7/1913 By J.W. Curo, LS 1428
Location filed: Survey Record #237, Book A, page 606
Monument: Set 2.5"x 4' iron pipe, capped with anchor rod
From GLO witnesses, which are standing green and plainly
marked, by proportionate measurement. NE and NW trees are
gone, lists witnesses as follows.
8" Jack Pine, S 5° W, 123.88'(GLO)
6" Jack Pine, S 3 1/2° E, 130.93'(GLO)
8" Jack Pine, N 32°56' W, 49.05' nail head at base
8" Jack Pine, N 65°08' E, 80.54' nail head at base

5/1914, A.W. Moulster
Ditch shelf 5, Book 2, page 70
2"x 48" iron pipe, on line at station 79+27.5, set from South
BTs, S.R. #1

6/1916, J.F. Pomasel, LS 1728
Curo Book 62, image 159
Found corner and chained S. for centerline.

2/1935, J.A. Gjelhaug, Eng. CCC
USFS Form 874-9
Notes GLO witnesses and marked new witnesses.
8" Jack Pine, S 85° E, 65 1/2 links(43.23')

Evidence of Subsequent Corner Restoration Found

Year of search 1962 By R.H. McDonald, USFS
Location filed: T145N R31W Field Book 1, page 12
Monument: Found 2" Galv. Iron pipe with cap
Lowered monument 6" and marked new witnesses.
5" N. Pine, N 55° E, 43.6' scribed
7" N. Pine, S 68 1/2° E, 34.8' scribed
Cedar Post, East, 35.0' with 54-4

5/1981, C. Krause, USFS
T145N R31W Field Book 1, page 12
Found 2"x 48" iron pipe with cap, down 4" in road and
witnesses as follows.
12" Jack Pine, N 65° E, 80.54'(1913) nail in blaze at base
11" N. Pine, S 69° E, 34.8'(1962) marked for removal
8" N. Pine, N 55° E, 43.6'(1962) marked for removal
10" N. Pine, N 30° E, 106.47' spike in side
19" N. Pine, N 52° E, 70.03' spike in side
14" N. Pine, S 83° E, 112.25' spike in side
10" N. Pine, S 50° E, 94.78' spike in side
Cedar Post, East, 35.0'(1962) marked for removal

7/1989, R.W. Murray, LS 15483
Certificate of survey for Slagle, #917
Indicates monument found.

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 2000 By CCHD/SO
 Location filed: #2000.046
 Monument: Found 2" I.P. with plumbers cap
 down 0.3', 2'+/-, S. and 7'+/-, W. of centerline Co. Rd. #146
 and witnesses as follow.
 13" N. Pine, N 30° E, 106.47'(1981) BT tag
 16" N. Pine, N 52° E, 70.03'(1981) BT tag
 12" N. Pine, S 38° W, 70.41'
 Power Pole, N 25° W, 59.11'

Year of search _____ By _____
 Location filed: _____
 Monument: _____


11/2015, R.W. Murray, LS 15483
 Certificate of Location
 Found no monument and notes 2000 witnesses.

1/2016, R.W. Murray, LS 15483
 Certificate of Location
 Reviewed corner location with T. Freeman and used his
 established position or the corner. Set 1/2"x 14" iron pipe
 capped LS 15483 and marked new witnesses.
 OHP Pole, N 29° W, 59.10' (2000) spike in SW side
 30" N. Pine, N 65° E, 46.94' spike in N. side
 30" N. Pine, S 52° E, 94.77' spike in NE side

Index No. R13

CASS COUNTY LAND CORNER RECORD

T. 145 R. 31 M. 574 Coordinates: X _____ Y _____
NE 28 Corner common to sections 21, 22, 27, 28

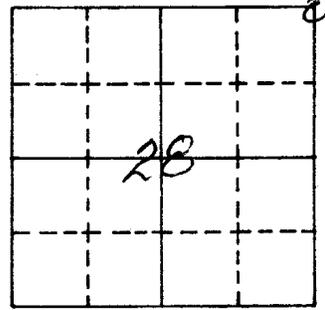

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Species	Bearing Trees			
	J. Pine	J. Pine	J. Pine	J. Pine
Diameter	6"	8"	4"	8"
Bearing	S3 1/2 E	S4 W	N52 W	N49 1/2 E
Distance	196 LKS	190 LKS	78 LKS	370 LKS

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

○ = Corner

Subsequent Corner Restoration

Year surveyed 1913 By JOHN CURO
Location filed COUNTY SURVEY RECORD BOOK "A" P. 605-611
Monument END OLD CORNER B.T.S: 6" J. PINE S3-30E 196 LKS
8" J. PINE S4 W 190 LKS SET 2" 14x48" GALV. I.P.
W/ CAR.

Evidence of Subsequent Corner Restoration

Year of search 1916 By Tomasek
MICROFILM - roll 105 BK 62 P. 15
End corner - Chain to SE Cor = 5271.8

Bearing Trees, Reference Objects

Species	<u>J. PINE</u>	<u>J. PINE</u>	_____	_____
Diameter	<u>8"</u>	<u>8"</u>	_____	_____
Bearing	<u>N32-56W</u>	<u>N65-08E</u>	_____	_____
Distance	<u>49.05'</u>	<u>80.54'</u>	_____	_____

Bearing Trees, Reference Objects

_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

R13

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search 2000 By CCSO
End. in place; 2" I.P. w/ plumbers cap,
down 0.3'. located 2'S & 146 and 7' W
& N/S C.R. 146. End. 2 B.T.'s (USFS 1981, K.K.)
Established 2 more ties as noted.

REF. TIES:

<u>P. Pole</u>	<u>N 25° W</u>	<u>59.11'</u>
<u>12" N. Pine</u>	<u>S 38° W</u>	<u>70.41'</u>
<u>16" N. Pine (End. B.T. tag)</u>	<u>N 52° E</u>	<u>70.03'</u>
<u>13" N. Pine (End. B.T. tag)</u>	<u>N 30° E</u>	<u>106.47'</u>

* distance to new ties pulled to dbl. hd. nail

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____