


T. 145 R. 31 M. 5th Coordinates: X _____ Y _____
SW 31 Corner common to sections 31 and 36-145-32

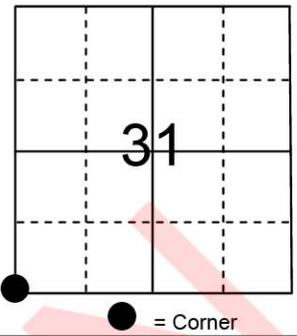

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871
Original monument Post

Original Evidence Found

Year of search _____ by _____
Monument found _____

Bearing Trees

Species	<u>Linden</u>	<u>Black Ash</u>
Diameter	<u>5"</u>	<u>6"</u>
Bearing	<u>N 50° W</u>	<u>N 18° E</u>
Distance	<u>25 links</u>	<u>27 links</u>

Original Bearing Trees Found

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 5/1913 By J.W. Curo, LS 1428
Location filed: Survey Record #245, Book B, page 37
Monument: Hub and tack by Middleton

Evidence of Subsequent Corner Restoration

Year of search 1973 By CCHD
Location filed: Co. Rd. #69
Monument: R.R. Spike

Bearing Trees, Reference Objects

Species	<u>Oak</u>	<u>Basswood stub</u>
Diameter	<u>3"</u>	<u>8"</u>
Bearing	<u>S 10°30' E</u>	<u>N 43°40' W</u>
Distance	<u>48.70'</u>	<u>72.35'</u>

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 8/1994 By R.J. Thorpe, LS 23331
 Location filed: Hubbard Co. Certificate of Location
 Monument: Oak stake
 Found a R.R. Spike at road intersection, dug down 16" to natural soil, found Curo 4" Oak stake. Set Hubbard Co. CIM and witnesses
 Fence Post, N 33° E, 52.77' duplex nail, up 0.5', NW side
 Fence Post, N 52° W, 45.90' duplex nail, up 0.5', SW side
 5" White Oak, S 55° W, 87.96' duplex nail, up 0.8', SE side
 Power Pole, S 38° W, 50.46' duplex nail, up 0.4', SE side

12/2010, T.L. Freeman, LS 21367
 Certificate of Location
 Found CIM, down 7", on centerline Co. Rd. #69 and centerline 460th St and witnesses.
 Fence Post, N 52° W, 45.90'(1994) duplex nail, up 8", SW side
 5" White Oak, S 55° W, 87.96'(1994) duplex nail, up 9", SE
 Power Pole, S 38° W, 50.46'(1994) duplex nail, up 7", SE side
 Fence Post, N 30° E, 72.95' mag nail, up 12", SE side

10/2011, T.L. Freeman, LS 21367
 Certificate of Survey, #5761
 Indicates found CIM.


Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

Index No. 21

CASS COUNTY LAND CORNER RECORD

T. 145 R. 31 M. 5TH Coordinates: X _____ Y _____
SW 31 Corner common to sections 31

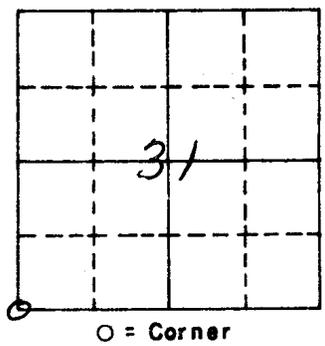

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871
Original monument Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees

Species	<u>Lind</u>	<u>Bl. Ash</u>	_____
Diameter	<u>5"</u>	<u>6"</u>	_____
Bearing	<u>N56W</u>	<u>N19E</u>	_____
Distance	<u>2545</u>	<u>2745</u>	_____

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1913 By John Curd
Location filed County Survey Record Book B P.36-39
Monument END HUB + TACK SET BY MIDDLETON

Evidence of Subsequent Corner Restoration

Year of search 1973 By Co Hwy Dept.
Co Rn # 69
R.R. spike in place

Bearing Trees, Reference Objects

Species	<u>OAK</u>	<u>BASSWOOD</u>	_____
Diameter	<u>3"</u>	<u>8" stub</u>	_____
Bearing	<u>S10-30E</u>	<u>N43-40W</u>	_____
Distance	<u>48.70'</u>	<u>72.35'</u>	_____

Bearing Trees, Reference Objects

_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____
Filed at _____

By _____
Date _____