

CORNER RESTORATION T14N R29W 6

CORNER RESTORATION

T14N R29W

KS
FIELD BOOK
320012

BOOK 6

South West 1/16 Cor. Sec. 16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam with brass cap
marked SW 1/16 S 16

1918.

W. Oak 9" S42°45'W 212 1KS-139.92'
Now 13" BROKEN OFF 3 FT TALL STUMP. FD NEG SCRIBE IN
HOLLOW STUMP. R MAIN

W. Oak 12" N75°30'W 211 1KS-139.26'
Now ROTTED WINDFALL. FD ROLLER FROM OLD BLAZE. R MAIN

FORM 458 ON 6" OAK S85°W-86.46 FT

5-8-2000 R MAIN

FD IRON IN PLACE ± 50 FT EAST OF MIXED
HARDWOODS. CORNER IN LARGE GRASS SLough.
BEAVER AND ± 150 FT SOUTH EAST OF CORNER.
DROVE 8 FT STEEL SIGN POST ON NORTH SIDE OF IRON.
WIRED IRON TO POST, TOP OF POST AND CAP ARE NOW
8" ABOVE SWAMP.

WITNESS WITH,

W OAK 7" 550 W 56.80 FT TO SPC MARK 516 BT

MAPLE 10" N62 W 39.47 FT TO SPC MARK 516 BT

8 FT STEEL SIGN POST 1.55 FT NORTH
LINE TO STANDARD NORTH AND SOUTH OF CORNER

K, L-10

Angle Point 3 of Allotment 1654 and a point
on the East bdy. of Allotment 1405, Sec. 16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

	S 16
	TR
TR	1654
	AP 3
	1405
	1918

7150-4 By WITTHOFT & EMERY 2/10/70

5-16-2000 R. MAIN

Fd IRON IN PLACE UP 4" IRON IS IN MIXED
HARD WOODS. 1970 TAG ON A 10" ROAK (TWIN) FROM WHICH
CORNER BEARS N80°W 105 FT. MARK NEW B.T.S.

ROAK 9" N46°E 100.42 FT TO SPK MKD. S16 BT

ROAK 6½" N62°W 110 FT TO SPK MKD. S16 BT

ROAK 10" S80°E 105 FT TO SPK NET MKD 1970 TAG

MARCH/2001 MAIN

8 FT STEEL SIGN POSTS 4.0 EAST 4.0 SOUTH
LINE TO STANDARD SOUTH AND EAST

M-10

North West 1/16 Cor. Sec. 16

G.L.O. Resurvey notes of 1918

Iron post 3/4 long 1" diam. with brass cap marked

NW 1/16 S 16

1918

R. Oak 16" S38°W 258 1K5- 170.28'
NO EVIDENCE

R. Oak 14" N34°30'W 479 1K5- 316.14'
NO EVIDENCE

Form 458 on 5" Elm N 80°W - 130.68 FT
No date

7150-4 By EMERY & WITTHOFT 2/9/70

4-11-2000 R MAIN

FD CORNER IN GRASS & ALDER SLOUGH. FD TAG BY
EMERY AND WITTHOFT ON 15" ASPEN N 42 E

1 CHAIN 4 LKS FROM CORNER. TAG DATED 2/9/70.

SLOUGH IS NW X SE ± 6 ACRES. SLOUGH IS "HOOR GLASS"
SHAPE AND CORNER IS AT NARROWS OF "HOOR GLASS."

WOODS EDGE N 60 E 50 FT AND S 20 W 75 FT.

MKD NEW AT

W OAK 9" N 60 E 92.9 FT TO SPERMEN: S 16 BT

8 FT STEEL SIGN POSTS 1/4 S NORTH 1/8 E EAST
LINE TO STANDARD NORTH AND EAST

M.C. Secs. 8-9 (shore of Leech L. bears E+W)

G.L.D. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

M C	
S 8	S 9
T141 N	R29W
1918	

R. Oak 14" 584°E 356 lks - 234.96'

Birch 12" N81°45'W 78 lks - 51.48'

Center North 1/16 Cor. Sec. 9

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

C
N 1/16 | S 9
C


Spruce 8" N18°E 25 1/2 - 16.50'

Cedar 12" S84°W 39 1/2 - 25.74'

S.M.C. on the center line Sec. 9 (shore of L each h. bears E & W)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

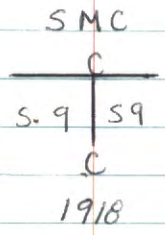

Cedar 8" S3° 15' E 251 1/2 - 165.66'

Cedar 7" S2° 45' W 220 1/2 - 145.20'

Center East 1/16 Sec. 9

G.L.O. Resurvey notes of 1918

Iron post 3/16" diam. with brass cap marked

E 1/16
 C ————— C

S9.

1918

R. Oak 13" S34°E 34 IK5- 22.44'

NO EVIDENCE REMAINS AT BEG. + DIST.

R. Oak 12" N61°W 34 IK5- 22.44'

NO EVIDENCE REMAINS AT BEG. + DIST.

1/23/89 OK-GB

FD. IRON + CAP - IN PLACE - IN GOOD CONDITION

3" ABOVE GROUND - IN HARDWOOD STAND

W. OAK 9 N18 E 36.50' MKD CE'116 S9 BT

R. OAK 11 S37 E 23.35' MKD CE'116 S9 BT


W. OAK 17 S64 W 83.30' MKD CE'116 S9 BT

8' STEEL SIGN POST EAST 4.75 AND WEST 4.15'

Ce. Center West 1/16 Cor. Sec. 9

G.L.D. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked



S 9

1918

R. W. Oak 9" N8°30'E 62 1/2 - 40.92'

Nc

R. W. Oak 7" S5°30'W 42 1/2 - 27.72'

Nc

1/2

Fe

3'

W

R.

W

8

C South East 1/16 Col. Sec. 9

6 G.L.O. Resurvey notes of 1918

2 Iron post 3' long 1" diam. with brass cap marked

SE 1/16 S9

1918

W. Oak 14" S72°30'W 64 lks - 42.24'

F Elm 7" N12°W 49 lks - 32.34'

(Angle Point 2 of Allotment 1478 and Angle
Point 5 of Allotment 1484, Sec. 9

2 G.L.O. Resurvey notes of 1918

- Iron post 3' long 1" diam. with brass cap marked

- TR 1484

- AP 5

- AP 2

- TR

F 1478

- 1918

North East 1/16 Cor. Sec. 9
 G. L. O. Resurvey notes of 1918
 Iron post 3' long 1" diam. with brass cap marked
 NE 1/16 S9
 1918

Maple 14" S77°W 35 1/2 - 23.10'

Maple 18" N46°30'E 60 1/2 - 39.60'

H-10

South West 1/16 Cor. Sec. 9

E.L.O. Resurvey notes of 1918

Iron post 3' long, 1" diam. with brass cap marked

1/19/89 CK-GB SW 1/16 S9

Found 6LO iron 1918

with B.C. set 1' above ground

Spruce 16" N25°15'E 78 IKS- 51.48'

Found no evidence

Ash 8" S38°45'W 65 IKS- 42.90'

Found 15 S391W 42.9 No scar vis.

9150-4 By WATTHOFF 2/17/70

Mko New BT'S

Ash 6" N33 E 49.5' S W 1/16 S7 BT

Ash 7" S 6 E 29.95 S W 1/16 S7 BT

W.OAK 27 N43W 102' 0" S W 1/16 S9 BT

8' steel sign post west 4.0' with signs.

line to standard E-W from corner.

CC DONE

13

H-9,10

Angle Point 3 of Allotment 1572, Angle Point
4 of Allotment 1570 and a point on the North
bdy. of Allotment 1603, Sec. 9

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

TR	TR
1570	1572
AP 4	AP 3
TR	1603
1918	

7150-4 By WHITTHOFT 2/17/70

1/19/89 CK GB

FD. IRON AND CAP IN PLACE - IN GOOD CONDITION

4" ABOVE GROUND IN HARDWOODS AND ASPEN

OLD BARBED WIRE FENCE E+W 3' NORTH OF CORNER

LINE TO STD. E+W

W. OAK 13 S2W 29.5 mko. S9 BT

W. OAK 8 S67E 67.75' " S9 BT

W. OAK 4 N66E 7.65' X BT

8" STEEL SIGN POST 4.2' EAST

CC DONE

19

S.M.C. on the West 1/16 line, Sec. 9 (shore of Leach L. bears E 1/2 W)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S M C

W

S 9 | S 9

W

1918


Cedar 8" N 87° 15' E 60 KS - 39.60'

Elm 10" S 48° 15' W 135 KS - 89.10'

M.C. Secs. 18-19 (shore of Pine L. bears N & S)

G.L.D. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

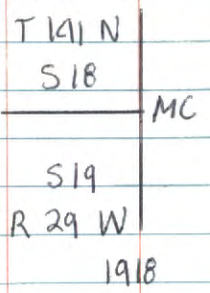

Poplar 12" N26°W 56 KS- 36.96'

Poplar 10" S83°15'W 26 KS- 17.16'

M.C. Secs. 17-18 (Share of Pineh. bears, NE & SW)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

T 141 N	R 29 W
S 18	S 17
M.C.	

N. Pine 30" N35°E 8 1/2 5.28'

Poplar 8" N62°15'W 79 1/2 52.14'

West 1/16 Cor. Secs. 8-17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 8

W 1/16

S 17

1918

Cedar 10" N 85° E 33.1 AS - 21.78'
NO EVIDENCE

Cedar 14" S 12° 30' W 39.1 AS - 25.74'
STUMP & BRG AND DISTANCE.

L-30-2001

FD IRON ENCLAVE LAYING DOWN & STRAIGHTEN
AND WIRE TO 8 FT STEEL SIGN POST. CORNER
ON THE EDGE OF CEDAR WOODS. MKD NEW
BTS AS FOLLOWS.

CEDAR 22 S 60 W 22.55 FT TO SPK MKD W TO S 17 BT

ASH 1 1/2 S 66° E 19.53 FT TO SPK MKD W TO S 17 BT

ASH 9" N 40° E 33.20 FT TO SPK MKD W TO S 8 BT

8 FT STEEL SIGN POST 4.15 FT SOUTH

M.C. Secs. 8-17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

	T141 N
MC	SB
	S17
	R29W

1918


Cedar 20" N6 $\frac{1}{2}$ ° E 43 1/2 - 28.38'

Cedar 18" S27°45'E 49 1/2 - 32.34'

M.C Secs 8-17 (shore of Haynes h. bears NE & SW)

G.L.O. Resurvey notes of 1918

Iron post 3 long 1" diam. with brass cap marked

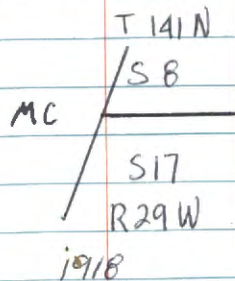

Cedar 10" Bears East 15 1/2 - 9.90'

Cedar 8" S 21° 15' E 8 1/2 - 5.28'

M.C. Secs. 8-17

G.I.O. Resurvey notes of 1918

Iron post 3' long 1" diam. With brass cap marked

T141N

SB

MC

S17

R 29W

1918

Ash 8" N25°30'E 39 IKS - 22.44'

Ash 12" S81°W 29 IKS - 19.14'

West 1/16 Cor. Secs. 7-18

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S7

W 1/16

S18

1918

R. Dak 18" S87° 15' W 117 1/2 - 77.22'

W. Dak 7" N80° W 145 1/2 - 95.70'

S.M.C. on the centerline Sec. 17 (shore of Pine L. bears E+W)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

C
S17 | S17
/ C
SMC
1918


Tamarack 4" N32°E 50 IKS- 33.00'

Tamarack 10" N24°W 122 IKS- 80.52'

S.M.C. on the Center line Sec. 17 (Shore of Pine L. bears N45)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

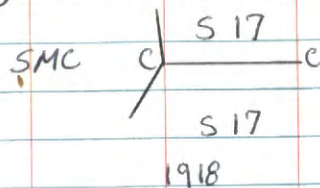

Poplar 12" N38°30'E 237 1KS - 156.42'

Poplar 8" N7°W 146 1KS - 96.36'

S.M.C. on the center line Sec. 17 (Shore of Pineh. bears NE $\frac{1}{2}$ Sec.)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 17
 C ————— C SMC
 S 17
 1918


Maple 10" S 89° W 64 KS - 42.24'

Maple 10" N 6° W 55 KS - 36.30'

SMC on the South 1/16 line Sec. 17 (share of Pine L. bears NW & SE)

G.L.V. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

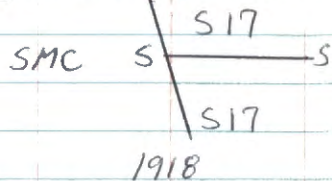


W. Oak 14" N80°30'E 100 lks - 66.00'

W. Oak 14" N42°15'W 84 lks - 55.44'

SMC on the West 1/16 line Sec. 17 (shore of Pine I. bears NE & SW)

G.L.O. Resurvey notes of 1918

Iron post 3 long 1" diam. with brass cap marked

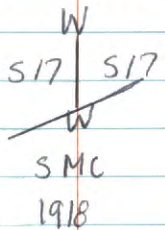

Pine 14" N45°30'E 109 1K5 - 71.94'

W. Oak 18" S70°W 140 1K5 - 92.46'

S.M.C. on the center line Sec. 18

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

6-12-81 CK-GB

SMC

CHAINED SOUTH FROM C^{1/4}

C

967' TO LOCATION OF THIS S18

S18

IRON AND FOUND IRON LYING

C

ON GROUND ON EAST SIDE

1918

OF N+S WOODS TRAIL - PROBABLY BLADED OUT

W. Oak 12" S42°45'E 40 KS - 26.40'

W. Oak 14" S49°30'W 121 KS - 79.86'


NO TIME TO SEARCH FOR BT's. AT THIS TIME

TOOK IRON BACK TO S.O. - WILL TRY TO SET LATER

S.M.C. on the center line Sec 18

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

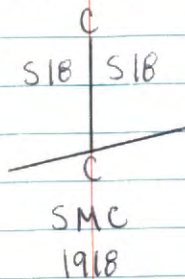

Poplar 8" N37°15'E 40 KS- 26.40'

Poplar 8" N27°W 55 KS- 36.30'

Center North 1/16 Cor. Sec. 18

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

C
 N 1/16 | S 18
 C
 1918

R. Oak 18" S67°E 98 1/2 - 64.68'

W. Oak 24" S85°W 225 1/2 - 148.50'


SEE BOOK #8 PAGE 14

CORNER REMONUMENTED 6/21/81 CK

S.M.C. on the Center line Sec. 18

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

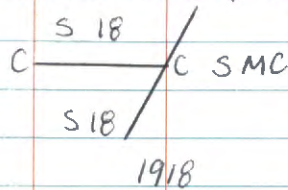

Poplar 8" S55°30'W 57 1KS- 37.62'

Poplar 8" N9°W 56 1KS- 36.96'

South East 1/16 Cor. Sec. 18

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SE 1/16 S 18

1918


Poplar 10" S4°45'E 39 IKS - 25.74'

Poplar 10" N19°W 47 IKS - 31.02'

S. M. C. on the E. 1/16 line Sec. 18 (shore of Pine L. bears NW 1/4 Sec.)

G. L. O. Resurvey notes of 1918

Iron post 3 long 1" diam. with brass cap marked

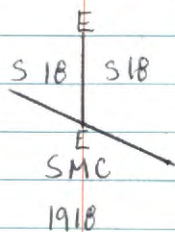


Birch 12" N70°E 261 KS - 172.26'

Poplar 8" N60°30'W 186 KS - 122.76'

S.M.C. on the S. 1/16 line Sec. 18 (shore of Pine L. bears N4S)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

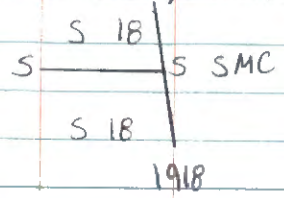


Birch 12" S18°45'W 46 1KS- 30.36'

Poplar 10" N64°30'W 39 1KS- 25.74'

S.M.C. on the North 1/16 line Sec. 18

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

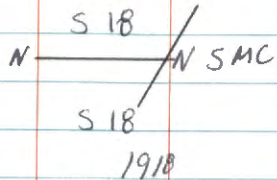

Poplar 4" N62°45'E 61 1K5- 40.26'

Poplar 7" S22°W 52 1K3- 34.32'

M.C. Secs. 7-8

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam with brass cap marked

M C	
57	58
T141N	R29W
1918	

Tamarack 8" S3°E 53 KS- 34.98'

Tamarack 8" S36°W 21 KS- 13.86'

M.C. Secs. 7-8

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T 141 N	R 29 W
---------	--------

S 7	S 8
-----	-----

M C

1918

Poplar 18" N40°45'E 145 1K5- 95.70'

W. Oak 12" N18°30'W 134 1K5- 88.44'

Sec. Cor. Secs. 5-6-7-8

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T. 191 N R. 29 W

S 6 S 5

S 7 S 8

1918

R. Oak 16" N49°15'E 70 KS- 46.20'

R. Oak 8" S25°E 57 KS- 37.62'

R. Oak 8" S51°15'W 21 KS- 13.86'

R. Oak 16" N17°45'W 71 KS- 46.86'

Angle Point 3 of Allotment 1478, Angle Point 4 of
Allotment 1482 and a point on the North bdy. of
Allotment 1624, Secs. 5-B

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 5

TR	TR
1482	1478
AP 4	AP 3

TR 1624

S 8

1918

M.C. Secs. 5-8 (shore of Leech L. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T 141 N

SS

S 8

R 29 W

1918

R. Oak 12" S 2° E 70 KS - 46.20'

W. Oak 8" N 51° W 21 KS - 13.86'

East 1/16 Col. Secs. 6-7

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 6'

E 1/16

S 7'

1918

Oak 18" S69°30'E 48 IKS - 31.68'
WOAK 21" @ BRG AND DIST

Maple 8" N68°30'W 60 IKS - 39.60'
NO EVIDENCE

10-18-01 R. MAIN

FD IRON IN PLACE UP 1 FT. CORNER IN MATURE
MIXED HARDWOODS 300 FT SOUTH OF HWY 200.
PUT "T" POST 1 FT SOUTH WEST OF IRON
WITNESS WITH ?

GLO WOAK 21" S70°E 32.25 FT TO SPK OLD BLAZE
VISIBLE

WOAK 13½" N13°E 46.65 FT TO SPK MKD S6 BT

Quarter Cor. Secs. 6-7

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

$\frac{1}{4}$ 56

57
 1918

Poplar 6" S58°45'E 118 IKS - 77.88'

Poplar 14" N49°45'W 141 IKS - 93.06'

10-18-01 R MAIN

SEARCH FOR CORNER USING DIST DIST INTERSECTION
 FROM AP 3 AND SEC COR $\frac{116}{127}$. FIND RAIL ROAD SPIKE
 NEAR MY SEARCH LOCAL. SPIKE HAS RIBBON.
 ORIGIN OF SPIKE UNKNOWN @ THIS TIME. NO
 EVIDENCE OF GLO ASPEN FROM RR SPIKE.

TEMP TIES TO RR SPIKE W. OAK 7" N58E 55.20 FT
 W. OAK 8" S3°W 75.83 FT TO SPIKE. RR SPIKE ON
 WEST SHOULDER OF TRACK, ± 50 FT SOUTH OF OH GATE.

West 1/16 Cor. Secs. 6-7

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

56

W 1/16

57

1918

R. Oak 15" S32°E 76 KS - 50.16'

R. Oak 16" N62°W 31 KS - 20.46'


10-22-01 R. MAIN

FALLS IN HWY 200 NO EVIDENCE

S.M.C. on the center line of Sec. 8 (shore of Rath. bears SW + NE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

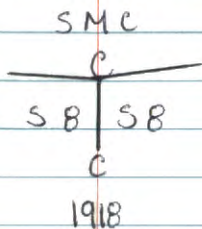


Spruce 8" S1°45'E 29 KS - 19.14'

Spruce 14" S23°15'W 72 KS - 47.52'

S.M.C. on the center line Sec. 8 (shore of island bears E & W)

G.L.D. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

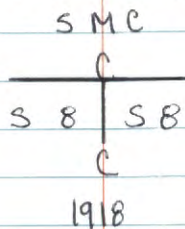


Spruce 8" S46°E 58 KS- 38.28'

Ash 16" S47°W 35 KS- 23.10'

S.M.C. on the center line Sec. 8 (shore of lake bears NE + SW)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

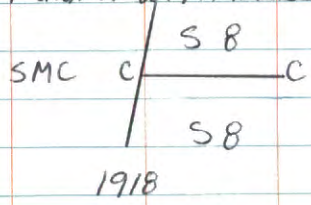


Cedar 12" S46°E 37 1/2 - 24.42'

Cedar 12" N68°30'E 47 1/2 - 31.02'

S.M.C. on the East 1/16 line Sec. 8 (Shore of
Leech l. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

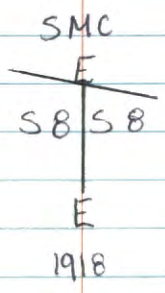


Maple 6" S28°30'E 63 1K5- 41.58'

Maple 7" S26°W 57 1K5- 37.62'

S.M.C. on the North 1/16 line Sec. 8

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

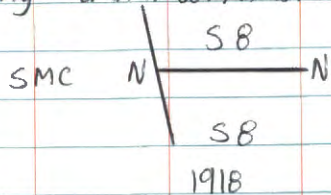

Maple 12" N88°45'E 89 KS - 58.74'

W. Oak 30" S30°E 36 KS - 23.76'

S.M.C. on the West 1/16 line Sec. 8 (Shore
of island bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

SMC
W
SB | SB
W
1918

Tamarack 20" S1°30'E 21 KS - 13.86'

Spruce 18" S37°W 46 KS - 30.36'

Angle Point 3 of Allotment 1383, Sec. 7

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

TR
1383
AP 5

S 7

1918

10-17-01 R. MAIN

FD IRON IN PLACE UP 105 FT LEANING SOUTHEAST
CORNER IN MIXED HARDWOODS ON STEEP SLOPE
FACING SOUTHEAST. CORNER @ MIDSLOPE. SWAMP
SOUTHEAST OF IRON ± 75' TOP OF RIDGE ± 75'
NORTH WEST MARK NEW BTS. BT DISTANCE TO
PROJECTED BASE OF MONUMENT.


W OAK 9" N68°W 24.85 FT TO SPR MKD S 7 BT

W OAK 14" N35°E 29.25 FT TO SPR MKD S 7 BT

S.M.C. on the center line Sec. 7 (shore of
Rat L. bears N 45)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

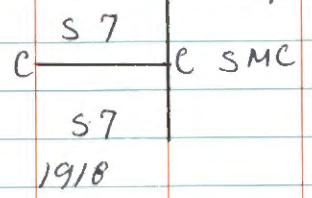

Ash 7" bears South 175 KS - 115.50'

Poplar 18" N 79° W 355 KS - 234.30'

Center West 1/16 line Sec. 7

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

W 1/16
C ——— C

S7

1918

			80 LKS	52.80'
W. Oak	6"	N87°30' E	84 LKS	52.80'
W OAK	16"	N88° E	52.80'	52.80'

R. Oak 14" N68°30' W 153 LKS - 100.98'
LARGE DEPRESSION NOTHING CONCLUSIVE

10-22-01 R. MAIN

Fd GLO UP 3" ON NORTH SIDE OLD TRAIL.
CORNER IN MIXED HARD WOODS, GRASS SLOUGH EAST
SOUTHEAST OF CORNER 100 FT. HEAVY STEEL
SIGN POST 0.4 FT SOUTH OF CORNER. WITNESS
WITH:

GLO W. OAK 16" N89E 52.74 FT TO SPK. OLD SCAR


W OAK 10" S32 E 48.12 FT TO SPK MKD 57 BT

10-23-01 R MAIN RELOOKED @ GLO NOTES, DIST TO W OAK
IS 80 LKS NOT 89 LKS

S.M.C. on the East 1/16 line Sec. 7 (shore
of Rat I. bears E+W)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

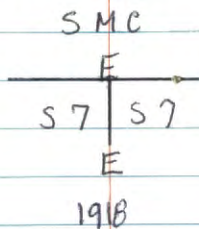

Ash 7" S45°E 90 KS - 59.40'

Maple 6" S39°30'W 74 KS - 48.84'

Angle Point 4 of Allotment 1383, Sec 7

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

TR
1383
AP 4°

S 7

1918

10-30-01 R. MAIN

Fd IRON IN PLACE up 6" 5" MAPLE TREE IS STARTING TO GROW AROUND MONUMENT. CORNER IN MIXED HARDWOODS ON GENTLE WEST FACING SLOPE. WITNESS WITH:

W OAK 12" N46°E 31.63 FT TO SPK MED. S 7 BT

MAPLE 7" N 8 W 22.40 FT TO SPK MED. S 7 BT

CLO FENCE RUNS NORTH AND SOUTH

8 FT STEEL SIGN POSTS 3.2 SOUTH 3.4 NORTH DIST TO CL LINE TO STANDARD NORTH AND SOUTH

South West 1/16 Cor. Sec. 7

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SW 1/16 S7

1918

J. Pine 8" N20°E 135 1/2 - 89.10'

NO EVIDENCE

N. Pine 10 N38°45'E 203 1/2 - 133.98'

NOW 22" @ BRG AND DIST, TAGGED

4-3-03 R. MAIN

Fd IRON IN PLACE UP ± 2 FT. IRON ON
EAST EDGE OF GRASS SLOUGH ± 20 FT.
WEST OF MIXED HARDWOOD POINT. PVT
STEEL "T" POST 6" SOUTHWEST OF IRON.
GPS ED MONUMENT MRK ONE NEW BT.

W OAK 14" S69°E 31.55 FT TO SAK MRK 157 BT

8 FT STEEL SIGN POSTS 3.45 EAST 5.2 WEST DIST
TO E OF POST

North West 1/16 Cor. Sec. 7

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

NW 1/16 S7

1918

Poplar 8" N43°E 62 KS - 40.92'
NOW 23" DIESING ASPEN @ BR6 DIST OLD BLAZE VISIBLE

Oak 14" N11°15'W 51 KS - 33.66'
NO EVIDENCE

10-23-01 R. MATIN

FD IRON IN PLACE UP 8 INCHES. CORNER IN
MIXED HARDWOOD MARK TWO NEW WITNESSES.

R OAK 10" S68°E 31.88 FT SPL MKD. 57 BT

W OAK 8" N57°E 44.67 FT SPL MKD. 57 BT

~~BT STEEL SIGN POSTS EAST 31.88' WEST 44.67'~~
~~DIST TO C. OF POST~~

Angle Point lot Allotment 1211 and ?

?

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

?

AP 1

TR

1211

1918

Meander Cor. Secs. 5-6 (shore of Leach L. bears
W & NE)

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

MC	
S6	S5
T 141N	R 29W
1918	


Birch 8" S17°30'E 43 / KS - 28.38'

Birch 8" S6°W 41 / KS - 27.06'

Center South 1/16 Cora Sec. 5

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

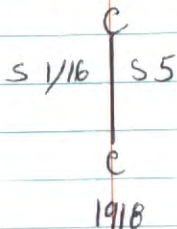

Poplar 12" N63°45'E 161KS- 10.56'

Maple 6" S17°30'E 391KS- 25.74'

Col. Between Allotments 1478 and 1482, Sec. 5

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

TR	TR
1482	1478

S 5

1918

South West 1/16 Cor. Sec. 5

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SW 1/16 S5

1918


R. Oak 22" N20°E 42 KS - 27.72'

Poplar 9" S40°W 18 KS - 11.88'

S.M.C. on the South $1/16$ line Sec. 5 (shore of
Leech L. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

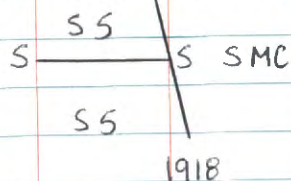


W. Oak 7" $S 8^{\circ} W$ 53 1/2 - 34.98'

W. Oak 16" $N 79^{\circ} W$ 60 1/2 - 39.60'

S.M.C. on the West 1/16 line Sec. 5 (shore of
Leech L. bears NE + SW)

G.L.D. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

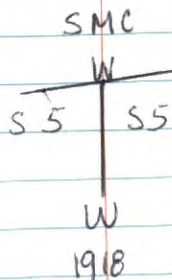

R. Oak 8" S14°30'E 59 1/2 - 38.94'

Maple 6" S46°30'W 57 1/2 - 37.62'

S.M.C. of Allotments 1478 & 1482 Sec. 5 (Share
of Leech L. bears NE & SW)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

SMC

TR | TR

1482 | 1478

55

1918


Cedar 16" S57° 30' E 46 KS - 30.36'

W. Dak 14" S27° W 15 KS - 9.90'

Center South 1/16 Cor. Sec. 6

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

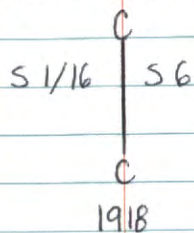


Basswood 8" N26°30'E 32 KS- 21.12'

R. Oak 16" S22°15'E 26 KS- 17.16'

S.M.C. on the center line of Sec. 6 (Shore of
Leech L. bears NW & SE)

G.L.D. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

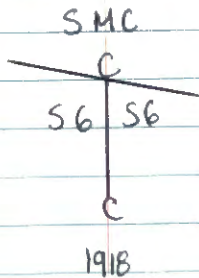

Elm 10" S16°E 46 1/3 - 30.36'

Birch 12" S54°30'W 6 1/3 - 3.96'

Center West 1/16 Cor. Sec. 6

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

W 1/16
C ————— C

S6

1918

Cedar 10" S21°30'W 26 1/2 - 17.16'
NOW A 3' HX STUMP @ BRG & DIST

Cedar 10" N44°15'W 22 1/2 - 14.52'
NOW 24" @ BRG & DISTANCE

2-2-2000 R MAIN

Fd IRON IN PLACE. THE CAP AND 4" OF THE
PIPE ARE BROKEN OFF @ GROUND LEVEL. THE
CORNER IS IN MIXED SALSIM ASH & CEDAR.
CORNER FALLS @ THE END OF HIGH GROUND
COMING FROM THE SOUTH WEST. CEDAR
LOW GROUND NORTH, EAST AND SOUTHEAST OF
CORNER. WITNESS WITH:


GW CEDAR 24" N44W 14.52' TAG ON TREE

CEDAR 10" S36W 33.85 FT TO SPRING S6 BT

S.M.C. on the center line Sec. 6 (Shore of
Leach L. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

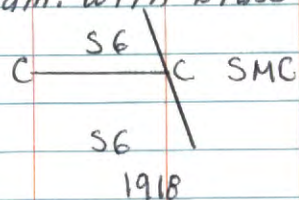


W. Oak 7" S33°15'W 24 1/2 - 15.84'

Birch 14" N80°W 38 1/2 - 25.08'

S.M.C. on the East 1/16 line Sec. 6 (shore of
Leech L. bears NW & E)

G.H.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

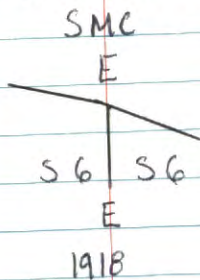


Cedar 6" S1°E 136 1/2 - 89.76'

Cedar 12" S25°30'W 111 1/2 - 73.26'

S.M.C. on the South 1/16 line Sec. 6 (Shore of
Leach L. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

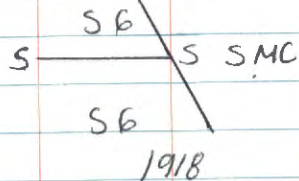

Birch 14" S18°30'E 218 1/5 - 143.88'

Cedar 8" S5°30'W 214 1/5 - 141.24'

South West 1/16 Cor. Sec. 6

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

SW 1/16 S6

1918

Cedar 7" S68°E 9 1/2 KS - 5.94'

NO EVIDENCE (UNDER SNOW)

Cedar 14" N25°30'W 36 1/2 KS - 23.76'

NOW A 3 FT HI STUMP @ BRG & DIST.

1-12-2000 R MAIN.

FD IRON IN PLACE LEANING SOUTH. FIND BARB
WIRE RUNNING NORTH OF CORNER. IRON IN
ASH AND CEDAR. HIGH GROUND WEST AND
SOUTH OF CORNER ± 100 FT.


ASH 7 1/2" S31°E 150 1/2 FT TO SPK MKD S6 BT

CEDAR 5" N65°E 47.10 FT TO SPK MKD S6 BT

S.M.C. on the West 1/16 line Sec 6 (shore of Leech L. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

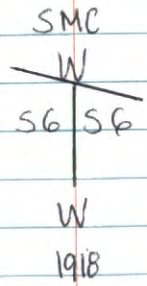


Birch 5" S38°30'E 50 KS- 33.00'

Poplar 12" N73°30'W 48 KS- 31.68'

S.M.C. on the North 1/16 line Sec. 6 (Shore of
Leech L. bears NW & SE)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

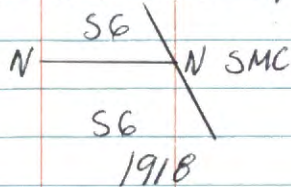

Poplar 8" S31°30'E 154 1/2 - 101.64'

W. Oak 12" N56°15'W 203 1/2 - 133.98'

Angle Point 1 Sec. 24

G. L. V. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T 141 N R 29 W

S 24

API

1918

N. Pine 10" N39°45'E 150 1/2 - 99.00'

W. Oak 16" S38°15'E 131 1/2 - 86.46'

Angle Point 2 Sec. 24

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

T 14 N R 29 W

S 24

AP 2

1918

W. Oak 16" S 58° 30' W 100 KS - 66.00'

Birch 8" N 45° W 32 KS - 21.12'

Angle Point 3 Sec. 24

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

T 141 N R 29 W

~~S 24~~
~~AP3~~
~~1918~~

W. Oak 16" N88°30'W 88 1/5 - 58.08'

W. Oak 16" N53°W 52 1/5 - 34.32'

Angle Point 4 Sec. 24

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

T 141 N
R 29 W
S 24
AP 4
1918

N. Pine 6" S 0° 15' E 243 1/2 - 166.38'

N. Pine 10" N 58° W 184 1/2 - 121.44'

Angle Point 5 Sec. 23

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

T 141 N	R 29 W
---------	--------

S 23	AP 5
------	------

1918

Poplar 8" N36°30'W 27 IKs - 17.82'

Balsam 8" N78°E 215 IKs - 141.90'

Angle Point 4 Sec. 23

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

S 23
T 141 N
R 29 W
AP 4
1918

Balsam 12" N 12° 35' E 88 1/2 - 58.08'

Poplar 8" S 26° E 125 1/2 - 82.50'