

T142N R30W
CORNER RESTORATION

K&K
FIELD BOOK

820012

BOOK 4


T142N R30W

CORNER


#4

T.

P.

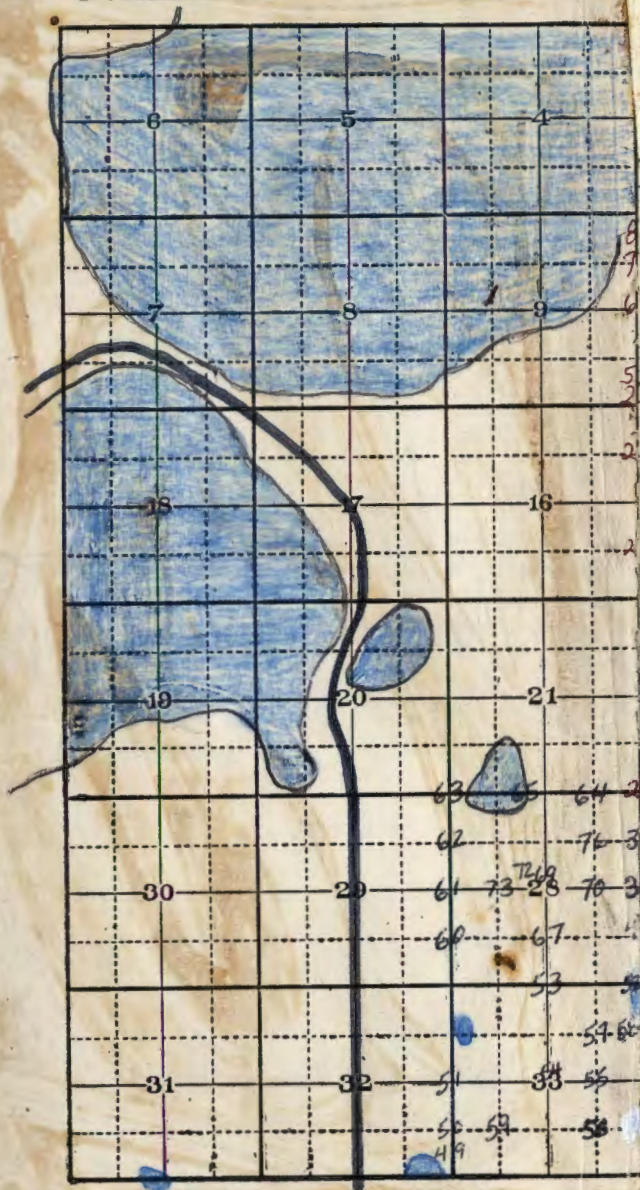

Mos.

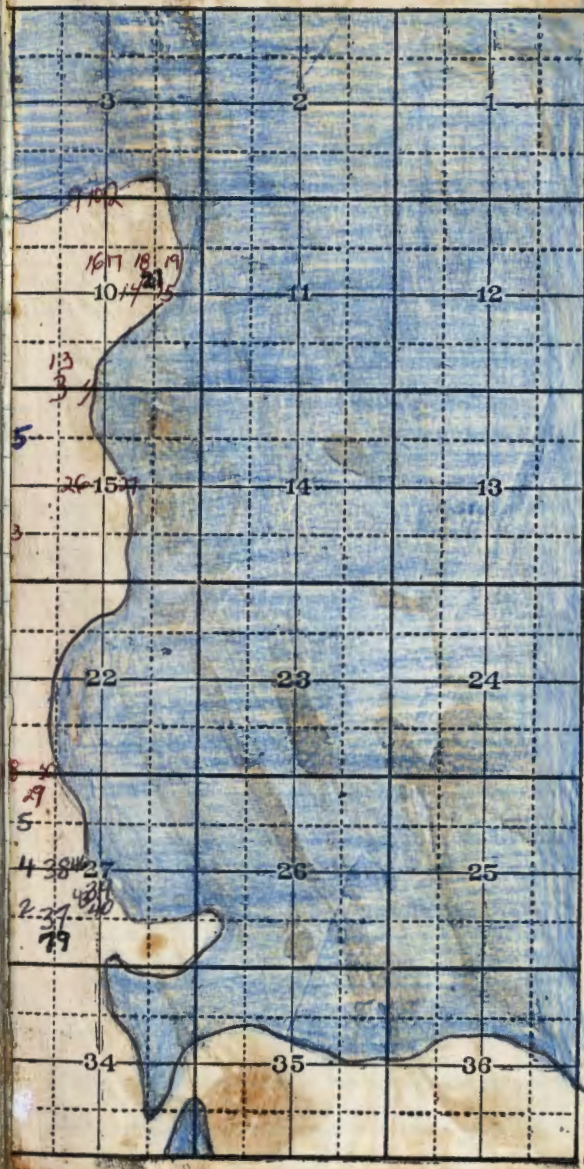

Tree Map

S.M.C. of Allotments 1605 and 1733 Sec. 9

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S.M.C.

| | |
|------|------|
| TR | TR |
| 1733 | 1605 |
| S 9 | S 9 |
| 1918 | |

J-13

J-13

Sec. Col. Secs. 9-10-15-16

G.L.O. Resurvey notes of 1918

Iron post 3' long 2" diam. with brass cap marked

Found cap & iron in place T142N R30W

26" above ground, in good S9 | S 10

condition. I toward S16 | S 15

Iron 12" in ground. 1918

W. Oak 6" S73½°W 105 | KS - 69.30'

Now a 9" Oak at brg. 9' dist. Rescribed S16 Bt.

Maple 8" N72°W 121 | KS - 79.86'

Now a 10" Maple at brg. 6' dist. Hollow and rotten

W. Oak 7" S31¼°E 243 | KS - 160.38'

Now a 16" Oak at brg. 6' dist. Rescribed S15 Bt.

To perpetuate this corner I scribed (1)
one new bearing tree in section 9 as
the Maple is hollow and rotten.

15" Elm N65°W 71.0 ft. scribed S9 Bt.

72" steel sign post due South 2.0' with F.S.
signs 54-2 & 54-4 attached.

No tree suitable for witness in section 10

9-21-70

Curtis R. Krause

AFF. idav. T
3/15/71
1293 East to W/O

Also found original post 9½ ft long
lying on ground by G.L.O. brass cap.

J-14

J-14

West 1/16 Cor. Secs. 10-15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

W 1/16 S10

S15

1918

Ash 7" N38°W 29.1KS - 19.14'

Now a 19" Ash at brg. & dist. scribe overgrown

Elm 7" S55 1/2°W 6.1KS - 3.96'

Found a rotten slip at brg. & dist.

To perpetuate this corner I
reset monument 12" above ground
and scribed 3 new bearing trees.

17" Elm N75°W 59.0 ft. scribed W 1/16 S10 bt.

11" Ash N6°W 47.9 ft. scribed W 1/16 S10 bt.

13" Ash N84°E 47.5 ft. scribed W 1/16 S10 bt.

72" steel sign post due North 1.9' with

F.S. signs 54-2 & 54-4 attached.

9-23-70

Anteo R. Kramer

Affidavit 3/15/71 JRB

115.5' to WC. sec.

3

this iron had been pulled out and
thrown off to the side, both flanges
were straightened out. We found one
remaining bearing tree, so we replaced
iron by bearing and distance, in its
former location.

I reset iron 12" above ground. Also
due to chopping on G.L.O. Ash, to
identify as bt., this tree may die
so we took three other bt's.

9-22-70

J-14, 15

Witness Cor. to the true position for the Meander Cor. Secs

10-15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T142 N R30 W

No monument found S10/WC

S15/MC

1918

Ash 10" S30 1/4° W 60 lks - 39.60'

No evidence of Ash falls in push out

Elm 8" N68 1/4° W 39 lks - 25.74'

Now a 22" Elm at brg 1/2 dist. scribe overgrown

to perpetuate this corner I set a 3" dia. 5' long galvanized steel pipe filled with concrete and capped with a 3" dia. brass tablet stamped.

T142 N R30 W

S10/WC

S15/MC

1970

RLS NO 6807

Witnessed by.

13" Ash N12° W 40.7 ft. scribed WC MC S10 RB

12" Elm N43° E 16.5 ft. scribed WC MC S10 RB

5" Elm S61° E 11.0 ft. scribed WC MC S15 RB

72" steel sign post due West 2.4' with F.S.

signs 54-2 & 54-4 attached

9-23-70

Chris R. Krause

Affidavit

3/19/71

CRB

4

Chained to this location from the West 1/6 115.5'. no evidence of Iron monument in area. Cut into large Elm at brg 1/2 dist recorded in field notes and found scribing inside of tree. Ash bearing tree has been taken out with a cat as there is a push out trail going NW.

9-22-70

H, J-13

Angle Point 2 of Allotment 1305, Secs. 9-10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

59 | S10

Found iron cap in place

16" above ground in good
condition

AP2

TR

1305

1918

To perpetuate this corner I scribed
(3) new bearing trees as follows.

8" Oak N85°E 47.1 ft. scribed AP2 S10 Bt.

24" Oak N52°E 56.8 ft. scribed AP2 S10 Bt.

12" Hard Maple N68°W 81.6 ft. scribed AP2 S9 Bt.

72" steel sign post due East 2.0' with FS.

Signs 54-2 & 54-4 Attached.

9-21-70

Curtis R. Krause

Affidavit
3/15/77
UB

Y4 Cor. Secs. 9-10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

$\frac{1}{4}$
S9 | S10
1918

Pits, 18 x 18 x 12", N. & S. of Cor., 5' dist.

F-13

F-13

North 1/16 Cor. Secs 9-10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found iron cap N 1/16

in place in good 59 | 310

condition 12" above ground.

1918

Pits 18x18x12", N. and S. of Cor. 5' dist.

Found pits North & South 5' dist.

72" steel sign post due West 3.3' with F.S.
signs 59-2 & 59-4 attached.

Also drove steel sign post beside iron
3' deep and wired iron to post. with FS-59-4.

2-12-09R. MAIN J SCAONOVER

FD IRON IN PLACE AND GPS. SIGN POST WEST
FALLN OVER FROZEN. IRON UNDER ICE.

Affidavit
3/15/77

7

Handwritten note: 3/18/70 CAB

E, F-13
 Meander Cor. Secs. 9-10
 G.L.O. Resurvey notes of 1918
 Iron post 3' long 1" diam. with brass cap
 marked Iron & cap T142N R30W
 Found in place, in good MC /
 condition 18" above grd. 59 | 510
 1918

2-11-09
 FN IRON LEANING OVER FROZEN IN SWAMP
 30 FT FROM WOODS TO THE EAST ± 350'
 SOUTH OF LAKE EDGE.
 1970 ASH 15" S66E 32.5 FT NOW TAGGED.
 GPS IRON SIGN POST SOUTH LAYING DOWN

Elm 4" S78½°E 92.1KS- 60.72'
 Now a 13" living Elm growing lying with trunk on grd.
 Basswood 4" S2½°W 91.1KS- 60.06'

No evidence found.
 To perpetuate this corner I scribed
 (2) two new bearing trees as follows.

7" Ash S14°E 32.0ft. scribed MC 510 Bt.
 8" Ash S66°E 32.5ft. scribed MC 510 Bt.

72" steel sign post due South 2.9' with
 F.S. signs. 54-2 & 54-9 attached.
 9-29-70
 Curtis R. Krause

Meander Cor. of Trac. S'ecs. 3-10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

T142 N R30W

Mc / S 3

/ S 10

1918

Raise a mound of Stone, 3' base, 2' high E.
of cor.

Angle Point 2 of Allotment 1238 Secs 3-10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 3

AP2

TR

1238

S 10

1918

Reestablished Original Meander Cor. Secs. 3-10

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

T142N R30W

S3 / MC

S10 \

1920

Ash 8" S28 $\frac{1}{4}$ °W 20 IKS - 13.20'

Ash 4" N40 $\frac{3}{4}$ °W 31 IKS - 20.46'

Quarter Cor. S. sec. 3-10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

$$\begin{array}{r} + \quad 53 \\ \hline 4 \quad 510 \end{array}$$

1918

Maple 5" S35°W 37 1/2 - 24.42'

Elm 5" N29½°W 23 1/2 - 15.18'

H, J-14

Angle Point 1 of Allotment 1305, Sec. 10

B.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam with brass cap marked

Found iron cap

API

in place 3' above

TR

grass in good condition 1305

Placed steel sign post 1918

beside monument and wired iron to post.

72" steel sign post due West 2.4' with

F.S. signs 54-2 & 54-4 attached.

72" steel sign post due South 1.9' with

F.S. sign 54-2 attached.

9-23-70

Arthur R. Krause

Affidavit
3/15/71
CRB

C-^{14, 15}~~14, 15~~

Angle Point 3 of Allotment 1340, Sec. 10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

| | |
|---------------------|------|
| Not found, in high | TR |
| grass and brush, in | 1340 |
| marsh | AP3 |

9-24-70

1918

Carl Krause


G-15, 16

Special Meander Cor. Sec. 10 (W. Shore Leech L.)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found Iron & cap in place S10

with top of monument  C SMC

bent flush with ground. S10

1918

Elm 10" N47¹/₂°W 32 1ks - 21.12'

Now a 22" Elm at brg. † dist. scribe overgrown.

Basswood 14" S37¹/₂°W 18 1ks - 11.88'

Now a 20" Basswood at brg. † dist. scribe overgrown.

Angle Point 3 of Allotment 1238, Sec. 10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found Iron & cap

in good condition

10" above ground

| |
|------|
| TR |
| 1238 |
| AP 3 |

1918

Check page 18 of this book for reason
not fixed up.

5-30-06 R. MAIN

FD IRON IN PLACE AND GPS. THE MONUMENT
ON Pg 17 APPEARS TO BE OUT OF POSITION.

Angle Point 2 of Allotment 1340 Sec. 10

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found Iron & cap TR 1238

in good condition AP 2

10" above ground 9-24-70 TR

Ant. Kramer 1340

1918

Check on page #18 of this Book for
explanation, why not fixed up.

5-30-06 R. MAIN

GPSE0 THIS IRON^o APPEARS TO BE OUT OF
POSITION^o

Angle Point 1, Allotment 1340 and Angle Point 4 of
Allotment 1238, Sec. 10

G.L.O. Resurvey notes of 1921

Iron post 3' long 1" diam. with brass cap
marked AP4 S10

Found iron cap (in TR 1238

place) in marsh grass API
in good condition. TR

9-29-70

1340

Carl Kramer 1921

Distance Between G.L.O. irons didn't check
with these field notes.

5-30-06 ROMAINE

FD IRON IN PLACE APPEARS TO BE IN
POSITION IN RELATION TO SMC ON THE
N¹/₆ LINE ON PAGE 190 GPS IRON 0

$$\begin{array}{r} 58.06 \\ 45.32 \\ \hline 12.74 = 840.84 \end{array}$$

840.84'

BET SMC AND AP4+AP1

681.12'

BET AP4+AP-1 AND AP2

AP3 330' AP2 681.12'

AP4 840.84

N SMC

API WEST BRG.

F-16, 15

Special Meander Cor. Sec. 10 (W. shore Leach L.)

G. L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found in place N S10 / N SMC

10" above ground S10

1918

Basswood 4" N85°W 55 IKS - 36.30'

Now a 16" Basswood at brg. dist. scribe overgrown

Ash 4" S13 1/4°W 30 IKS - 19.80'

Falls in cleared area lake shore cabin

9-29-70

Curt Krause

5/15/97 CK

Fd. IRON + CAP - IN PLACE - IN ROCK MOUND

GLO BASSWOOD IS NOW 18.5" AT N85W

36.30' SCAR FACING IRON

INFORMATION ON BT TAGS

4/29/81 CK + GB - B.O.

MKD NEW TIES

BASSWOOD 18.5" S15W 36.8' SCAR NOW

ASH 10 N24W 38.67' SCAR NOW

8' STEEL SIGN POST EAST 2.15' w/54-9

West 890.551 to 10201 10/19

NE SUMMER HOME LOT IRON IS

S45W 31'± FROM GLO IRON

LOT IRON HAS BEEN BROKEN OFF, BUT

CONCRETE AND BASE OF IRON ARE IN PLACE.

ALSO Fd. NW LOT CORNER BROKEN OFF

FISH CLEANING HOUSE IS FULLY ON F.S. LAND

OWNER WAS PRESENT WHEN COR'S WERE Fd.

5-30-06 R MAIN.

GPS IRON. CORNER IS ± 75 FT SOUTH OF SOUTH

SHOULDER BOAT RAMP LOOP FOR STONY PT

CAMPGROUND AND ± 50 FT WEST OF LAKE EDGE.

FISH CLEANING STRUCTURE IS GONE.

Angle Point 1 of Section 10

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

AP
|
T142N
R30W
S10

1920

Elm 10" N16³/₄°E 55 IKS - 36.30'


Elm 22" S84³/₄°W 40 IKS - 26.40'

SEE BOOK # 1 PAGE 1

Angle Point 2, Sec. 10

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

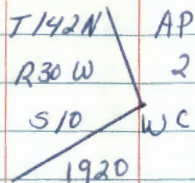


Elm 14" N33½°W 27 IKS - 17.82'

Maple 7" N5½°E 43 IKS - 28.38'

Witness Cor. to the true position for Angle Point 1, Sec. 3

G. L. O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

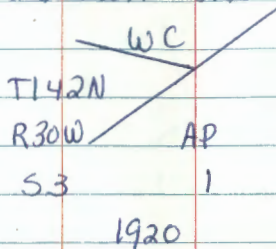

Ash 6" S62½°W 26 1KS - 17.16'

Poplar 8" N62½°W 64 1KS - 42.24'

South 1/16 Secs. 15-16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 1/16
 S 16 | S 15
 1918

Poplar 10" S 63 1/2° W 76 1X3 - 50.16'

Fd. no evidence

Ash 7" N 77° W 136 1X5 - 89.76'

Fd. a 9" ash at bring dist. Believe this tree came from
 Fern 458 on 5" Ash S 53° W - 48.44 FT ^{stp. of BT}

10/31/85 - CK-GB-JA "Happy Halloween"

Fd iron pipe with brass cap leaning eastly with
 flanges in place. Stood iron up and set B.C. to
 7" above swamp. Place 1 1/2" elm post along side iron.

Mkd. New BT's:



| | | | | | |
|--------|-----|---------|------|---------------|-----|
| W. Oak | 10" | N 70° W | 90.1 | 5 1/6 S 16 BT | 500 |
| Ash | 6" | S 1° W | 42.2 | 5 1/6 S 16 BT | 500 |
| Ash | 6" | S 45° W | 31.1 | 5 1/6 S 16 BT | 500 |

CC Done 10/85

Corner falls approx. 35' east from high ground.

Fd. old P.S.L.P. on 10" Ash S 53° W 48.44'

New clear cut to the SW from this corner.

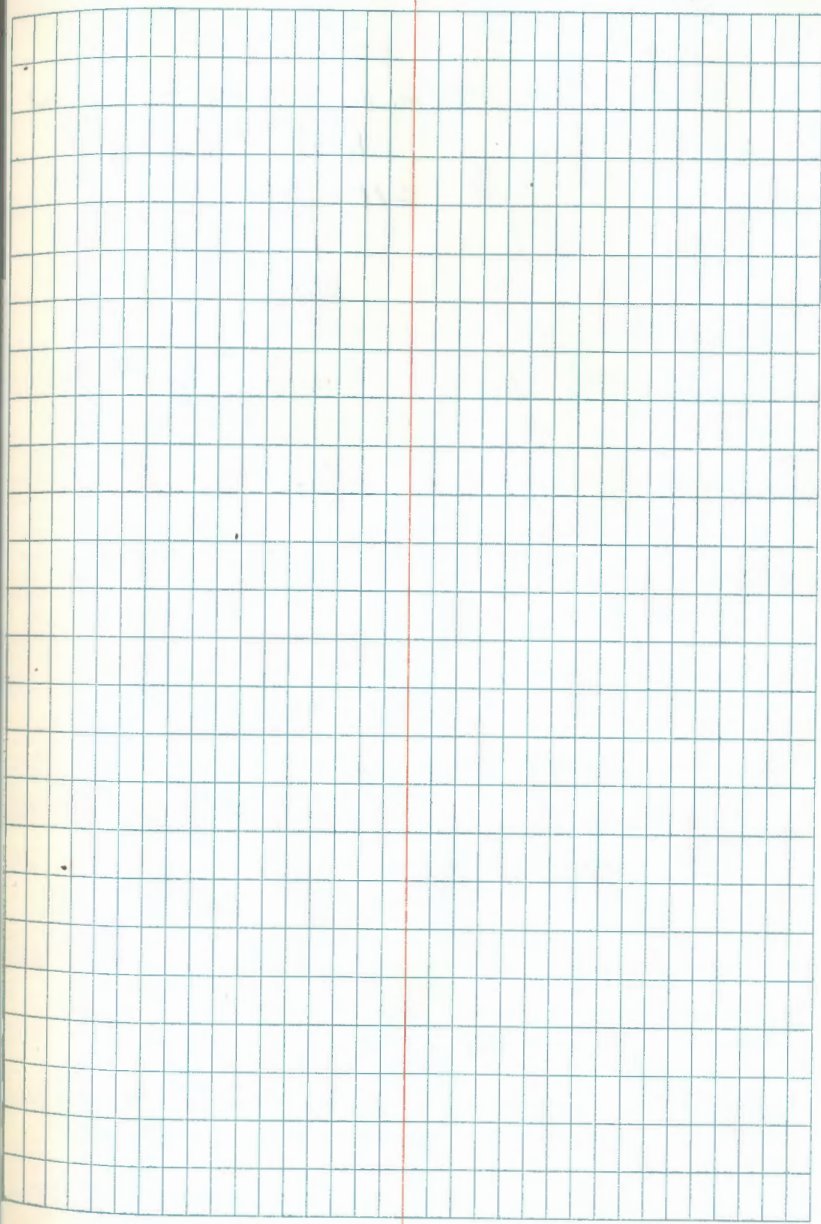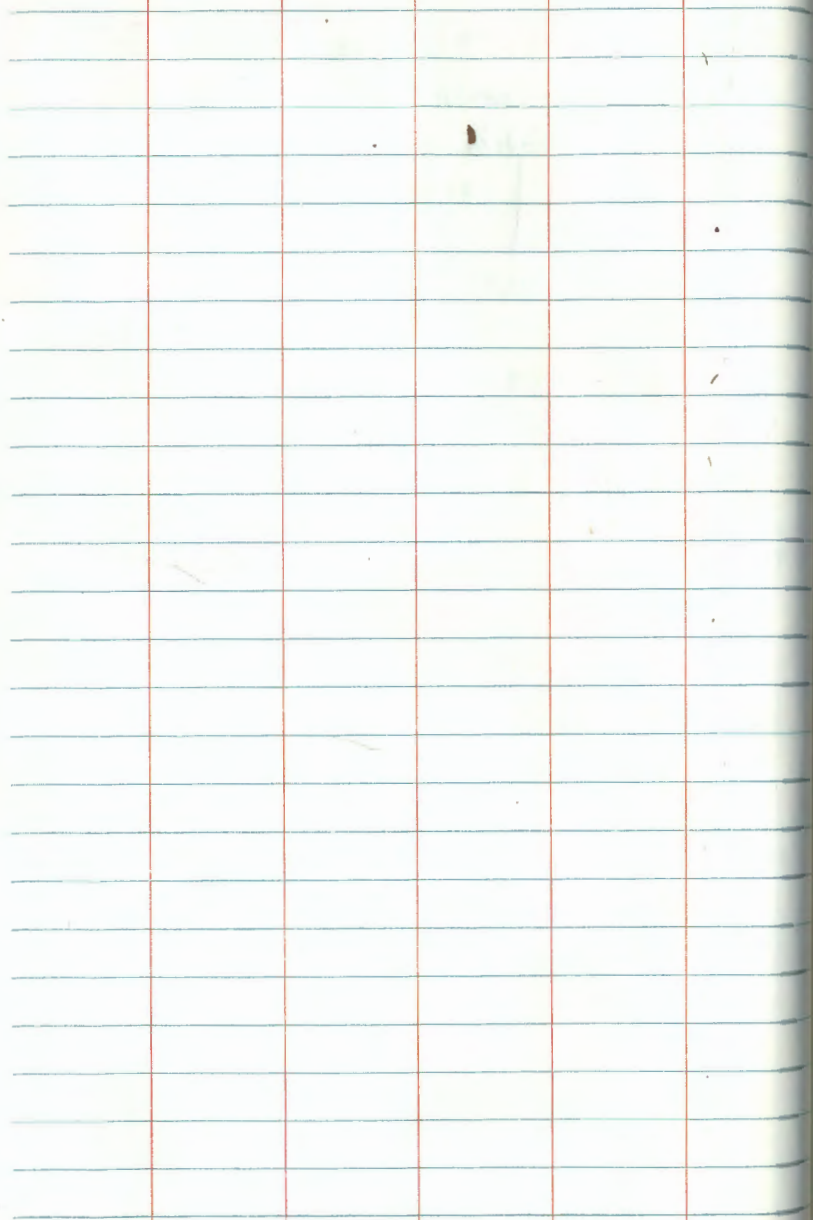

K-13

North 1/16 Secs. 15-16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam with brass cap marked

Found iron & cap 12" N 1/16

above ground in good S16 | S15
condition

1918

Basswood 7" N15°E 51 1/2 - 33.66'

Found rotted log & stp. at big & dist.

Poplar 10" N54 3/4°W 82 1/2 - 54.12'

Found rotted stp. at big & dist.

To perpetuate this corner I scribed (3)

Three new bearing trees as follows:

9" Oak N 8°E 44.4 ft. scribed N 1/16 S15 E

12" Oak N 47°W 52.6 ft. scribed N 1/16 S16 E

9" Oak N 74°W 40.7 ft. scribed N 1/16 S16 E

72" steel sign post due South 22' with F.S.
signs 54-2 & 54-4 attached.

9-21-70

Curtis R. Kramm

FSLP on 5" Oak 275' East of cor. West side of road

K-13

Mt. David
3/19/71 CAPS
1310.0 North of 1/4 Cor.

25

L-13, 14

Witness Cor. to the true point for special meander

Cor. Sec. 15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T142N R30W

S15

C

S15

1918

WC
C SMC

Poplar 8" S61°W 10 1/2 - 6.60'

Poplar 7" N76°W 11 1/2 - 7.26'

Chained to this area from the 1/4 Cor
To the West, We found no evidence of
iron or Bts. Chaining fell at top
of slope and marsh begins.

9-18-70

Curt Krause

Special Meander Cot Sec. 15

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

N — 515 \ N 515
515

1918

Oak 4" $57\frac{3}{4}^{\circ}$ W 22 1/2 - 14.52'

Oak 5" $NR\frac{3}{4}^{\circ}$ W 35 1/2 - 23.10'

Sec. Cor. Secs. 21-22-27-28

G. L. O. Resurvey notes of 1918

Iron post 3' long 2" diam. with brass cap marked

T14N R30W

S21 | S22

S28 | S27

1918

Pits 18x18x12", in each Sec. 5' 1/2' dist

Form 458 on 3" Cedar post at corner
ASPE N?

Reestablishment of the original meander cor. Sec. 22-

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T142N R30W

S22

MC

S27

1918

Oak 6" N12°E 44 1/5 - 29.04'

Ash 4" S20 1/4°W 41 1/3 - 27.06'

R-14, 15

Meander Cor. Secs. 22-27 (W. Shore Leech L.)

G.L.O. Resurvey notes of 1918

Iron post 3/4 long 1" diam. with brass cap marked

T142N R30W

S22 | MC

S27 |

1918

Poplar 6" S80°W 51 1/2' - 33.66'

Poplar 6" N87 1/2°W 12 1/2' - 7.92'

5680-11 by Touch 7/17/68

Angle Point 1, Sec. 22

G.L.O. Resurvey notes of 1921

Iron post 3/4 long 1" diam. with brass cap marked

T142N | AP

R30W | 1

S22

1921

Elm 7" S70°W 32 KS - 21.12'

Oak 16" N49½°E 28 KS - 18.48'

Angle Point 2, Sec. 22

G.L.O. Resurvey notes of 1921

Iron post 3' long 1" diam. with brass cap marked

T142N
R30W
S22 AP 2
1921

Poplar 12" West 21KS - 1.32'

Ash 5" S37 $\frac{1}{4}$ °E 26 KS - 17.16'

Witness Cor. to the true point for Angle Point 3, Sec. 22

G.L.O. Resurvey notes of 1921

Iron post 3' long 1" diam. with brass cap marked

T142N

R30W

WC

S22

AP3

1921


Maple 6" N49°W 7 IK5 - 4.62'

Oak 6" S22°W 18 IK5 - 11.88'

Quarter Cor. Secs. 27-28

G.L.O. Resurvey notes of 1918

Iron post 3 long 1" diam. with brass cap marked

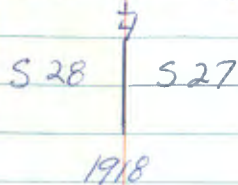

Poplar 8" 559 $\frac{1}{2}$ ^oE 46 1/2 - 30.36'

Poplar 10" 50^o45'W 14 1/2 - 9.24'

North 1/16 Cor. Secs. 27-28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

N 1/16

S 28 S 27

1918

Tamarack 5" S 76 $\frac{1}{4}$ ° E 26 1/2 - 17.16'

Tamarack 6" S 21 $\frac{3}{4}$ ° W 33 1/2 - 21.78'

Angle Point 6 of Allotment 1567 and Angle
Point 1 of Allotment 1283 Sec. 27 .
G.L.O. Resurvey notes of 1918

AP 6

TR

1567

TR

AP 1

1324

TR

1283

1918

Southwest 1/16 Cor. Sec. 27

G.L.O. Resurvey notes at 1918

Iron post 3' long 1" diam. with brass cap marks

SW 1/16 S 27

1918

Tamarack 8" S30 $\frac{3}{4}$ °E 81 1/2 - 53.46'

Tamarack 6" S20 $\frac{1}{2}$ °W 40 1/2 - 26.40'

Centerwest 1/16 Cor. Sec. 27

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

W 1/16
←—————→ C


S27

1918

Maple 10" N78 $\frac{1}{2}$ °E 36 lks - 23.76'

Basswood 28" S44 $\frac{1}{2}$ °E 52 lks - 34.32'

Witness Cor. to the true point for the
 Special Meander Cor. Sec. 27
 G.L.O. Resurvey notes of 1918
 Iron post 3' long 1" diam. with brass cap marked

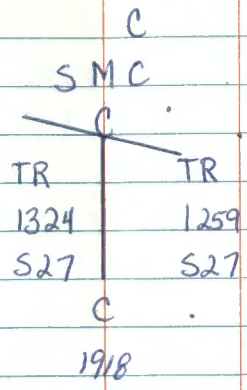


Mound of stone 3' base 2' high South of Cor.

Witness Cor. to the true point for the
Special Meander Cor. Sec. 27

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

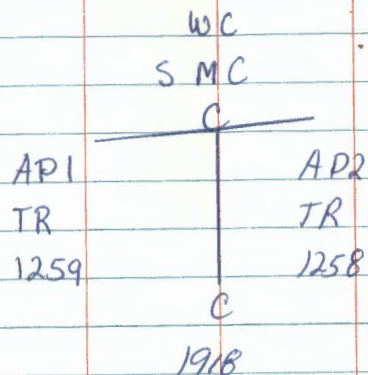

Angle Point 3 of Allotment 1567 Sec. 27

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked.

AP3

TR 1567

1918

Witness Cor. to the true point for the
South 1/16 Cor of Secs. 27-28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. With brass cap marked


| | |
|--------|---------|
| | S27 |
| S28 WC | |
| S1/16 | A94 |
| | TR 1567 |
| | 1918 |

Tamarack 5" S88°E 19 IKS - 12.54'

Cedar 3" N54½°E 30 IKS - 19.80'

Special Meander Cor. on South ~~1/4~~^{1/6} line Sec. 27
 G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

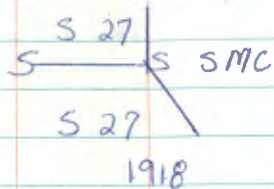

Mound of stone 2½' base 1½' high West of Cor.

Angle Point 2 of Allotment 1567 Sec. 27

G.L.V. Resurvey notes of 1918

Iron post 3' long 1" diam. With brass cap marked

AP2

TR

1567

1918

Angle Point 3 of Allotment 1325 Sec. 27

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

AD3

TR

1325

TR


1567

1918

Witness Cor. to the true point for Special
Meander Cor. Sec. 27

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

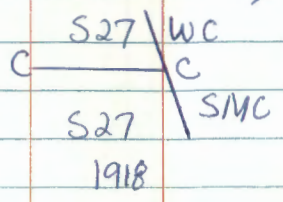

Tamalack 4" N37°W 14 1/2 - 9.24'

Tamalack 3" S88°W 3 1/2 - 1.98'

Angle Point 2 of Allotment 1325 Sec. 27

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

TR 1322.

AP2

TR1325

1918

Special Meander Cor. Sec. 27

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

S27 S.M.C
N ————— N

S27

1918

Poplar 12" N59 $\frac{1}{4}$ °W 54 1/3 - 35.64'

Poplar 12" S75°W 45 1/3 - 29.70'

Meander Cot. Secs. 32-33

G. L. O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap mounted

T142N | R30W

S32 | S33

MC

1917

J. Pine 5" N5° W 151 lks - 99.66'

R. Oak 4" N14½° E 28 lks - 18.48'

South 1/16 Cor. Secs. 32-33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked 12/16/92 Krause & GRAMAS 1/16

Fd. 6.0 iron pipe with S 32 S 33

B.C. set firmly in the
ground. B.C. set 2" above
ground.

N. Pine 4" S $10\frac{1}{2}^{\circ}$ E 71.185 - 46.86'

Fd. ^{21"}N. Pine snag S 5 E at 47.6' to center of

J. Pine 6" N $23\frac{1}{4}^{\circ}$ W 187.185 - 123.42'

Fd. J. Pine WINDFALL at N 23 W, 123.42'. Scribed rotted

Placed a F.S.L.P. on a 5" W. OAK, S 15 W
26.6' to 600 spike.

CHAINED S 89 E 1315'. Distance checked good.
Line fell about 2' south of my line.
Found a F.S.L.P. on a 12" Aspen 2' east of
corner by Leo Withhoff.

Quarter Cor. Secs. 32-33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. With brass cap
marked

2/24/93 BRAMA, Austk, S32 | S33

Rorick - Fd. GLO iron

with brass cap set 1917

under ground 2".

Birch 4" S32°E 87 lks - 57.42'

Birch 3" N70°W 42 lks - 27.02'

Placed a FSLP on a 10" Red OAK S86W


18" from corner. Corner is approx. 5'
west of center of an old township road.

Corner is on west edge of old road.

Chained from NW corner of section 33
south down old road 2555.5.

CC DONE

51

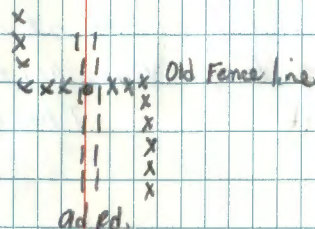

Meander Cot. Secs. 28-33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked

T142N R30W

S28 / me

S33 /

1917

Tamarack 12" S79°W 16 1/2 - 10.56'

Quarter Cor. Secs. 28-33

G. L. O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked

S 28

$\frac{1}{4}$ ———

S 33

1917

Cedar 6" N $19\frac{1}{2}^{\circ}$ E 10 IKS - 6.60'
New 9 $\frac{1}{2}$ " @ BRG & DIST

Cedar 8" S $20\frac{1}{2}^{\circ}$ E 12 IKS - 7.92'
New 13" @ BRG & DIST

10-20-1975 L. WITTHOFT

PLACE CEDAR POST ALONG EAST SIDE OF BRASS CAP. PLACE
TAG 54-6 ON POST. Fd FOREST SERVICE TAG ON
NORTH BT by MOORE 1936. PLACE BT TAGS 54-3
ON BTS

4-4-2000 R. MAIN

Fd IRON IN PLACE IN CEDAR SWAMP FLUSH/W/GROUND
MONUMENT \pm 460 FT EAST OF GRASSY OPENING
AT THE END OF FR

NEW BT CEDAR 5 $\frac{1}{2}$ " S 79° E 10.3 FT GROUND MKD: X BT

Center $\frac{1}{4}$ Cor. Sec. 33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap marked

C $\frac{1}{4}$ S33

1917


Mound of Stone 3' base $1\frac{1}{2}$ ' high West of
Corner

Go To BK #6 Pg #44

Center East 1/16 Cor. Sec. 33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked



S33

1917

R.Oak 5" N41 1/2° E 255 1/3 - 168.30'

W.Oak 11" N18° W 382 1/3 - 252.12'

Go To BK #6 Pg 43

South East 1/16 Cor. Sec. 33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap marked

SE 1/16 S33

1917

R. Dak 10" S14 $\frac{1}{2}$ $^{\circ}$ E 236 1K5 - 155.76'

R. Dak 12" N24 $\frac{1}{4}$ $^{\circ}$ W 276 1K5 - 182.16'

North East 1/16 Cor. Sec. 33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked

NE 1/16 S33

1917

Basswood 8" N82 $\frac{1}{2}$ °E 120 IXS - 79.20'

W. Oak 8" S15 $\frac{1}{4}$ °E 191 IXS - 126.06'

3-27-2000 R. MAIN

Fd GLO IRON IN PLACE BENT OVER IN WOODS

TRAIL. Young ASPEN TO NORTHWEST MIXED

HARDWOODS IN OTHER QUADRANTS. WOOD TRAIL

GOES WEST, NORTH & SOUTHEAST FROM CORNER.

Old FENCE LINE \pm 30 FT SOUTH OF CORNER.

LINE TO STANDARD SOUTH AND EAST OF CORNER.

WITNESS WITH:

R OAK 10 S14W 55.48 FT TO SPK MKD: 53 BT

R OAK 11 S53E 46.57 FT TO SPK MKD: 53 BT

MAPLE 8 N50W 46.75 FT TO SPK MKD: 53 BT

8 FT STEEL SIGN POSTS 12.2 EAST 7.7 SOUTH

N=17108925.898

E=1272719.47

REAL TIME GPS

NAD 83 UTM FT

57

3-28-2000 R MAIN

PULL AND STRAIGHTEN GLO IRON. MONUMENT 1 INCH


UNDER ROAD SURFACE. PLACE TWO '1'X1' ROCKS

@ ROAD SURFACE TO HELP PROTECT MONUMENTS

Special Meander Cor. Sec. 33

G. L. O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked

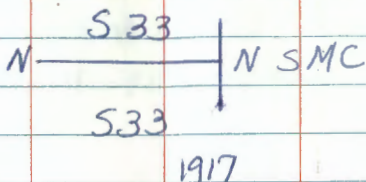

Cedar 6" S45°W 27 1/2 - 17.82'

Cedar 7" N24°W 11 1/2 - 7.26'

South West 1/16 Cor. Sec. 33

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked 2/24/93 BRAMA, Ausk SW 1/16 S33

Perick - Fd. GLO brass 1917

cap a iron pipe set firmly in the ground, 4" High


Mound of stone 2' base 1 1/2' high, West
of Cor.

Placed a F.S.L.P. on 7" White Oak S1E 47' from
corner.

CE DONE CK

59

2/24/93 Chained N1E 1287' from this corner
and intersected compass line from W 1/4 of
sec. 33. Line fell 45' west of chained
distance of 1306'. Placed a F.S.L.P. on a old
fence post saying approx. CW 1/16 is S4E, 14'
to our intersection of our lines.

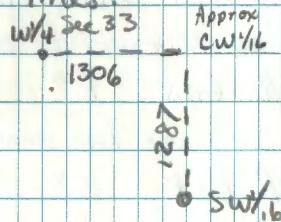

South 1/16 Cor. Secs. 28-29

G. L. O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked

S 1/16

7/9/92 GB-CK

S 29 528

FD. IRON & CAP BENT - 16" BELOW

GROUND - REMOVED FOR ROAD 1917

CONSTRUCTION TO SOUTH

W. Oak 8" S38°W 106 LKS - 69.96'

DISTANCE AND BEARING FALLS IN DITCH OF CO. 153

R. Oak 5" N103°E 384 LKS - 253.44'

Falls in powerline clearing - FD. no evidence

MARKED NEW TIES TO CORNER POSITION

PLACED MAGNETIC PELLET 4' BELOW GROUND

R. OAK 11 N42E 98.20' SPK & TAG

R. OAK 12 S51E 66.20' " "

R. OAK 12 S83E 61.78' " "

CORNER IS APPROX. 40' EAST OF COUNTY ROAD

153 IN ROAD + POWERLINE CLEARING

8' STEEL SIGN POST 2.3 NORTH

11-2-92 GB-CK

RESET GLO 1" IRON FLUSH WITH GROUND

MAG. PELLET JUST BELOW FLANGES

MARKED BT TODAY

S 1/16 S28 BT SPK & TAGGED

CORNER AT TOP OF BACKSLOPE OF COUNTY ROAD 153

AND NORTH OF NEW DRIVEWAY AND ROAD SOUTH

Quarter Cor. Secs. 28-29

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass

cap marked

10/24/89 CK, MEH, BB

529 | 528

Found 610 iron pipe with

brass cap set 4" above

1917

ground

J. Pine 10" N13°E 41.1K5 - 27.06'

Fd. well rotted stump with faint scribble at ^{brg. ing} dist.

J. Pine 10" S48½°W 40.1K5 - 26.40'

Fd. well rotted stump at brging + dist.

Mkd New BT's:

Norway Pine 13" N55E 57.67 ¼ 528 BT

Norway Pine 20" S37W 8.25 ¼ 529 BT


Norway Pine 14" N30W 28.2 ¼ 529 BT

Placed 8' steel sign posts north 3.85'
and south 3.85' with both signs at

line to standard north C.C. Done

A old road is approx. 35' east of corner.

Recent clearcut to the SW

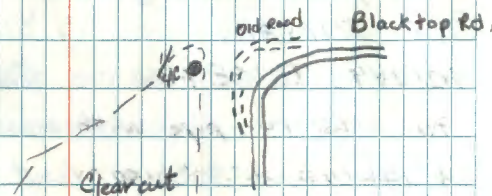

North 1/16 Cor. Secs. 28-29

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass

Cap marked N1/16

10/24/89 CK, GB, MEH 529 528

Fd. GLO iron pipe with brass

Cap leaning and 30" high. Reset 1917

monument from GLO Oak BT. Brass cap 7" above ground.

Tamarack 8" $566^{\frac{30}{4}}E$ 41 1K5 - 27.06'

Fd. no evidence

W. Oak 7" $562^{\circ}W$ 60 1K5 - 39.60'

Fd. 18" W. Oak $562^{\circ}W$ at 39.6 Scar visible

Mkd New BT's:

W. OAK 12" S2W 90.7' N1/16 529 BT

N. PINE 16" S86W 98.8' N1/16 529 BT

8' steel sign posts south 3.80' and
east 4.05' from corner with signs att.

Line to standard south + east, (1990)

C.C. Dore

Chained from 1/4 corner NW 1310.7'. Distance
checked good & bearing was good. Found old N-S
fence line 6' east of corner.

Beaver pond to the north and east from
corner. Corner is on the edge.

Sec. Cor. Secs. 20-21-28-29

G.L.O. Resurvey notes of 1917

Iron post 3' long 2" diam. with brass
cap marked

T 142 N R 30 W

S 20 | S 21

S 29 | S 28

1917

Tamarack 6" N 64 $\frac{1}{2}$ ° E 64 KS - 42.24'

Tamarack 5" S 52° E 26 KS - 17.16'

Tamarack 6" S 27 $\frac{1}{2}$ ° W 32 KS - 21.12'

Tamarack 5" N 41 $\frac{1}{4}$ ° W 32 KS - 21.12'

East 1/16 Cor. Secs. 21-28

C.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass
cap marked

E 1/16 521

528

1918

Poplar 9" N75 $\frac{1}{2}$ °E 37 1/2 - 24.42'

Poplar 6" S17°W 51 1/2 - 33.66'

Meander Cor. Secs. 21-28 (E. shore Mud L.)

G.L.V. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

T 142N

MC | 521
528

R 30 W

1918


Poplar 8" N24½°E 42 1/2 - 27.72'

Cedar 10" S30°E 66 1/2 - 43.56'

Meander Cor. and Witness Cor. to Angle Point
2 of Allotment 1340 and Angle Point 1 of
Allotment 1313

G.L.O. Resurvey notes of 1918


Iron post 3' long 1" diam. with brass cap mounted
WC

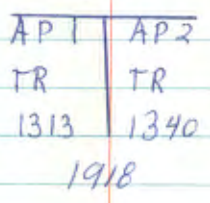

Center South 1/16 Cor. Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

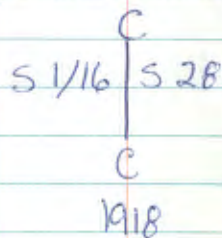

Poplar 9" N19 1/2° E 34 1/2 S - 22.44'

Poplar 9" N15 1/4° W 62 1/2 S - 40.92'

Angle Point 3 of Allotment 1567 Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass

Cap marked

AD3

TR

TR

1567

1297

1918

Center $\frac{1}{4}$ Cor. Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

C $\frac{1}{4}$ S 28

1918

W. Pine 18" N70°E 62 1/2 - 40.92'

Poplar 8" N50 $\frac{1}{2}$ °W 225 1/2 - 148.50'

5/4/90 G.B. - See Field Book #6 for re-monumentation
of this corner. page 35

Center East 1/16 Cor. Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

E 1/16
C ————— C

S 28

1918

Tamarack 8" S 66° E 191x5 - 12.54'

Tamarack 6" N ~~38~~³³ 3/4° E 141x5 - 9.24'

Angle Point 4 of Allotment 1345 Sec. 28

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

AP4

TR

1345

TR 1567

1918

Angle Point 7 of Allotment 1726 Sec 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass

cap marked AP7

10/31/89 - CK, GB, MEH TR

Chained down E-W 1726

blacktop road from TR 1297

west 1/4 of sec 28. S 28

Searched for this 1918

corner, but found no evidence.

Ran survey traverse for re-establishment
of this corner. See traverse book - this time.

Set a 2 1/2" x 24" long galv. iron pipe
with brass cap marked.

Mon. is set under AP7

blacktop road in centerline TR

1726

TR 1297

S 28

1990

U.S.F.S.

5/4/90 GB

Mkd. BT's:

1. R. OAK 16" N 49 E 85.50 AP7 S 28 BT

2. R. OAK 9" S 20 E 71.00 S 28 BT

3. R. OAK 10" S 5 W 91.3 S 28 BT

(1990) Line to standard runs north from this corner

651.38' WEST OF C 1/4 SEC. 28

Center West 1/16 Cor. Sec. 28

G. L. O. Resurvey notes of 1918

Iron post 3" long 1" diam. with brass cap
marked

W 1/16

NO DRAW WITH LOCATOR

C ————— C

COULD BE FOUND - COULD BE S 28

UNDER 5' OF FILL AT THIS 1918

LOCATION

Poplar 3" N49°E 48 IKS - 31.68'

NO EVIDENCE REMAINS

W. Oak 6" S6½°E 196 IKS - 129.36'

NO EVIDENCE REMAINS

10/31/89 - CK, GB, MEH

Chained down E-W blacktop road from
the west ¼ corner of sec 28. Found no evidence
of this corner position. Ran traverse for
re-establishment of this corner. See traverse log.

Set a 2½" x 24" long galv. iron pipe with
brass mkd. Monument is set T142N R30W
under blacktop road 1' south of

C ————— W 1/16 C

S 28

1990

U.S. F.S.

5/29/90 - GB marked new BT's:

1. MAPLE 7" S30 E 85.35 CW 1/16 S 28 BT

2. R. OAK 10" S3 W 55.57 CW 1/16 S 28 BT

3. Ash 4" N52W 90.07 CW 1/16 S 28 BT

8" steel sign post north 47.55 Both signs at
C. E. Done

Line to standard done in 1990 runs north from corner.

Angle Point 9 of Allotment 1584 and Angle
Point 2 of Allotment 1297 Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

AP9

TR

1584

AP2

TR

1297

S28

1918

Angle Point 4 of Allotment 1567 Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

AD4

TR

1567

S 28

1918

North East 1/16 Cor. Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

NE 1/16 S28

1918

Poplar 7" N33° E 44 IKS - 29.04'

Poplar 7" N55½° W 39 IKS - 25.74'

Angle Point 5 of Allotment 1345 Sec. 28

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

TR

1345

S 28

1918

AP5

Angle Point 3 of Allotment 1297 and Angle
Point 8 of Allotment 1584 Sec. 28

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass
cap marked

| | |
|------|------|
| AP 8 | AP 3 |
|------|------|

| | |
|----|----|
| TR | TR |
|----|----|

| | |
|------|------|
| 1584 | 1297 |
|------|------|

S 28

1918

U, V-14 AP1, TR1283-AP6 TR1567 - TR1324

1918 GLO SURVEY Pg 61

SET AN IRON POST 3 FT X 1" Z6 ENCLAS IN

THE GROUND WITH BRASS CAP MKD: AP6

| | |
|------|------|
| TR | |
| 1567 | TR |
| AP1 | 1324 |
| TR | |
| 1283 | |
| 1918 | |

8/18 R. SELBAUGH

Fd I.P. IN GOOD CONDITION SET A
STEEL SIGN POST 2.55 FT SOUTH OF I.P.

3/11/1980 G. BRAMA S. HARE

Fd I.P. 8" AND SIGN POST PLACED BY
SELBAUGH IN PLACE. TRAIL SOUTH OF CORNER
± 100 FT RUNS EAST & WEST.

WITNESSED BY:

ROAK 15 S85W 50.6 FT MKD: TR1283

ROAK 10 S63E 62.15 FT MKD: TR1324

ROAK 14 N32W 41.15 FT MKD: TR1567

STEEL SIGN POST SOUTH 2.55 FT WEST?